

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 009 UpperBedB/C									
093	A	Wall	L Ctr		I	Drywall	White	0.0	QM
106	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
094	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
095	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
098	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
097	C	Ceiling			I	Drywall	White	-0.1	QM
102	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
103	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
104	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
105	C	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
096	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
100	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
099	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
101	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
Interior Room 010 UpperBedC/D									
107	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
114	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
113	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
115	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
108	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
109	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
111	C	Ceiling			I	Drywall	White	-0.2	QM
116	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
117	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
118	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
110	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 011 UpperHall									
119	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
129	A	Attic Hatch	Ctr		I	Wood	White	-0.2	QM
130	A	Attic Casing	Ctr		I	Wood	White	-0.2	QM
120	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
121	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
124	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
123	C	Ceiling			I	Drywall	White	-0.2	QM
122	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
126	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
125	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
127	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
128	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/05/13 09:24
 Total Reading Sets: 130
 Job Started: 09/05/13 09:24
 Job Finished: 09/05/13 09:59

USCG Elizabeth City
 Housing Units
 208 Albatross Street- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Attic Hatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	9	0 <0%>	9 <100%>	0 <0%>	
Cabinet	3	0 <0%>	3 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	10	0 <0%>	10 <100%>	0 <0%>	
Door Rgt jamb	10	0 <0%>	10 <100%>	0 <0%>	
Door U Ctr	10	0 <0%>	10 <100%>	0 <0%>	
DoorStop	2	0 <0%>	2 <100%>	0 <0%>	
Mini Blinds	1	0 <0%>	1 <100%>	0 <0%>	
Sink	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	46	2 <4%>	44 <96%>	0 <0%>	
Window Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Window Sash	6	0 <0%>	6 <100%>	0 <0%>	
Window Sill	6	0 <0%>	6 <100%>	0 <0%>	
Inspection Totals:	130	2 < 2%>	128 < 98%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 08:31

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
204 Albatross Street- Interior


INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____

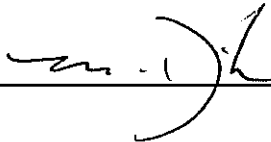

Date: _____

9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13

Report Date: 9/13/2013

Abatement Level: 1.0

Report No. 09/05/13 08:31

Total Readings: 141 Actionable: 2

Job Started: 09/05/13 08:31

Job Finished: 09/05/13 09:19

USCG Elizabeth City

Housing Units

204 Albatross Street- Interior

Reading					Paint			Lead	Mode
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	
Interior Room 008 MasterBath									
088	A	Wall	L Lft		I	Ceramic	Tan	6.3	QM
Interior Room 009 UpperBath									
099	A	Wall	L Lft		I	Ceramic	Tan	6.9	QM
Calibration Readings									
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Mini Blinds		Rgt	I	Vinyl	White	0.0	QM
49	005	Bathroom	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
50	005	Bathroom	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
51	005	Bathroom	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
52	005	Bathroom	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
53	005	Bathroom	C	Ceiling			I	Drywall	White	-0.1	QM
54	005	Bathroom	B	Baseboard		Ctr	I	Wood	White	0.0	QM
55	005	Bathroom	B	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
56	005	Bathroom	B	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
57	005	Bathroom	D	Cabinet		Lft	I	Wood	White	-0.1	QM
58	006	UpperHall	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
59	006	UpperHall	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
60	006	UpperHall	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
61	006	UpperHall	D	Wall		L Ctr	I	Drywall	White	-0.2	QM
62	006	UpperHall	C	Ceiling			I	Drywall	White	-0.2	QM
63	006	UpperHall	A	Wall		L Ctr	I	Wood	White	-0.1	QM
64	006	UpperHall	D	Closet		Ctr Door Casing	I	Wood	White	-0.2	QM
65	006	UpperHall	D	Closet		Ctr Door	I	Wood	White	0.0	QM
66	006	UpperHall	D	Closet		Ctr Shelf	I	Wood	White	-0.2	QM
67	006	UpperHall	D	Stairs		Rgt Wall	I	Wood	White	0.0	QM
68	006	UpperHall	A	AccessHatch		Ctr	I	Wood	White	-0.2	QM
69	006	UpperHall	A	Attic Casing		Ctr	I	Wood	White	-0.1	QM
70	007	UpperBedA/B	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
71	007	UpperBedA/B	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
72	007	UpperBedA/B	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
73	007	UpperBedA/B	D	Wall		L Ctr	I	Drywall	White	0.0	QM
74	007	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.1	QM
75	007	UpperBedA/B	A	Baseboard		Ctr	I	Wood	White	0.0	QM
76	007	UpperBedA/B	D	Door		Lft Rgt jamb	I	Wood	White	0.1	QM
77	007	UpperBedA/B	D	Door		Lft U Ctr	I	Wood	White	0.0	QM
78	007	UpperBedA/B	A	Window		Ctr Sash	I	Wood	White	-0.1	QM
79	007	UpperBedA/B	A	Window		Ctr Sill	I	Wood	White	-0.1	QM
80	007	UpperBedA/B	A	Mini Blinds		Ctr	I	Vinyl	White	0.0	QM
81	007	UpperBedA/B	D	Closet		Rgt Door	I	Wood	White	-0.3	QM
82	007	UpperBedA/B	D	Closet		Rgt Shelf	I	Wood	White	-0.3	QM
83	008	MasterBath	A	Wall		U Ctr	I	Drywall	White	-0.1	QM
84	008	MasterBath	B	Wall		U Ctr	I	Drywall	White	-0.2	QM
85	008	MasterBath	C	Wall		U Ctr	I	Drywall	White	-0.2	QM
86	008	MasterBath	D	Wall		U Ctr	I	Drywall	White	-0.1	QM
87	008	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
88	008	MasterBath	A	Wall		L Lft	I	Ceramic	Tan	6.3	QM
89	008	MasterBath	A	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
90	008	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
91	008	MasterBath	D	Cabinet		Lft	I	Wood	White	-0.1	QM
92	008	MasterBath	D	Sink		Lft	I	Porcelain	White	-0.1	QM
93	008	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.3	QM
94	009	UpperBath	A	Wall		U Ctr	I	Drywall	White	-0.1	QM
95	009	UpperBath	B	Wall		U Ctr	I	Drywall	White	-0.1	QM
96	009	UpperBath	C	Wall		U Ctr	I	Drywall	White	-0.2	QM
97	009	UpperBath	D	Wall		U Ctr	I	Drywall	White	-0.1	QM
98	009	UpperBath	C	Ceiling			I	Drywall	White	-0.1	QM
99	009	UpperBath	A	Wall		L Lft	I	Ceramic	Tan	6.9	QM
100	009	UpperBath	D	Door		Ctr Rgt casing	I	Wood	White	0.0	QM
101	009	UpperBath	D	Door		Ctr U Ctr	I	Wood	White	-0.1	QM
102	009	UpperBath	B	Cabinet		Rgt	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Mini Blinds		Rgt	I	Vinyl	White	0.0	QM
49	005	Bathroom	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
50	005	Bathroom	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
51	005	Bathroom	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
52	005	Bathroom	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
53	005	Bathroom	C	Ceiling			I	Drywall	White	-0.1	QM
54	005	Bathroom	B	Baseboard		Ctr	I	Wood	White	0.0	QM
55	005	Bathroom	B	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
56	005	Bathroom	B	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
57	005	Bathroom	D	Cabinet		Lft	I	Wood	White	-0.1	QM
58	006	UpperHall	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
59	006	UpperHall	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
60	006	UpperHall	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
61	006	UpperHall	D	Wall		L Ctr	I	Drywall	White	-0.2	QM
62	006	UpperHall	C	Ceiling			I	Drywall	White	-0.2	QM
63	006	UpperHall	A	Wall		L Ctr	I	Wood	White	-0.1	QM
64	006	UpperHall	D	Closet		Ctr Door Casing	I	Wood	White	-0.2	QM
65	006	UpperHall	D	Closet		Ctr Door	I	Wood	White	0.0	QM
66	006	UpperHall	D	Closet		Ctr Shelf	I	Wood	White	-0.2	QM
67	006	UpperHall	D	Stairs		Rgt Wall	I	Wood	White	0.0	QM
68	006	UpperHall	A	AccessHatch		Ctr	I	Wood	White	-0.2	QM
69	006	UpperHall	A	Attic Casing		Ctr	I	Wood	White	-0.1	QM
70	007	UpperBedA/B	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
71	007	UpperBedA/B	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
72	007	UpperBedA/B	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
73	007	UpperBedA/B	D	Wall		L Ctr	I	Drywall	White	0.0	QM
74	007	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.1	QM
75	007	UpperBedA/B	A	Baseboard		Ctr	I	Wood	White	0.0	QM
76	007	UpperBedA/B	D	Door		Lft Rgt jamb	I	Wood	White	0.1	QM
77	007	UpperBedA/B	D	Door		Lft U Ctr	I	Wood	White	0.0	QM
78	007	UpperBedA/B	A	Window		Ctr Sash	I	Wood	White	-0.1	QM
79	007	UpperBedA/B	A	Window		Ctr Sill	I	Wood	White	-0.1	QM
80	007	UpperBedA/B	A	Mini Blinds		Ctr	I	Vinyl	White	0.0	QM
81	007	UpperBedA/B	D	Closet		Rgt Door	I	Wood	White	-0.3	QM
82	007	UpperBedA/B	D	Closet		Rgt Shelf	I	Wood	White	-0.3	QM
83	008	MasterBath	A	Wall		U Ctr	I	Drywall	White	-0.1	QM
84	008	MasterBath	B	Wall		U Ctr	I	Drywall	White	-0.2	QM
85	008	MasterBath	C	Wall		U Ctr	I	Drywall	White	-0.2	QM
86	008	MasterBath	D	Wall		U Ctr	I	Drywall	White	-0.1	QM
87	008	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
88	008	MasterBath	A	Wall		L Lft	I	Ceramic	Tan	6.3	QM
89	008	MasterBath	A	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
90	008	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
91	008	MasterBath	D	Cabinet		Lft	I	Wood	White	-0.1	QM
92	008	MasterBath	D	Sink		Lft	I	Porcelain	White	-0.1	QM
93	008	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.3	QM
94	009	UpperBath	A	Wall		U Ctr	I	Drywall	White	-0.1	QM
95	009	UpperBath	B	Wall		U Ctr	I	Drywall	White	-0.1	QM
96	009	UpperBath	C	Wall		U Ctr	I	Drywall	White	-0.2	QM
97	009	UpperBath	D	Wall		U Ctr	I	Drywall	White	-0.1	QM
98	009	UpperBath	C	Ceiling			I	Drywall	White	-0.1	QM
99	009	UpperBath	A	Wall		L Lft	I	Ceramic	Tan	6.9	QM
100	009	UpperBath	D	Door		Ctr Rgt casing	I	Wood	White	0.0	QM
101	009	UpperBath	D	Door		Ctr U Ctr	I	Wood	White	-0.1	QM
102	009	UpperBath	B	Cabinet		Rgt	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
103	009	UpperBath	B	Sink		Rgt	I	Porcelain	White	-0.1	QM
104	009	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.3	QM
105	010	UpperBedB/C	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
106	010	UpperBedB/C	B	Wall		L Ctr	I	Drywall	White	0.0	QM
107	010	UpperBedB/C	C	Wall		L Ctr	I	Drywall	White	-0.2	QM
108	010	UpperBedB/C	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
109	010	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.1	QM
110	010	UpperBedB/C	A	Baseboard		Ctr	I	Wood	White	-0.1	QM
111	010	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
112	010	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
113	010	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.1	QM
114	010	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	0.0	QM
115	010	UpperBedB/C	C	Mini Blinds		Ctr	I	Vinyl	White	0.0	QM
116	010	UpperBedB/C	D	Closet		Ctr Door	I	Wood	White	-0.1	QM
117	010	UpperBedB/C	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.3	QM
118	011	UpperBedC/D	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
119	011	UpperBedC/D	B	Wall		L Ctr	I	Drywall	White	-0.2	QM
120	011	UpperBedC/D	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
121	011	UpperBedC/D	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
122	011	UpperBedC/D	C	Ceiling			I	Drywall	White	0.1	QM
123	011	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	0.0	QM
124	011	UpperBedC/D	B	Door		Lft Rgt jamb	I	Wood	White	-0.1	QM
125	011	UpperBedC/D	B	Door		Lft U Ctr	I	Wood	White	-0.1	QM
126	011	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.1	QM
127	011	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	-0.1	QM
128	011	UpperBedC/D	A	Closet		Ctr Door	I	Wood	White	-0.1	QM
129	011	UpperBedC/D	A	Closet		Ctr Shelf	I	Wood	White	-0.1	QM
130	012	UpperBedD/A	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
131	012	UpperBedD/A	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
132	012	UpperBedD/A	C	Wall		L Ctr	I	Drywall	White	-0.2	QM
133	012	UpperBedD/A	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
134	012	UpperBedD/A	C	Ceiling			I	Drywall	White	-0.1	QM
135	012	UpperBedD/A	A	Baseboard		Ctr	I	Wood	White	-0.1	QM
136	012	UpperBedD/A	B	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
137	012	UpperBedD/A	B	Door		Lft U Ctr	I	Wood	White	-0.1	QM
138	012	UpperBedD/A	A	Window		Rgt Rgt casing	I	Wood	White	-0.2	QM
139	012	UpperBedD/A	A	Window		Rgt Sash	I	Wood	White	-0.2	QM
140	012	UpperBedD/A	A	Closet		Lft Door	I	Wood	White	-0.3	QM
141	012	UpperBedD/A	A	Closet		Lft Shelf	I	Wood	White	-0.3	QM
----- End of Readings -----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/05/13 08:31
 Total Readings: 141
 Job Started: 09/05/13 08:31
 Job Finished: 09/05/13 09:19

USCG Elizabeth City
 Housing Units
 204 Albatross Street- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
007	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
013	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
014	A	Door	Ctr	U Ctr	I	Metal	White	0.1	QM
008	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
009	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
011	C	Ceiling			I	Drywall	White	-0.2	QM
010	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
012	D	Baseboard	Ctr		I	Wood	White	0.0	QM
020	D	Stairs	Lft	Treads	I	Wood	Varnish	0.1	QM
018	D	Stairs	Lft	Risers	I	Wood	White	-0.1	QM
019	D	Stairs	Lft	Stringer	I	Wood	White	-0.1	QM
015	D	Closet	Ctr	Door	I	Wood	White	0.0	QM
016	D	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
017	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
Interior Room 002 Bedroom A/B									
021	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
026	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
029	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
030	A	Window	Ctr	Sash	I	Wood	White	0.1	QM
022	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
023	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
025	C	Ceiling			I	Drywall	White	-0.2	QM
024	D	Wall	L Ctr		I	Drywall	White	0.1	QM
027	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
028	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
031	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
037	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
032	B	Wall	L Ctr		I	Drywall	White	0.0	QM
033	C	Wall	L Ctr		I	Drywall	White	0.1	QM
036	C	Baseboard	Lft		I	Vinyl	Black	-0.1	QM
035	C	Ceiling			I	Drywall	White	0.0	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Living/Din									
038	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
039	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
043	B	Baseboard	Ctr		I	Wood	White	-0.2	QM
040	C	Wall	L Ctr		I	Drywall	White	0.0	QM
042	C	Ceiling			I	Drywall	White	0.0	QM
046	C	Window	Rgt	Rgt casing	I	Wood	White	0.1	QM
047	C	Window	Rgt	Sash	I	Vinyl	White	-0.1	QM
044	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
045	C	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
048	C	Mini Blinds	Rgt		I	Vinyl	White	0.0	QM
041	D	Wall	L Ctr		I	Drywall	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 005 Bathroom									
049	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
050	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
054	B	Baseboard	Ctr		I	Wood	White	0.0	QM
055	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
056	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
051	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
053	C	Ceiling			I	Drywall	White	-0.1	QM
052	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
057	D	Cabinet	Lft		I	Wood	White	-0.1	QM
Interior Room 006 UpperHall									
058	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
063	A	Wall	L Ctr		I	Wood	White	-0.1	QM
068	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
069	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
059	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
060	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
062	C	Ceiling			I	Drywall	White	-0.2	QM
061	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
067	D	Stairs	Rgt	Wall	I	Wood	White	0.0	QM
065	D	Closet	Ctr	Door	I	Wood	White	0.0	QM
064	D	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
066	D	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
Interior Room 007 UpperBedA/B									
070	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
075	A	Baseboard	Ctr		I	Wood	White	0.0	QM
078	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
079	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
080	A	Mini Blinds	Ctr		I	Vinyl	White	0.0	QM
071	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
072	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
074	C	Ceiling			I	Drywall	White	-0.1	QM
073	D	Wall	L Ctr		I	Drywall	White	0.0	QM
076	D	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
077	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
081	D	Closet	Rgt	Door	I	Wood	White	-0.3	QM
082	D	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
Interior Room 008 MasterBath									
088	A	Wall	L Lft		I	Ceramic	Tan	6.3	QM
083	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
089	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
090	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
084	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
085	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
087	C	Ceiling			I	Drywall	White	-0.1	QM
093	C	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
086	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
091	D	Cabinet	Lft		I	Wood	White	-0.1	QM
092	D	Sink	Lft		I	Porcelain	White	-0.1	QM
Interior Room 009 UpperBath									
099	A	Wall	L Lft		I	Ceramic	Tan	6.9	QM
094	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
104	A	Bathtub	Ctr		I	Porcelain	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
095	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
102	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
103	B	Sink	Rgt		I	Porcelain	White	-0.1	QM
096	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
098	C	Ceiling			I	Drywall	White	-0.1	QM
097	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
100	D	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
101	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
Interior Room 010 UpperBedB/C									
105	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
110	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
106	B	Wall	L Ctr		I	Drywall	White	0.0	QM
107	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
109	C	Ceiling			I	Drywall	White	-0.1	QM
113	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
114	C	Window	Ctr	Sill	I	Wood	White	0.0	QM
115	C	Mini Blinds	Ctr		I	Vinyl	White	0.0	QM
108	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
111	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
112	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
116	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
117	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
Interior Room 011 UpperBedC/D									
118	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
128	A	Closet	Ctr	Door	I	Wood	White	-0.1	QM
129	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
119	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
124	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
125	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
120	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
123	C	Baseboard	Ctr		I	Wood	White	0.0	QM
122	C	Ceiling			I	Drywall	White	0.1	QM
126	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
127	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
121	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 012 UpperBedD/A									
130	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
135	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
138	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
139	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
140	A	Closet	Lft	Door	I	Wood	White	-0.3	QM
141	A	Closet	Lft	Shelf	I	Wood	White	-0.3	QM
131	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
136	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
137	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
132	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
134	C	Ceiling			I	Drywall	White	-0.1	QM
133	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
005								0.0	QM
006								0.4	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/05/13 08:31
 Total Reading Sets: 135
 Job Started: 09/05/13 08:31
 Job Finished: 09/05/13 09:19

USCG Elizabeth City
 Housing Units
 204 Albatross Street- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
AccessHatch	1	0 <0%>	1 <100%>	0 <0%>	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	9	0 <0%>	9 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	12	0 <0%>	12 <100%>	0 <0%>	
Closet Door	6	0 <0%>	6 <100%>	0 <0%>	
Closet Door Casing	2	0 <0%>	2 <100%>	0 <0%>	
Closet Shelf	5	0 <0%>	5 <100%>	0 <0%>	
Closet Shelf Sup.	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Door Rgt jamb	4	0 <0%>	4 <100%>	0 <0%>	
Door U Ctr	10	0 <0%>	10 <100%>	0 <0%>	
Mini Blinds	3	0 <0%>	3 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	51	2 <4%>	49 <96%>	0 <0%>	
Window Rgt casing	3	0 <0%>	3 <100%>	0 <0%>	
Window Sash	6	0 <0%>	6 <100%>	0 <0%>	
Window Sill	3	0 <0%>	3 <100%>	0 <0%>	
Inspection Totals:	135	2 < 1%>	133 < 99%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 10:33

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
251 Gulfstream Drive- Interior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____



Date: _____

9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13 USCG Elizabeth City
Report Date: 9/13/2013 Housing Units
Abatement Level: 1.0 251 Gulfstream Drive- Interior
Report No. 09/03/13 10:33
Total Readings: 134 Actionable: 2
Job Started: 09/03/13 10:33
Job Finished: 09/03/13 11:28

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 006 MasterBath									
073	C	Wall	L Ctr		I	Ceramic	Tan	4.9	QM
Interior Room 009 UpperBath									
116	C	Wall	L Ctr		I	Ceramic	Tan	5.7	QM
Calibration Readings									
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 10:33
 Total Readings: 134
 Job Started: 09/03/13 10:33
 Job Finished: 09/03/13 11:28

USCG Elizabeth City
 Housing Units
 251 Gulfstream Drive- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1		CALIBRATION								1.0	QM
2		CALIBRATION								1.0	QM
3		CALIBRATION								1.0	QM
4		CALIBRATION								-0.9	QM
5		CALIBRATION								-1.1	QM
6		CALIBRATION								-0.9	QM
7	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
8	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
9	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
10	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
11	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.4	QM
12	001	Hall/Stairs	A	Door		Rgt Rgt casing	I	Wood	White	-0.2	QM
13	001	Hall/Stairs	A	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
14	001	Hall/Stairs	A	Door		Rgt U Rgt	I	Wood	White	-0.3	QM
15	001	Hall/Stairs	A	Window		Lft Rgt casing	I	Wood	White	0.1	QM
16	001	Hall/Stairs	A	Window		Lft Sill	I	Wood	White	-0.3	QM
17	001	Hall/Stairs	D	Door		Rgt Lft casing	I	Wood	White	-0.1	QM
18	001	Hall/Stairs	D	Door		Rgt Lft jamb	I	Wood	White	-0.3	QM
19	001	Hall/Stairs	D	Door		Rgt L Ctr	I	Wood	White	0.1	QM
20	002	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
21	002	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
22	002	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
23	002	Bathroom	D	Wall	L Ctr		I	Drywall	White	0.1	QM
24	002	Bathroom	C	Ceiling			I	Drywall	White	-0.2	QM
25	002	Bathroom	C	Baseboard		Ctr	I	Wood	White	0.0	QM
26	002	Bathroom	D	Door		Lft Rgt casing	I	Wood	White	-0.6	QM
27	002	Bathroom	D	Door		Lft Rgt jamb	I	Wood	White	-0.3	QM
28	002	Bathroom	D	Door		Lft U Ctr	I	Wood	White	-0.5	QM
29	002	Bathroom	B	Cabinet		Rgt	I	Wood	Varnish	-0.5	QM
30	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
31	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
32	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
33	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
34	003	Living/Din	C	Ceiling			I	Drywall	White	-0.1	QM
35	003	Living/Din	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
36	003	Living/Din	C	Door		Ctr Rgt casing	I	Wood	White	-0.1	QM
37	003	Living/Din	C	Door		Ctr Rgt jamb	I	Wood	White	0.1	QM
38	003	Living/Din	C	Door		Ctr U Ctr	I	Wood	White	-0.5	QM
39	003	Living/Din	C	Window		Lft Rgt casing	I	Wood	White	-0.4	QM
40	003	Living/Din	C	Window		Lft Sill	I	Wood	White	-0.3	QM
41	003	Living/Din	C	Window		Lft Sash	I	Vinyl	White	-0.1	QM
42	001	Hall/Stairs	C	Stairs		Ctr Stringer	I	Wood	White	-0.6	QM
43	001	Hall/Stairs	B	Stairs		Ctr Risers	I	Wood	White	-0.2	QM
44	001	Hall/Stairs	B	Stairs		Ctr Treads	I	Wood	Varnish	-0.2	QM
45	001	Hall/Stairs	A	Stairs		Ctr Railing cap	I	Wood	Varnish	-0.1	QM
46	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
47	004	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
48	004	Kitchen	C	Wall	L	Ctr	I	Drywall	White	-0.2	QM
49	004	Kitchen	D	Wall	L	Ctr	I	Drywall	White	-0.8	QM
50	004	Kitchen	C	Ceiling			I	Drywall	White	-0.6	QM
51	004	Kitchen	C	Baseboard		Ctr	I	Vinyl	Black	-0.2	QM
52	004	Kitchen	D	LowerCabinet		Ctr	I	Wood	Varnish	-0.8	QM
53	004	Kitchen	D	Cabinet		Ctr	I	Wood	Varnish	0.0	QM
54	005	UpperBedA	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
55	005	UpperBedA	B	Wall	L	Ctr	I	Drywall	White	-0.1	QM
56	005	UpperBedA	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
57	005	UpperBedA	D	Wall	L	Ctr	I	Drywall	White	-0.2	QM
58	005	UpperBedA	C	Ceiling			I	Drywall	White	-0.1	QM
59	005	UpperBedA	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
60	005	UpperBedA	C	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
61	005	UpperBedA	C	Door		Lft Rgt jamb	I	Wood	White	0.0	QM
62	005	UpperBedA	C	Door		Lft U Ctr	I	Wood	White	-0.3	QM
63	005	UpperBedA	A	Window		Rgt Rgt casing	I	Wood	White	-0.6	QM
64	005	UpperBedA	A	Window		Rgt Sash	I	Wood	White	-0.4	QM
65	005	UpperBedA	A	Window		Rgt Sill	I	Wood	White	-0.2	QM
66	005	UpperBedA	B	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
67	005	UpperBedA	B	Closet		Ctr Shelf Sup.	I	Wood	White	0.0	QM
68	006	MasterBath	A	Wall	U	Ctr	I	Drywall	White	-0.3	QM
69	006	MasterBath	B	Wall	U	Ctr	I	Drywall	White	-0.2	QM
70	006	MasterBath	C	Wall	U	Ctr	I	Drywall	White	-0.3	QM
71	006	MasterBath	D	Wall	U	Ctr	I	Drywall	White	-0.5	QM
72	006	MasterBath	C	Ceiling			I	Drywall	White	-0.2	QM
73	006	MasterBath	C	Wall	L	Ctr	I	Ceramic	Tan	4.9	QM
74	006	MasterBath	A	Door		Ctr Rgt casing	I	Wood	White	-0.2	QM
75	006	MasterBath	A	Door		Ctr Rgt jamb	I	Wood	White	-0.1	QM
76	006	MasterBath	A	Door		Ctr U Ctr	I	Wood	White	-0.5	QM
77	006	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.7	QM
78	006	MasterBath	B	Sink		Lft	I	Porcelain	White	-0.9	QM
79	006	MasterBath	B	Cabinet		Lft	I	Wood	White	-0.5	QM
80	007	UpperBedB/C	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
81	007	UpperBedB/C	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
82	007	UpperBedB/C	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
83	007	UpperBedB/C	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
84	007	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.6	QM
85	007	UpperBedB/C	C	Baseboard		Ctr	I	Wood	White	0.1	QM
86	007	UpperBedB/C	A	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
87	007	UpperBedB/C	A	Door		Lft Rgt jamb	I	Wood	White	-0.1	QM
88	007	UpperBedB/C	A	Door		Lft U Ctr	I	Wood	White	-0.1	QM
89	007	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.1	QM
90	007	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.1	QM
91	007	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	-0.2	QM
92	007	UpperBedB/C	A	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
93	007	UpperBedB/C	A	Closet		Ctr Shelf Sup.	I	Wood	White	-0.4	QM
94	008	UpperBedC/D	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
95	008	UpperBedC/D	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
96	008	UpperBedC/D	C	Wall	L	Ctr	I	Drywall	White	0.0	QM
97	008	UpperBedC/D	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
98	008	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.1	QM
99	008	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	0.1	QM
100	008	UpperBedC/D	B	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
101	008	UpperBedC/D	B	Door		Lft Rgt jamb	I	Wood	White	-0.1	QM
102	008	UpperBedC/D	B	Door		Lft U Ctr	I	Wood	White	-0.4	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	008	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	0.0	QM
104	008	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.3	QM
105	008	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	-0.4	QM
106	008	UpperBedC/D	A	Closet		Ctr Door Casing	I	Wood	White	-0.1	QM
107	008	UpperBedC/D	A	Closet		Ctr Door Jamb	I	Wood	White	-0.3	QM
108	008	UpperBedC/D	A	Closet		Ctr Door	I	Wood	White	-0.4	QM
109	008	UpperBedC/D	A	Closet		Ctr Shelf	I	Wood	White	-0.7	QM
110	008	UpperBedC/D	A	Closet		Ctr Shelf Sup.	I	Wood	White	-0.1	QM
111	009	UpperBath	A	Wall	U	Ctr	I	Drywall	White	-0.3	QM
112	009	UpperBath	B	Wall	U	Ctr	I	Drywall	White	0.0	QM
113	009	UpperBath	C	Wall	U	Ctr	I	Drywall	White	-0.3	QM
114	009	UpperBath	D	Wall	U	Ctr	I	Drywall	White	-0.5	QM
115	009	UpperBath	C	Ceiling			I	Drywall	White	-0.3	QM
116	009	UpperBath	C	Wall	L	Ctr	I	Ceramic	Tan	5.7	QM
117	009	UpperBath	B	Door		Ctr Rgt jamb	I	Wood	White	-0.1	QM
118	009	UpperBath	B	Door		Ctr U Ctr	I	Wood	White	-0.7	QM
119	009	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.3	QM
120	009	UpperBath	D	Sink		Lft	I	Porcelain	White	-0.5	QM
121	009	UpperBath	D	Cabinet		Lft	I	Wood	White	-0.7	QM
122	009	UpperBath	B	DoorStop		Ctr	I	Wood	Black	-0.2	QM
123	010	UpperHall	A	Wall	L	Ctr	I	Drywall	White	-0.5	QM
124	010	UpperHall	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
125	010	UpperHall	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
126	010	UpperHall	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
127	010	UpperHall	A	Ceiling			I	Drywall	White	-0.2	QM
128	010	UpperHall	C	Baseboard		Ctr	I	Wood	White	0.0	QM
129	010	UpperHall	D	Door		Ctr Rgt casing	I	Wood	White	-0.6	QM
130	010	UpperHall	D	Door		Ctr Rgt jamb	I	Wood	White	0.0	QM
131	010	UpperHall	D	Door		Ctr U Lft	I	Wood	White	-0.3	QM
132	010	UpperHall	B	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
133	010	UpperHall	B	Closet		Ctr Shelf Sup.	I	Wood	White	-0.3	QM
134	010	UpperHall	B	Stairs		Ctr Wall	I	Wood	White	0.1	QM
----- End of Readings -----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 10:33
 Total Readings: 134
 Job Started: 09/03/13 10:33
 Job Finished: 09/03/13 11:28

USCG Elizabeth City
 Housing Units
 251 Gulfstream Drive- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
007	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
015	A	Window	Lft	Rgt casing	I	Wood	White	0.1	QM
016	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
013	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
012	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
014	A	Door	Rgt	U Rgt	I	Wood	White	-0.3	QM
045	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
008	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
044	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
043	B	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
009	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
011	C	Ceiling			I	Drywall	White	-0.4	QM
042	C	Stairs	Ctr	Stringer	I	Wood	White	-0.6	QM
010	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
017	D	Door	Rgt	Lft casing	I	Wood	White	-0.1	QM
018	D	Door	Rgt	Lft jamb	I	Wood	White	-0.3	QM
019	D	Door	Rgt	L Ctr	I	Wood	White	0.1	QM
Interior Room 002 Bathroom									
020	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
021	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
029	B	Cabinet	Rgt		I	Wood	Varnish	-0.5	QM
022	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
025	C	Baseboard	Ctr		I	Wood	White	0.0	QM
024	C	Ceiling			I	Drywall	White	-0.2	QM
023	D	Wall	L Ctr		I	Drywall	White	0.1	QM
027	D	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
026	D	Door	Lft	Rgt casing	I	Wood	White	-0.6	QM
028	D	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
Interior Room 003 Living/Din									
030	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
031	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
032	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
035	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
034	C	Ceiling			I	Drywall	White	-0.1	QM
039	C	Window	Lft	Rgt casing	I	Wood	White	-0.4	QM
041	C	Window	Lft	Sash	I	Vinyl	White	-0.1	QM
040	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
037	C	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
036	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
038	C	Door	Ctr	U Ctr	I	Wood	White	-0.5	QM
033	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 004 Kitchen									
046	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
047	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
048	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
051	C	Baseboard	Ctr		I	Vinyl	Black	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
050	C	Ceiling			I	Drywall	White	-0.6	QM
049	D	Wall	L Ctr		I	Drywall	White	-0.8	QM
052	D	LowerCabinet	Ctr		I	Wood	Varnish	-0.8	QM
053	D	Cabinet	Ctr		I	Wood	Varnish	0.0	QM
Interior Room 005 UpperBedA									
054	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
063	A	Window	Rgt	Rgt casing	I	Wood	White	-0.6	QM
064	A	Window	Rgt	Sash	I	Wood	White	-0.4	QM
065	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
055	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
067	B	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
066	B	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
056	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
059	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
058	C	Ceiling			I	Drywall	White	-0.1	QM
061	C	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
060	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
062	C	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
057	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 006 MasterBath									
068	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
075	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
074	A	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
076	A	Door	Ctr	U Ctr	I	Wood	White	-0.5	QM
069	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
078	B	Sink	Lft		I	Porcelain	White	-0.9	QM
079	B	Cabinet	Lft		I	Wood	White	-0.5	QM
073	C	Wall	L Ctr		I	Ceramic	Tan	4.9	QM
070	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
072	C	Ceiling			I	Drywall	White	-0.2	QM
077	C	Bathtub	Ctr		I	Porcelain	White	-0.7	QM
071	D	Wall	U Ctr		I	Drywall	White	-0.5	QM
Interior Room 007 UpperBedB/C									
080	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
087	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
086	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
088	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
093	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.4	QM
092	A	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
081	B	Wall	L Ctr		I	Drywall	White	0.1	QM
082	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
085	C	Baseboard	Ctr		I	Wood	White	0.1	QM
084	C	Ceiling			I	Drywall	White	-0.6	QM
089	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
090	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
091	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
083	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 008 UpperBedC/D									
094	A	Wall	L Ctr		I	Drywall	White	0.0	QM
108	A	Closet	Ctr	Door	I	Wood	White	-0.4	QM
106	A	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
107	A	Closet	Ctr	Door Jamb	I	Wood	White	-0.3	QM
110	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
109	A	Closet	Ctr	Shelf	I	Wood	White	-0.7	QM
095	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
101	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
100	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
102	B	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
096	C	Wall	L Ctr		I	Drywall	White	0.0	QM
099	C	Baseboard	Ctr		I	Wood	White	0.1	QM
098	C	Ceiling			I	Drywall	White	-0.1	QM
103	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
104	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
105	C	Window	Ctr	Sill	I	Wood	White	-0.4	QM
097	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 009 UpperBath									
111	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
119	A	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
112	B	Wall	U Ctr		I	Drywall	White	0.0	QM
117	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
118	B	Door	Ctr	U Ctr	I	Wood	White	-0.7	QM
122	B	DoorStop	Ctr		I	Wood	Black	-0.2	QM
116	C	Wall	L Ctr		I	Ceramic	Tan	5.7	QM
113	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
115	C	Ceiling			I	Drywall	White	-0.3	QM
114	D	Wall	U Ctr		I	Drywall	White	-0.5	QM
120	D	Sink	Lft		I	Porcelain	White	-0.5	QM
121	D	Cabinet	Lft		I	Wood	White	-0.7	QM
Interior Room 010 UpperHall									
123	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
127	A	Ceiling			I	Drywall	White	-0.2	QM
124	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
134	B	Stairs	Ctr	Wall	I	Wood	White	0.1	QM
133	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
132	B	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
125	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
128	C	Baseboard	Ctr		I	Wood	White	0.0	QM
126	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
130	D	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
129	D	Door	Ctr	Rgt casing	I	Wood	White	-0.6	QM
131	D	Door	Ctr	U Lft	I	Wood	White	-0.3	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								-0.9	QM
005								-1.1	QM
006								-0.9	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	251 Gulfstream Drive- Interior
Report No.	09/03/13 10:33	
Total Reading Sets:	128	
Job Started:	09/03/13 10:33	
Job Finished:	09/03/13 11:28	

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Baseboard	7	0 <0%>	7 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	10	0 <0%>	10 <100%>	0 <0%>	
Closet Door	1	0 <0%>	1 <100%>	0 <0%>	
Closet Door Casing	1	0 <0%>	1 <100%>	0 <0%>	
Closet Door Jamb	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	4	0 <0%>	4 <100%>	0 <0%>	
Closet Shelf Sup.	4	0 <0%>	4 <100%>	0 <0%>	
Door L Ctr	1	0 <0%>	1 <100%>	0 <0%>	
Door Lft casing	1	0 <0%>	1 <100%>	0 <0%>	
Door Lft jamb	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	8	0 <0%>	8 <100%>	0 <0%>	
Door Rgt jamb	9	0 <0%>	9 <100%>	0 <0%>	
Door U Ctr	7	0 <0%>	7 <100%>	0 <0%>	
Door U Lft	1	0 <0%>	1 <100%>	0 <0%>	
Door U Rgt	1	0 <0%>	1 <100%>	0 <0%>	
DoorStop	1	0 <0%>	1 <100%>	0 <0%>	
LowerCabinet	1	0 <0%>	1 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	42	2 <5%>	40 <95%>	0 <0%>	
Window Rgt casing	5	0 <0%>	5 <100%>	0 <0%>	
Window Sash	4	0 <0%>	4 <100%>	0 <0%>	
Window Sill	5	0 <0%>	5 <100%>	0 <0%>	
Inspection Totals:	128	2 < 2%>	126 < 98%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 12:19

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
255 Gulfstream Drive- Interior


INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____

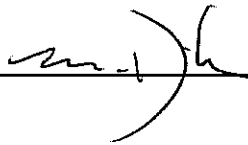

Date: _____

9/12/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13 USCG Elizabeth City
Report Date: 9/13/2013 Housing Units
Abatement Level: 1.0 255 Gulfstream Drive- Interior
Report No. 09/03/13 12:19
Total Readings: 147 Actionable: 2
Job Started: 09/03/13 12:19
Job Finished: 09/03/13 13:13

Reading					Paint			Lead	Mode
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	
Interior Room 006 MasterBath									
069	C	Wall	L Rgt		I	Ceramic	Tan	4.1	QM
Interior Room 010 UpperBath									
128	C	Wall	L Lft		I	Ceramic	Tan	5.8	QM
Calibration Readings									
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 12:19
 Total Readings: 147
 Job Started: 09/03/13 12:19
 Job Finished: 09/03/13 13:13

USCG Elizabeth City
 Housing Units
 255 Gulfstream Drive- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
1	001	Hall/Stairs	A	Wall	L	Ctr	I	Drywall	White	-0.2	QM
2	001	Hall/Stairs	B	Wall	L	Ctr	I	Drywall	White	-0.8	QM
3	001	Hall/Stairs	C	Wall	L	Ctr	I	Drywall	White	-0.6	QM
4	001	Hall/Stairs	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.6	QM
6	001	Hall/Stairs	C	Baseboard		Ctr	I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door		Ctr Rgt casing	I	Wood	White	-0.2	QM
8	001	Hall/Stairs	A	Door		Ctr Rgt jamb	I	Wood	White	-0.4	QM
9	001	Hall/Stairs	A	Door		Ctr U Ctr	I	Wood	White	-0.3	QM
10	001	Hall/Stairs	A	Window		Lft Rgt casing	I	Wood	White	0.0	QM
11	001	Hall/Stairs	A	Window		Lft Sill	I	Wood	White	0.0	QM
12	001	Hall/Stairs	C	Stairs		Ctr Stringer	I	Wood	White	-0.2	QM
13	001	Hall/Stairs	B	Stairs		Ctr Risers	I	Wood	White	0.0	QM
14	001	Hall/Stairs	D	Stairs		Ctr Wall	I	Wood	White	-0.3	QM
15	001	Hall/Stairs	B	Stairs		Ctr Treads	I	Wood	Varnish	-0.3	QM
16	001	Hall/Stairs	B	Stairs		Ctr Railing cap	I	Wood	Varnish	-0.3	QM
17	001	Hall/Stairs	B	Closet		Ctr Shelf	I	Wood	White	-0.6	QM
18	001	Hall/Stairs	B	Closet		Ctr Shelf Sup.	I	Wood	White	-0.1	QM
19	002	Bathroom	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
20	002	Bathroom	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
21	002	Bathroom	C	Wall	L	Ctr	I	Drywall	White	-0.2	QM
22	002	Bathroom	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
23	002	Bathroom	C	Ceiling			I	Drywall	White	-0.3	QM
24	002	Bathroom	C	Baseboard		Ctr	I	Wood	White	-0.7	QM
25	002	Bathroom	D	Door		Lft Rgt casing	I	Wood	White	-0.6	QM
26	002	Bathroom	D	Door		Lft Rgt jamb	I	Wood	White	-0.4	QM
27	002	Bathroom	D	Door		Lft U Ctr	I	Wood	White	-0.1	QM
28	002	Bathroom	B	Cabinet		Rgt	I	Wood	Varnish	-0.1	QM
29	003	Living/Din	A	Wall	L	Ctr	I	Drywall	White	-0.5	QM
30	003	Living/Din	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
31	003	Living/Din	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
32	003	Living/Din	D	Wall	L	Ctr	I	Drywall	White	-0.2	QM
33	003	Living/Din	B	Ceiling			I	Drywall	White	-0.3	QM
34	003	Living/Din	C	Baseboard		Ctr	I	Wood	White	-0.3	QM
35	003	Living/Din	C	Door		Ctr Rgt casing	I	Wood	White	-0.5	QM
36	003	Living/Din	C	Door		Ctr Rgt jamb	I	Wood	White	0.0	QM
37	003	Living/Din	C	Door		Ctr U Ctr	I	Wood	White	-0.5	QM
38	003	Living/Din	C	Window		Lft Rgt casing	I	Wood	White	-0.1	QM
39	003	Living/Din	C	Window		Lft Sash	I	Vinyl	White	-0.3	QM
40	003	Living/Din	C	Window		Lft Sill	I	Wood	White	0.0	QM
41	004	Kitchen	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
42	004	Kitchen	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
43	004	Kitchen	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
44	004	Kitchen	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
45	004	Kitchen	C	Ceiling			I	Drywall	White	-0.5	QM
46	004	Kitchen	C	Baseboard		Ctr	I	Vinyl	Black	-0.3	QM
47	004	Kitchen	D	LowerCabinet		Ctr	I	Wood	Varnish	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Kitchen	D	Cabinet		Ctr	I	Wood	Varnish	-0.1	QM
49	005	UpperBedD/A	A	Wall		L Ctr	I	Drywall	White	-0.6	QM
50	005	UpperBedD/A	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
51	005	UpperBedD/A	C	Wall		L Ctr	I	Drywall	White	-0.7	QM
52	005	UpperBedD/A	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
53	005	UpperBedD/A	C	Ceiling			I	Drywall	White	-0.6	QM
54	005	UpperBedD/A	C	Baseboard		Ctr	I	Wood	White	-0.7	QM
55	005	UpperBedD/A	B	Door		Rgt Rgt casing	I	Wood	White	-0.3	QM
56	005	UpperBedD/A	B	Door		Rgt Rgt jamb	I	Wood	White	-0.5	QM
57	005	UpperBedD/A	B	Door		Rgt U Ctr	I	Wood	White	-0.4	QM
58	005	UpperBedD/A	A	Window		Ctr Rgt casing	I	Wood	White	-0.6	QM
59	005	UpperBedD/A	A	Window		Ctr Sash	I	Wood	White	-0.3	QM
60	005	UpperBedD/A	A	Window		Ctr Sill	I	Wood	White	-0.4	QM
61	005	UpperBedD/A	B	Door		Lft L Ctr	I	Wood	White	-1.2	QM
62	005	UpperBedD/A	B	Closet		Ctr Shelf	I	Wood	White	-0.5	QM
63	005	UpperBedD/A	B	Closet		Ctr Shelf Sup.	I	Wood	White	-0.1	QM
64	006	MasterBath	A	Wall		U Ctr	I	Drywall	White	-0.6	QM
65	006	MasterBath	B	Wall		U Ctr	I	Drywall	White	-0.3	QM
66	006	MasterBath	C	Wall		U Ctr	I	Drywall	White	-0.6	QM
67	006	MasterBath	D	Wall		U Ctr	I	Drywall	White	-0.5	QM
68	006	MasterBath	C	Ceiling			I	Drywall	White	-0.5	QM
69	006	MasterBath	C	Wall		L Rgt	I	Ceramic	Tan	4.1	QM
70	006	MasterBath	A	Door		Ctr Rgt casing	I	Wood	White	-0.4	QM
71	006	MasterBath	A	Door		Ctr Rgt jamb	I	Wood	White	-0.3	QM
72	006	MasterBath	A	Door		Ctr U Ctr	I	Wood	White	-0.4	QM
73	006	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-1.2	QM
74	006	MasterBath	B	Sink		Lft	I	Porcelain	White	-1.0	QM
75	006	MasterBath	B	Cabinet		Lft	I	Wood	White	0.1	QM
76	007	UpperBedA/B	A	Wall		L Ctr	I	Drywall	White	0.0	QM
77	007	UpperBedA/B	B	Wall		L Ctr	I	Drywall	White	-0.4	QM
78	007	UpperBedA/B	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
79	007	UpperBedA/B	D	Wall		L Ctr	I	Drywall	White	-0.9	QM
80	007	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.4	QM
81	007	UpperBedA/B	C	Baseboard		Ctr	I	Wood	White	-0.4	QM
82	007	UpperBedA/B	D	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
83	007	UpperBedA/B	D	Door		Lft Rgt jamb	I	Wood	White	-0.5	QM
84	007	UpperBedA/B	D	Door		Lft U Ctr	I	Wood	White	-0.1	QM
85	007	UpperBedA/B	A	Window		Lft Rgt casing	I	Wood	White	0.1	QM
86	007	UpperBedA/B	A	Window		Lft Sash	I	Wood	White	0.2	QM
87	007	UpperBedA/B	A	Window		Lft Sill	I	Wood	White	-0.4	QM
88	007	UpperBedA/B	A	Closet		Ctr Shelf	I	Wood	White	-0.1	QM
89	007	UpperBedA/B	A	Closet		Ctr Shelf Sup.	I	Wood	White	0.0	QM
90	008	UpperBedB/C	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
91	008	UpperBedB/C	B	Wall		L Ctr	I	Drywall	White	0.1	QM
92	008	UpperBedB/C	C	Wall		L Ctr	I	Drywall	White	-0.3	QM
93	008	UpperBedB/C	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
94	008	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.4	QM
95	008	UpperBedB/C	C	Baseboard		Ctr	I	Wood	White	-0.3	QM
96	008	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	-0.4	QM
97	008	UpperBedB/C	D	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
98	008	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.3	QM
99	008	UpperBedB/C	C	Window		Rgt Rgt casing	I	Wood	White	-0.2	QM
100	008	UpperBedB/C	C	Window		Rgt Sash	I	Wood	White	-0.3	QM
101	008	UpperBedB/C	C	Window		Rgt Sill	I	Wood	White	0.1	QM
102	008	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	008	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	-0.3	QM
104	008	UpperBedB/C	A	Closet		Rgt Shelf Sup.	I	Wood	White	-0.3	QM
105	009	UpperBedC/D	A	Wall		L Ctr	I	Drywall	White	0.1	QM
106	009	UpperBedC/D	B	Wall		L Ctr	I	Drywall	White	-0.2	QM
107	009	UpperBedC/D	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
108	009	UpperBedC/D	D	Wall		L Ctr	I	Drywall	White	0.0	QM
109	009	UpperBedC/D	C	Ceiling			I	Drywall	White	0.0	QM
110	009	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	-0.6	QM
111	009	UpperBedC/D	B	Door		Rgt Rgt casing	I	Wood	White	-0.5	QM
112	009	UpperBedC/D	B	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
113	009	UpperBedC/D	B	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
114	009	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.1	QM
115	009	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.1	QM
116	009	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	-0.4	QM
117	009	UpperBedC/D	B	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
118	009	UpperBedC/D	B	Closet		Ctr Shelf Sup.	I	Wood	White	0.1	QM
119	010	UpperBath	A	Wall		U Ctr	I	Drywall	White	-0.3	QM
120	010	UpperBath	B	Wall		U Ctr	I	Drywall	White	-1.1	QM
121	010	UpperBath	C	Wall		U Ctr	I	Drywall	White	-0.6	QM
122	010	UpperBath	D	Wall		U Ctr	I	Drywall	White	-0.4	QM
123	010	UpperBath	C	Ceiling			I	Drywall	White	-0.3	QM
124	010	UpperBath	C	Baseboard		Ctr	I	Wood	White	-0.5	QM
125	010	UpperBath	B	Door		Rgt Rgt casing	I	Wood	White	-0.3	QM
126	010	UpperBath	B	Door		Rgt Rgt jamb	I	Wood	White	-0.3	QM
127	010	UpperBath	B	Door		Rgt U Ctr	I	Wood	White	-0.6	QM
128	010	UpperBath	C	Wall		L Lft	I	Ceramic	Tan	5.8	QM
129	010	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.1	QM
130	010	UpperBath	D	Sink		Lft	I	Porcelain	White	-0.1	QM
131	011	UpperHall	A	Wall		L Ctr	I	Drywall	White	-0.7	QM
132	011	UpperHall	B	Wall		L Ctr	I	Drywall	White	-0.6	QM
133	011	UpperHall	C	Wall		L Ctr	I	Drywall	White	-0.4	QM
134	011	UpperHall	D	Wall		L Ctr	I	Drywall	White	-0.6	QM
135	011	UpperHall	C	Ceiling			I	Drywall	White	-1.1	QM
136	011	UpperHall	C	Baseboard		Ctr	I	Wood	White	-0.6	QM
137	011	UpperHall	B	Door		Ctr Rgt casing	I	Wood	White	-0.3	QM
138	011	UpperHall	B	Door		Ctr Rgt jamb	I	Wood	White	-0.5	QM
139	011	UpperHall	B	Door		Ctr U Ctr	I	Wood	White	-0.6	QM
140	011	UpperHall	B	Closet		Ctr Shelf	I	Wood	White	-0.7	QM
141	011	UpperHall	B	Closet		Ctr Shelf Sup.	I	Wood	White	-0.6	QM
142		CALIBRATION								1.0	QM
143		CALIBRATION								1.0	QM
144		CALIBRATION								1.0	QM
145		CALIBRATION								-0.1	QM
146		CALIBRATION								-0.4	QM
147		CALIBRATION								-0.3	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	255 Gulfstream Drive- Interior
Report No.	09/03/13 12:19	
Total Readings:	147	
Job Started:	09/03/13 12:19	
Job Finished:	09/03/13 13:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
005	A	Ceiling			I	Drywall	White	-0.6	QM
010	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
011	A	Window	Lft	Sill	I	Wood	White	0.0	QM
008	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.4	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
009	A	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.8	QM
015	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
013	B	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
016	B	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.3	QM
018	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
017	B	Closet	Ctr	Shelf	I	Wood	White	-0.6	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
006	C	Baseboard	Ctr		I	Wood	White	0.0	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
014	D	Stairs	Ctr	Wall	I	Wood	White	-0.3	QM
Interior Room 002 Bathroom									
019	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
028	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.7	QM
023	C	Ceiling			I	Drywall	White	-0.3	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	-0.6	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Living/Din									
029	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
030	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
033	B	Ceiling			I	Drywall	White	-0.3	QM
031	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
034	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
038	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
039	C	Window	Lft	Sash	I	Vinyl	White	-0.3	QM
040	C	Window	Lft	Sill	I	Wood	White	0.0	QM
036	C	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
035	C	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
037	C	Door	Ctr	U Ctr	I	Wood	White	-0.5	QM
032	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Kitchen									
041	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
042	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
043	C	Wall	L Ctr		I	Drywall	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
046	C	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
045	C	Ceiling			I	Drywall	White	-0.5	QM
044	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
047	D	LowerCabinet	Ctr		I	Wood	Varnish	0.0	QM
048	D	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
Interior Room 005 UpperBedD/A									
049	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
058	A	Window	Ctr	Rgt casing	I	Wood	White	-0.6	QM
059	A	Window	Ctr	Sash	I	Wood	White	-0.3	QM
060	A	Window	Ctr	Sill	I	Wood	White	-0.4	QM
050	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
061	B	Door	Lft	L Ctr	I	Wood	White	-1.2	QM
056	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.5	QM
055	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
057	B	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
063	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
062	B	Closet	Ctr	Shelf	I	Wood	White	-0.5	QM
051	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
054	C	Baseboard	Ctr		I	Wood	White	-0.7	QM
053	C	Ceiling			I	Drywall	White	-0.6	QM
052	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 006 MasterBath									
064	A	Wall	U Ctr		I	Drywall	White	-0.6	QM
071	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
070	A	Door	Ctr	Rgt casing	I	Wood	White	-0.4	QM
072	A	Door	Ctr	U Ctr	I	Wood	White	-0.4	QM
065	B	Wall	U Ctr		I	Drywall	White	-0.3	QM
074	B	Sink	Lft		I	Porcelain	White	-1.0	QM
075	B	Cabinet	Lft		I	Wood	White	0.1	QM
069	C	Wall	L Rgt		I	Ceramic	Tan	4.1	QM
066	C	Wall	U Ctr		I	Drywall	White	-0.6	QM
068	C	Ceiling			I	Drywall	White	-0.5	QM
073	C	Bathtub	Ctr		I	Porcelain	White	-1.2	QM
067	D	Wall	U Ctr		I	Drywall	White	-0.5	QM
Interior Room 007 UpperBedA/B									
076	A	Wall	L Ctr		I	Drywall	White	0.0	QM
085	A	Window	Lft	Rgt casing	I	Wood	White	0.1	QM
086	A	Window	Lft	Sash	I	Wood	White	0.2	QM
087	A	Window	Lft	Sill	I	Wood	White	-0.4	QM
089	A	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
088	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
077	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
078	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
081	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
080	C	Ceiling			I	Drywall	White	-0.4	QM
079	D	Wall	L Ctr		I	Drywall	White	-0.9	QM
083	D	Door	Lft	Rgt jamb	I	Wood	White	-0.5	QM
082	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
084	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 008 UpperBedB/C									
090	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
102	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
104	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
103	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
091	B	Wall	L Ctr		I	Drywall	White	0.1	QM
092	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
095	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
094	C	Ceiling			I	Drywall	White	-0.4	QM
099	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
100	C	Window	Rgt	Sash	I	Wood	White	-0.3	QM
101	C	Window	Rgt	Sill	I	Wood	White	0.1	QM
093	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
097	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
096	D	Door	Rgt	Rgt casing	I	Wood	White	-0.4	QM
098	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
Interior Room 009 UpperBedC/D									
105	A	Wall	L Ctr		I	Drywall	White	0.1	QM
106	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
111	B	Door	Rgt	Rgt casing	I	Wood	White	-0.5	QM
113	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
118	B	Closet	Ctr	Shelf Sup.	I	Wood	White	0.1	QM
117	B	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
107	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
110	C	Baseboard	Ctr		I	Wood	White	-0.6	QM
109	C	Ceiling			I	Drywall	White	0.0	QM
114	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
115	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
116	C	Window	Ctr	Sill	I	Wood	White	-0.4	QM
108	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 010 UpperBath									
119	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
129	A	Bathtub	Ctr		I	Porcelain	White	-0.1	QM
120	B	Wall	U Ctr		I	Drywall	White	-1.1	QM
126	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
125	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
127	B	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
128	C	Wall	L Lft		I	Ceramic	Tan	5.8	QM
121	C	Wall	U Ctr		I	Drywall	White	-0.6	QM
124	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
123	C	Ceiling			I	Drywall	White	-0.3	QM
122	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
130	D	Sink	Lft		I	Porcelain	White	-0.1	QM
Interior Room 011 UpperHall									
131	A	Wall	L Ctr		I	Drywall	White	-0.7	QM
132	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
138	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.5	QM
137	B	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
139	B	Door	Ctr	U Ctr	I	Wood	White	-0.6	QM
141	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.6	QM
140	B	Closet	Ctr	Shelf	I	Wood	White	-0.7	QM
133	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
136	C	Baseboard	Ctr		I	Wood	White	-0.6	QM
135	C	Ceiling			I	Drywall	White	-1.1	QM
134	D	Wall	L Ctr		I	Drywall	White	-0.6	QM

Calibration Readings

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
142								1.0	QM
143								1.0	QM
144								1.0	QM
145								-0.1	QM
146								-0.4	QM
147								-0.3	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 12:19
 Total Reading Sets: 141
 Job Started: 09/03/13 12:19
 Job Finished: 09/03/13 13:13

USCG Elizabeth City
 Housing Units
 255 Gulfstream Drive- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Baseboard	10	0 <0%>	10 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	3	0 <0%>	3 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	6	0 <0%>	6 <100%>	0 <0%>	
Closet Shelf Sup.	6	0 <0%>	6 <100%>	0 <0%>	
Door L Ctr	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	10	0 <0%>	10 <100%>	0 <0%>	
Door Rgt jamb	10	0 <0%>	10 <100%>	0 <0%>	
Door U Ctr	10	0 <0%>	10 <100%>	0 <0%>	
LowerCabinet	1	0 <0%>	1 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	46	2 <4%>	44 <96%>	0 <0%>	
Window Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Window Sill	6	0 <0%>	6 <100%>	0 <0%>	
Inspection Totals:	141	2 < 1%>	139 < 99%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 11:30

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
253 Gulfstream Drive- Interior


INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____

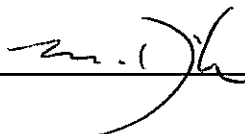

Date: _____

9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13 USCG Elizabeth City
Report Date: 9/13/2013 Housing Units
Abatement Level: 1.0 253 Gulfstream Drive- Interior
Report No. 09/03/13 11:30
Total Readings: 134 Actionable: 2
Job Started: 09/03/13 11:30
Job Finished: 09/03/13 12:17

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 006 MasterBath									
071	C	Wall	L Ctr		I	Ceramic	Tan	4.3	QM
Interior Room 007 UpperBath									
083	C	Wall	L Ctr		I	Ceramic	Tan	3.6	QM
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 11:30
 Total Readings: 134
 Job Started: 09/03/13 11:30
 Job Finished: 09/03/13 12:17

USCG Elizabeth City
 Housing Units
 253 Gulfstream Drive- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L	Ctr	I	Drywall	White	-0.2	QM
2	001	Hall/Stairs	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
3	001	Hall/Stairs	C	Wall	L	Ctr	I	Drywall	White	-0.7	QM
4	001	Hall/Stairs	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.1	QM
6	001	Hall/Stairs	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
7	001	Hall/Stairs	A	Door		Ctr Rgt casing	I	Wood	White	-0.8	QM
8	001	Hall/Stairs	A	Door		Ctr Rgt jamb	I	Wood	White	0.1	QM
9	001	Hall/Stairs	A	Door		Ctr U Ctr	I	Wood	White	-0.3	QM
10	001	Hall/Stairs	A	Window		Rgt Rgt casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	A	Window		Rgt Sill	I	Wood	White	-0.2	QM
12	001	Hall/Stairs	C	Stairs		Ctr Stringer	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	D	Stairs		Ctr Risers	I	Wood	White	-0.2	QM
14	001	Hall/Stairs	D	Stairs		Ctr Treads	I	Wood	Varnish	-0.5	QM
15	001	Hall/Stairs	A	Stairs		Ctr Railing cap	I	Wood	Varnish	0.0	QM
16	001	Hall/Stairs	B	Stairs		Ctr Wall	I	Wood	Varnish	-0.1	QM
17	001	Hall/Stairs	D	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
18	001	Hall/Stairs	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.1	QM
19	002	Bedroom A/B	A	Wall	L	Ctr	I	Drywall	White	-0.2	QM
20	002	Bedroom A/B	B	Wall	L	Ctr	I	Drywall	White	-0.1	QM
21	002	Bedroom A/B	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
22	002	Bedroom A/B	D	Wall	L	Ctr	I	Drywall	White	-0.2	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	-0.5	QM
24	002	Bedroom A/B	C	Baseboard		Ctr	I	Wood	White	-0.5	QM
25	002	Bedroom A/B	D	Door		Lft Rgt casing	I	Wood	White	-0.5	QM
26	002	Bedroom A/B	D	Door		Lft Rgt jamb	I	Wood	White	0.0	QM
27	002	Bedroom A/B	D	Door		Lft U Ctr	I	Wood	White	-0.4	QM
28	002	Bedroom A/B	A	Window		Ctr Rgt casing	I	Wood	White	-0.1	QM
29	002	Bedroom A/B	A	Window		Ctr Sill	I	Wood	White	0.0	QM
30	002	Bedroom A/B	A	Window		Ctr Sill	I	Wood	White	0.0	QM
31	002	Bedroom A/B	A	Mini Blinds		Ctr	I	Vinyl	White	-0.2	QM
On Floor											
32	003	Kitchen	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
33	003	Kitchen	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
34	003	Kitchen	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
35	003	Kitchen	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
36	003	Kitchen	A	Ceiling			I	Drywall	White	-0.5	QM
37	003	Kitchen	C	Baseboard		Ctr	I	Wood	White	-0.5	QM
38	003	Kitchen	B	LowerCabinet		Ctr	I	Wood	Varnish	-0.3	QM
39	003	Kitchen	B	Cabinet		Ctr	I	Wood	Varnish	-0.2	QM
40	004	Living/Din	A	Wall	L	Ctr	I	Drywall	White	-0.5	QM
41	004	Living/Din	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
42	004	Living/Din	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
43	004	Living/Din	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
44	004	Living/Din	A	Ceiling			I	Drywall	White	-0.2	QM
45	004	Living/Din	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
46	004	Living/Din	C	Door		Ctr Rgt casing	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
47	004	Living/Din	C	Door		Ctr Rgt jamb	I	Wood	White	-0.4	QM
48	004	Living/Din	C	Door		Ctr U Ctr	I	Wood	White	-0.2	QM
49	004	Living/Din	C	Window		Rgt Rgt casing	I	Wood	White	0.1	QM
50	004	Living/Din	C	Window		Rgt Sash	I	Vinyl	White	-0.1	QM
51	004	Living/Din	C	Window		Rgt Sill	I	Wood	White	-0.4	QM
52	005	UpperBedA	A	Wall	L	Ctr	I	Drywall	White	-0.4	QM
53	005	UpperBedA	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
54	005	UpperBedA	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
55	005	UpperBedA	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
56	005	UpperBedA	A	Ceiling			I	Drywall	White	-0.2	QM
57	005	UpperBedA	C	Baseboard		Ctr	I	Wood	White	0.2	QM
58	005	UpperBedA	C	Door		Ctr Rgt casing	I	Wood	White	0.0	QM
59	005	UpperBedA	C	Door		Ctr Rgt jamb	I	Wood	White	0.1	QM
60	005	UpperBedA	C	Door		Ctr U Ctr	I	Wood	White	0.1	QM
61	005	UpperBedA	A	Window		Lft Rgt casing	I	Wood	White	-0.1	QM
62	005	UpperBedA	A	Window		Lft Sash	I	Wood	White	-0.1	QM
63	005	UpperBedA	A	Window		Lft Sill	I	Wood	White	0.2	QM
64	005	UpperBedA	D	Closet		Ctr Shelf	I	Wood	White	0.0	QM
65	005	UpperBedA	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.4	QM
66	006	MasterBath	A	Wall	U	Ctr	I	Drywall	White	-0.3	QM
67	006	MasterBath	B	Wall	U	Ctr	I	Drywall	White	0.0	QM
68	006	MasterBath	C	Wall	U	Ctr	I	Drywall	White	-0.3	QM
69	006	MasterBath	D	Wall	U	Ctr	I	Drywall	White	0.0	QM
70	006	MasterBath	C	Ceiling			I	Drywall	White	-0.4	QM
71	006	MasterBath	C	Wall	L	Ctr	I	Ceramic	Tan	4.3	QM
72	006	MasterBath	A	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
73	006	MasterBath	A	Door		Rgt Rgt jamb	I	Wood	White	-0.4	QM
74	006	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
75	006	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.5	QM
76	006	MasterBath	C	Sink		Ctr	I	Porcelain	White	-0.6	QM
77	006	MasterBath	D	Cabinet		Rgt	I	Wood	White	-1.0	QM
78	007	UpperBath	A	Wall	U	Ctr	I	Drywall	White	0.0	QM
79	007	UpperBath	B	Wall	U	Ctr	I	Drywall	White	-0.6	QM
80	007	UpperBath	C	Wall	U	Ctr	I	Drywall	White	-0.2	QM
81	007	UpperBath	D	Wall	U	Ctr	I	Drywall	White	-0.4	QM
82	007	UpperBath	A	Ceiling			I	Drywall	White	-0.3	QM
83	007	UpperBath	C	Wall	L	Ctr	I	Ceramic	Tan	3.6	QM
84	007	UpperBath	D	Door		Lft Rgt casing	I	Wood	White	-0.2	QM
85	007	UpperBath	D	Door		Lft Rgt jamb	I	Wood	White	-0.2	QM
86	007	UpperBath	D	Door		Lft U Ctr	I	Wood	White	-0.5	QM
87	007	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.5	QM
88	007	UpperBath	B	Sink		Rgt	I	Porcelain	White	-0.9	QM
89	007	UpperBath	B	Cabinet		Rgt	I	Wood	White	-0.5	QM
90	008	UpperBedB/C	A	Wall	L	Ctr	I	Drywall	White	-0.6	QM
91	008	UpperBedB/C	B	Wall	L	Ctr	I	Drywall	White	-0.2	QM
92	008	UpperBedB/C	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
93	008	UpperBedB/C	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
94	008	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.3	QM
95	008	UpperBedB/C	C	Baseboard		Ctr	I	Wood	White	0.1	QM
96	008	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	0.0	QM
97	008	UpperBedB/C	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
98	008	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.3	QM
99	008	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
100	008	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	0.0	QM
101	008	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
102	008	UpperBedB/C	A	Closet		Rgt Door Casing	I	Wood	White	-0.4	QM
103	008	UpperBedB/C	A	Closet		Rgt Door Jamb	I	Wood	White	-0.3	QM
104	008	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.3	QM
105	008	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	-0.1	QM
106	008	UpperBedB/C	A	Closet		Rgt Shelf Sup.	I	Wood	White	-0.6	QM
107	009	UpperBedC/D	A	Wall	L	Ctr	I	Drywall	White	-0.6	QM
108	009	UpperBedC/D	B	Wall	L	Ctr	I	Drywall	White	-0.2	QM
109	009	UpperBedC/D	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
110	009	UpperBedC/D	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
111	009	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.3	QM
112	009	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
113	009	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
114	009	UpperBedC/D	A	Door		Rgt Rgt jamb	I	Wood	White	-0.3	QM
115	009	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	-0.3	QM
116	009	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
117	009	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	0.0	QM
118	009	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	0.0	QM
119	009	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	-0.4	QM
120	009	UpperBedC/D	C	Mini Blinds		Ctr	I	Vinyl	White	-0.4	QM
		On floor									
121	009	UpperBedC/D	A	Closet		Ctr Shelf	I	Wood	White	-0.2	QM
122	009	UpperBedC/D	A	Closet		Ctr Shelf Sup.	I	Wood	White	-0.7	QM
123	010	UpperHall	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
124	010	UpperHall	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
125	010	UpperHall	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
126	010	UpperHall	D	Wall	L	Ctr	I	Drywall	White	-0.2	QM
127	010	UpperHall	C	Ceiling			I	Drywall	White	-0.5	QM
128	010	UpperHall	C	Baseboard		Ctr	I	Wood	White	0.2	QM
129	010	UpperHall	B	Door		Ctr Rgt casing	I	Wood	White	-0.3	QM
130	010	UpperHall	B	Door		Ctr Rgt jamb	I	Wood	White	-0.1	QM
131	010	UpperHall	B	Door		Ctr U Ctr	I	Wood	White	-0.1	QM
132	010	UpperHall	D	Door		Ctr L Ctr	I	Wood	White	-0.4	QM
133	010	UpperHall	D	Closet		Ctr Shelf	I	Wood	White	0.2	QM
134	010	UpperHall	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.5	QM
---- End of Readings ----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 11:30
 Total Readings: 134
 Job Started: 09/03/13 11:30
 Job Finished: 09/03/13 12:17

USCG Elizabeth City
 Housing Units
 253 Gulfstream Drive- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
005	A	Ceiling			I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
008	A	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	-0.8	QM
009	A	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
015	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	0.0	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
016	B	Stairs	Ctr	Wall	I	Wood	Varnish	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
014	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.5	QM
013	D	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
018	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
017	D	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
023	A	Ceiling			I	Drywall	White	-0.5	QM
028	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
029	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
030	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
031	A	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
On Floor									
020	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	-0.5	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
Interior Room 003 Kitchen									
032	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
036	A	Ceiling			I	Drywall	White	-0.5	QM
033	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
038	B	Lower Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
039	B	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
034	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
037	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
035	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 004 Living/Din									
040	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
044	A	Ceiling			I	Drywall	White	-0.2	QM
041	B	Wall	L Ctr		I	Drywall	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
042	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
045	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
049	C	Window	Rgt	Rgt casing	I	Wood	White	0.1	QM
050	C	Window	Rgt	Sash	I	Vinyl	White	-0.1	QM
051	C	Window	Rgt	Sill	I	Wood	White	-0.4	QM
047	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.4	QM
046	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
048	C	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
043	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 005 UpperBedA									
052	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
056	A	Ceiling			I	Drywall	White	-0.2	QM
061	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
062	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
063	A	Window	Lft	Sill	I	Wood	White	0.2	QM
053	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
054	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
057	C	Baseboard	Ctr		I	Wood	White	0.2	QM
059	C	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
058	C	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
060	C	Door	Ctr	U Ctr	I	Wood	White	0.1	QM
055	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
065	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.4	QM
064	D	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
Interior Room 006 MasterBath									
066	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
073	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.4	QM
072	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
074	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
067	B	Wall	U Ctr		I	Drywall	White	0.0	QM
071	C	Wall	L Ctr		I	Ceramic	Tan	4.3	QM
068	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
070	C	Ceiling			I	Drywall	White	-0.4	QM
075	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
076	C	Sink	Ctr		I	Porcelain	White	-0.6	QM
069	D	Wall	U Ctr		I	Drywall	White	0.0	QM
077	D	Cabinet	Rgt		I	Wood	White	-1.0	QM
Interior Room 007 UpperBath									
078	A	Wall	U Ctr		I	Drywall	White	0.0	QM
082	A	Ceiling			I	Drywall	White	-0.3	QM
087	A	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
079	B	Wall	U Ctr		I	Drywall	White	-0.6	QM
088	B	Sink	Rgt		I	Porcelain	White	-0.9	QM
089	B	Cabinet	Rgt		I	Wood	White	-0.5	QM
083	C	Wall	L Ctr		I	Ceramic	Tan	3.6	QM
080	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
081	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
085	D	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
084	D	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
086	D	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
Interior Room 008 UpperBedB/C									
090	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
094	A	Ceiling			I	Drywall	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
104	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
102	A	Closet	Rgt	Door Casing	I	Wood	White	-0.4	QM
103	A	Closet	Rgt	Door Jamb	I	Wood	White	-0.3	QM
106	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.6	QM
105	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
091	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
092	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
095	C	Baseboard	Ctr		I	Wood	White	0.1	QM
099	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
100	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
101	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
093	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
097	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
096	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
098	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM

Interior Room 009 UpperBedC/D

107	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
114	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
113	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
115	A	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
119	A	Closet	Lft	Door	I	Wood	White	-0.4	QM
122	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.7	QM
121	A	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
108	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
109	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
112	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
111	C	Ceiling			I	Drywall	White	-0.3	QM
116	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
117	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
118	C	Window	Ctr	Sill	I	Wood	White	0.0	QM
120	C	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
On floor									
110	D	Wall	L Ctr		I	Drywall	White	-0.1	QM

Interior Room 010 UpperHall

123	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
124	B	Wall	L Ctr		I	Drywall	White	0.1	QM
130	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
129	B	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
131	B	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
125	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
128	C	Baseboard	Ctr		I	Wood	White	0.2	QM
127	C	Ceiling			I	Drywall	White	-0.5	QM
126	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
132	D	Door	Ctr	L Ctr	I	Wood	White	-0.4	QM
134	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.5	QM
133	D	Closet	Ctr	Shelf	I	Wood	White	0.2	QM

----- End of Readings -----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
 Report Date: 9/13/2013
 Abatement Level: 1.0
 Report No. 09/03/13 11:30
 Total Reading Sets: 134
 Job Started: 09/03/13 11:30
 Job Finished: 09/03/13 12:17

USCG Elizabeth City
 Housing Units
 253 Gulfstream Drive- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Baseboard	8	0 <0%>	8 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	3	0 <0%>	3 <100%>	0 <0%>	
Ceiling	10	0 <0%>	10 <100%>	0 <0%>	
Closet Door	2	0 <0%>	2 <100%>	0 <0%>	
Closet Door Casing	1	0 <0%>	1 <100%>	0 <0%>	
Closet Door Jamb	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	5	0 <0%>	5 <100%>	0 <0%>	
Closet Shelf Sup.	5	0 <0%>	5 <100%>	0 <0%>	
Door L Ctr	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	9	0 <0%>	9 <100%>	0 <0%>	
Door Rgt jamb	9	0 <0%>	9 <100%>	0 <0%>	
Door U Ctr	9	0 <0%>	9 <100%>	0 <0%>	
LowerCabinet	1	0 <0%>	1 <100%>	0 <0%>	
Mini Blinds	2	0 <0%>	2 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	42	2 <5%>	40 <95%>	0 <0%>	
Window Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Window Sash	4	0 <0%>	4 <100%>	0 <0%>	
Window Sill	7	0 <0%>	7 <100%>	0 <0%>	
Inspection Totals:	134	2 < 1%>	132 < 99%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 10:16

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
380 Hercules Court- Interior


INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____

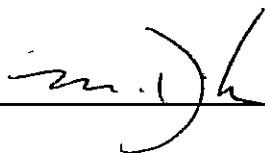

Date: _____

9/4/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	380 Hercules Court- Interior
Report No.	09/05/13 10:16	
Total Readings:	131	Actionable: 0
Job Started:	09/05/13 10:16	
Job Finished:	09/05/13 10:50	

Reading					Paint			Lead	
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	Mode
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:16
 Total Readings: 131
 Job Started: 09/05/13 10:16
 Job Finished: 09/05/13 10:50

USCG Elizabeth City
 Housing Units
 380 Hercules Court- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.2	QM
6	001	Hall/Stairs	C	Baseboard		Ctr	I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
10	001	Hall/Stairs	A	Window		Rgt Rgt casing	I	Wood	White	-0.3	QM
11	001	Hall/Stairs	A	Window		Rgt Apron	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	C	Stairs		Ctr Stringer	I	Wood	White	-0.3	QM
13	001	Hall/Stairs	C	Stairs		Ctr Risers	I	Wood	White	-0.1	QM
14	001	Hall/Stairs	C	WallCap		Ctr	I	Wood	White	-0.2	QM
15	001	Hall/Stairs	D	Stairs		Ctr Treads	I	Wood	Varnish	-0.2	QM
16	001	Hall/Stairs	D	Stairs		Ctr Railing cap	I	Wood	Varnish	-0.2	QM
17	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
18	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
19	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
20	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	0.0	QM
21	002	Bedroom A/B	B	Ceiling			I	Drywall	White	-0.1	QM
22	002	Bedroom A/B	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
23	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
24	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
25	002	Bedroom A/B	D	Door	Lft	U Lft	I	Wood	White	-0.1	QM
26	002	Bedroom A/B	A	Window		Ctr Rgt casing	I	Wood	White	-0.2	QM
27	002	Bedroom A/B	A	Window		Ctr Sash	I	Wood	White	-0.1	QM
28	002	Bedroom A/B	A	Window		Ctr Sill	I	Wood	White	-0.3	QM
29	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
30	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
31	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
32	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
33	003	Kitchen	A	Ceiling			I	Drywall	White	-0.2	QM
34	003	Kitchen	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
35	003	Kitchen	D	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
36	003	Kitchen	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
37	003	Kitchen	B	Cabinet		Ctr	I	Wood	Varnish	-0.1	QM
38	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
39	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
40	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
41	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
42	004	Living/Din	A	Ceiling			I	Drywall	White	-0.1	QM
43	004	Living/Din	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
44	004	Living/Din	C	Door		Ctr Rgt casing	I	Wood	White	0.1	QM
45	004	Living/Din	C	Door		Ctr Rgt jamb	I	Wood	White	-0.3	QM
46	004	Living/Din	C	Door		Ctr U Ctr	I	Metal	White	0.0	QM
47	004	Living/Din	C	Window		Rgt Rgt casing	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Window		Rgt Sash	I	Wood	White	-0.1	QM
49	004	Living/Din	C	Window		Rgt Sill	I	Wood	White	-0.2	QM
50	005	UpperBedD/A	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
51	005	UpperBedD/A	B	Wall		L Ctr	I	Drywall	White	0.0	QM
52	005	UpperBedD/A	C	Wall		L Ctr	I	Drywall	White	-0.2	QM
53	005	UpperBedD/A	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
54	005	UpperBedD/A	C	Ceiling			I	Drywall	White	-0.1	QM
55	005	UpperBedD/A	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
56	005	UpperBedD/A	B	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
57	005	UpperBedD/A	B	Door		Rgt Rgt jamb	I	Wood	White	-0.3	QM
58	005	UpperBedD/A	B	Door		Rgt U Ctr	I	Wood	White	0.0	QM
59	005	UpperBedD/A	D	Cabinet		Lft	I	Wood	Varnish	-0.1	QM
60	005	UpperBedD/A	A	Cabinet		Ctr	I	Wood	Varnish	-0.2	QM
61	006	UpperBedA/B	A	Wall		L Ctr	I	Drywall	White	-0.1	QM
62	006	UpperBedA/B	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
63	006	UpperBedA/B	C	Wall		L Ctr	I	Drywall	White	0.0	QM
64	006	UpperBedA/B	D	Wall		L Ctr	I	Drywall	White	-0.2	QM
65	006	UpperBedA/B	A	Ceiling			I	Drywall	White	-0.1	QM
66	006	UpperBedA/B	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
67	006	UpperBedA/B	D	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
68	006	UpperBedA/B	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
69	006	UpperBedA/B	D	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
70	006	UpperBedA/B	A	Window		Lft Rgt casing	I	Wood	White	-0.1	QM
71	006	UpperBedA/B	A	Window		Lft Sash	I	Wood	White	-0.1	QM
72	006	UpperBedA/B	A	Window		Lft Sill	I	Wood	White	0.1	QM
73	006	UpperBedA/B	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.3	QM
74	007	MasterBath	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
75	007	MasterBath	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
76	007	MasterBath	C	Wall		L Ctr	I	Drywall	White	-0.2	QM
77	007	MasterBath	D	Wall		L Ctr	I	Drywall	White	0.0	QM
78	007	MasterBath	A	Ceiling			I	Drywall	White	-0.3	QM
79	007	MasterBath	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
80	007	MasterBath	A	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
81	007	MasterBath	A	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
82	007	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	0.0	QM
83	007	MasterBath	D	Cabinet		Rgt	I	Wood	White	-0.3	QM
84	008	UpperBath	A	Wall		L Ctr	I	Drywall	White	0.0	QM
85	008	UpperBath	B	Wall		L Ctr	I	Drywall	White	-0.2	QM
86	008	UpperBath	C	Wall		U Ctr	I	Drywall	White	-0.1	QM
87	008	UpperBath	D	Wall		U Ctr	I	Drywall	White	-0.2	QM
88	008	UpperBath	A	Ceiling			I	Drywall	White	-0.3	QM
89	008	UpperBath	C	Wall		L Ctr	I	Ceramic	White	-0.2	QM
90	008	UpperBath	C	Baseboard		Ctr	I	Wood	White	-0.5	QM
91	008	UpperBath	D	Door		Rgt Rgt casing	I	Wood	White	-0.3	QM
92	008	UpperBath	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
93	008	UpperBath	D	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
94	008	UpperBath	B	Cabinet		Lft	I	Wood	White	-0.1	QM
95	009	UpperBedB/C	A	Wall		L Ctr	I	Drywall	White	-0.3	QM
96	009	UpperBedB/C	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
97	009	UpperBedB/C	C	Wall		L Ctr	I	Drywall	White	-0.2	QM
98	009	UpperBedB/C	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
99	009	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.1	QM
100	009	UpperBedB/C	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
101	009	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	-0.2	QM
102	009	UpperBedB/C	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
104	009	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.2	QM
105	009	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.1	QM
106	009	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	-0.2	QM
107	009	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	-0.3	QM
108	009	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.3	QM
109	010	UpperBedC/D	A	Wall	L	Ctr	I	Drywall	White	-0.2	QM
110	010	UpperBedC/D	B	Wall	L	Ctr	I	Drywall	White	-0.2	QM
111	010	UpperBedC/D	C	Wall	L	Ctr	I	Drywall	White	-0.2	QM
112	010	UpperBedC/D	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
113	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.1	QM
114	010	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
115	010	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	-0.2	QM
116	010	UpperBedC/D	A	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
117	010	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
118	010	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	0.0	QM
119	010	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.3	QM
120	010	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	-0.1	QM
121	011	UpperHall	A	Wall	L	Ctr	I	Drywall	White	-0.2	QM
122	011	UpperHall	B	Wall	L	Ctr	I	Drywall	White	-0.1	QM
123	011	UpperHall	C	Wall	L	Ctr	I	Drywall	White	0.1	QM
124	011	UpperHall	D	Wall	L	Ctr	I	Drywall	White	0.0	QM
125	011	UpperHall	A	Ceiling			I	Drywall	White	-0.1	QM
126	011	UpperHall	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
127	011	UpperHall	B	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
128	011	UpperHall	B	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
129	011	UpperHall	B	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
130	011	UpperHall	A	Attic Hatch		Ctr	I	Wood	White	0.0	QM
131	011	UpperHall	A	Attic Casing		Ctr	I	Wood	White	-0.1	QM
---- End of Readings ----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:16
 Total Readings: 131
 Job Started: 09/05/13 10:16
 Job Finished: 09/05/13 10:50

USCG Elizabeth City
 Housing Units
 380 Hercules Court- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
011	A	Window	Rgt	Apron	I	Wood	White	-0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
009	A	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
006	C	Baseboard	Ctr		I	Wood	White	0.0	QM
005	C	Ceiling			I	Drywall	White	-0.2	QM
013	C	Stairs	Ctr	Risers	I	Wood	White	-0.1	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	-0.3	QM
014	C	WallCap	Ctr		I	Wood	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
015	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
016	D	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.2	QM
Interior Room 002 Bedroom A/B									
017	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
026	A	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
027	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
028	A	Window	Ctr	Sill	I	Wood	White	-0.3	QM
018	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
021	B	Ceiling			I	Drywall	White	-0.1	QM
019	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
022	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
020	D	Wall	L Ctr		I	Drywall	White	0.0	QM
024	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
023	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
025	D	Door	Lft	U Lft	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
029	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
033	A	Ceiling			I	Drywall	White	-0.2	QM
030	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
037	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
031	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
034	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
032	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
036	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
035	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
Interior Room 004 Living/Din									
038	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
042	A	Ceiling			I	Drywall	White	-0.1	QM
039	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
040	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
043	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
047	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	C	Window	Rgt	Sash	I	Wood	White	-0.1	QM
049	C	Window	Rgt	Sill	I	Wood	White	-0.2	QM
045	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
044	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
046	C	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
041	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 005 UpperBedD/A									
050	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
060	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
051	B	Wall	L Ctr		I	Drywall	White	0.0	QM
057	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
056	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
058	B	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
055	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
054	C	Ceiling			I	Drywall	White	-0.1	QM
053	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
059	D	Cabinet	Lft		I	Wood	Varnish	-0.1	QM
Interior Room 006 UpperBedA/B									
061	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
065	A	Ceiling			I	Drywall	White	-0.1	QM
070	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
071	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
072	A	Window	Lft	Sill	I	Wood	White	0.1	QM
062	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
063	C	Wall	L Ctr		I	Drywall	White	0.0	QM
066	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
064	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
068	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
067	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
069	D	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
073	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
Interior Room 007 MasterBath									
074	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
078	A	Ceiling			I	Drywall	White	-0.3	QM
081	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
080	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
082	A	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
075	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
076	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
079	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
077	D	Wall	L Ctr		I	Drywall	White	0.0	QM
083	D	Cabinet	Rgt		I	Wood	White	-0.3	QM
Interior Room 008 UpperBath									
084	A	Wall	L Ctr		I	Drywall	White	0.0	QM
088	A	Ceiling			I	Drywall	White	-0.3	QM
085	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
094	B	Cabinet	Lft		I	Wood	White	-0.1	QM
089	C	Wall	L Ctr		I	Ceramic	White	-0.2	QM
086	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
090	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
087	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
092	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
091	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
093	D	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
Interior Room 009 UpperBedB/C									
095	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
108	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
107	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
096	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
097	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
100	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
099	C	Ceiling			I	Drywall	White	-0.1	QM
104	C	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
105	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
106	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
098	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
101	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
103	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Interior Room 010 UpperBedC/D									
109	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
116	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
115	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
117	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
110	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
111	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
114	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
113	C	Ceiling			I	Drywall	White	-0.1	QM
118	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
119	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
120	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
112	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 011 UpperHall									
121	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
125	A	Ceiling			I	Drywall	White	-0.1	QM
130	A	Attic Hatch	Ctr		I	Wood	White	0.0	QM
131	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
122	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
128	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
127	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
129	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
123	C	Wall	L Ctr		I	Drywall	White	0.1	QM
126	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
124	D	Wall	L Ctr		I	Drywall	White	0.0	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:16
 Total Reading Sets: 131
 Job Started: 09/05/13 10:16
 Job Finished: 09/05/13 10:50

USCG Elizabeth City
 Housing Units
 380 Hercules Court- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Attic Hatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	11	0 <0%>	11 <100%>	0 <0%>	
Cabinet	5	0 <0%>	5 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf Sup.	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	11	0 <0%>	11 <100%>	0 <0%>	
Door Rgt jamb	11	0 <0%>	11 <100%>	0 <0%>	
Door U Ctr	9	0 <0%>	9 <100%>	0 <0%>	
Door U Lft	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Wall	45	0 <0%>	45 <100%>	0 <0%>	
WallCap	1	0 <0%>	1 <100%>	0 <0%>	
Window Apron	1	0 <0%>	1 <100%>	0 <0%>	
Window Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Window Sill	5	0 <0%>	5 <100%>	0 <0%>	
Inspection Totals:	131	0 < 0%>	131 <100%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 10:43

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
388 Hercules Court- Interior

INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____



Date: _____

9/11/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
Report Date: 9/10/2013
Abatement Level: 1.0
Report No. 09/05/13 10:43
Total Readings: 124 Actionable: 1
Job Started: 09/05/13 10:43
Job Finished: 09/05/13 11:30

USCG Elizabeth City
Housing Units
388 Hercules Court- Interior

Reading					Paint			Lead	
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	Mode
Interior Room 008 UpperBath									
084	C	Bathtub	Ctr		I	Porcelain	White	>9.9	QM
Calibration Readings									
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:43
 Total Readings: 124
 Job Started: 09/05/13 10:43
 Job Finished: 09/05/13 11:30

USCG Elizabeth City
 Housing Units
 388 Hercules Court- Interior

Read No.	Rm No.	Room Name	Wall Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A Wall	L Ctr		I Drywall		White	0.2	QM
2	001	Hall/Stairs	B Wall	L Ctr		I Drywall		White	0.3	QM
3	001	Hall/Stairs	C Wall	L Ctr		I Drywall		White	-0.4	QM
4	001	Hall/Stairs	D Wall	L Ctr		I Drywall		White	-0.4	QM
5	001	Hall/Stairs	C Ceiling			I Drywall		White	-0.4	QM
6	001	Hall/Stairs	B Baseboard	Lft		I Wood		White	-0.1	QM
7	001	Hall/Stairs	A Door	Ctr	Rgt casing	I Wood		White	0.0	QM
8	001	Hall/Stairs	A Door	Ctr	U Ctr	I Metal		White	-0.4	QM
9	001	Hall/Stairs	D Closet	Ctr	Door	I Wood		White	-1.0	QM
10	001	Hall/Stairs	D Closet	Ctr	Door Casing	I Wood		White	-0.9	QM
11	001	Hall/Stairs	D Stairs	Lft	Risers	I Wood		White	-0.7	QM
12	001	Hall/Stairs	D Stairs	Lft	Stringer	I Wood		White	-1.1	QM
13	001	Hall/Stairs	D Stairs	Lft	Treads	I Wood		Varnish	-1.0	QM
14	002	Bedroom A/B	A Wall	L Ctr		I Drywall		White	-0.5	QM
15	002	Bedroom A/B	B Wall	L Ctr		I Drywall		White	-1.1	QM
16	002	Bedroom A/B	C Wall	L Ctr		I Drywall		White	-0.6	QM
17	002	Bedroom A/B	D Wall	L Ctr		I Drywall		White	-0.7	QM
18	002	Bedroom A/B	C Ceiling			I Drywall		White	-0.6	QM
19	002	Bedroom A/B	A Baseboard	Ctr		I Wood		White	-0.4	QM
20	002	Bedroom A/B	D Door	Lft	Rgt jamb	I Wood		White	-0.5	QM
21	002	Bedroom A/B	D Door	Lft	U Ctr	I Wood		White	-0.7	QM
22	002	Bedroom A/B	A Window	Ctr	Rgt casing	I Wood		White	-0.4	QM
23	002	Bedroom A/B	A Window	Ctr	Sash	I Wood		White	-0.9	QM
24	003	Kitchen	A Wall	L Ctr		I Drywall		White	-0.3	QM
25	003	Kitchen	B Wall	L Ctr		I Drywall		White	-0.4	QM
26	003	Kitchen	C Wall	L Ctr		I Drywall		White	-0.4	QM
27	003	Kitchen	D Wall	L Ctr		I Drywall		White	-0.6	QM
28	003	Kitchen	C Ceiling			I Drywall		White	-0.4	QM
29	003	Kitchen	C Baseboard	Ctr		I Wood		White	-0.3	QM
30	003	Kitchen	C Door	Lft	Rgt jamb	I Wood		White	-0.6	QM
31	003	Kitchen	A Cabinet	Ctr		I Wood		Varnish	-0.3	QM
32	004	Living/Din	A Wall	L Ctr		I Drywall		White	-0.3	QM
33	004	Living/Din	B Wall	L Ctr		I Drywall		White	-0.4	QM
34	004	Living/Din	C Wall	L Ctr		I Drywall		White	-0.5	QM
35	004	Living/Din	D Wall	L Ctr		I Drywall		White	0.0	QM
36	004	Living/Din	C Ceiling			I Drywall		White	-1.0	QM
37	004	Living/Din	A Baseboard	Ctr		I Wood		White	-0.2	QM
38	004	Living/Din	C Door	Ctr	Rgt casing	I Wood		White	-0.5	QM
39	004	Living/Din	C Door	Ctr	U Ctr	I Metal		White	-0.4	QM
40	004	Living/Din	C Window	Lft	Rgt casing	I Wood		White	-0.3	QM
41	004	Living/Din	C Window	Lft	Sash	I Wood		White	-0.2	QM
42	005	UpperHall	A Wall	L Ctr		I Drywall		White	-0.4	QM
43	005	UpperHall	B Wall	L Ctr		I Drywall		White	-0.4	QM
44	005	UpperHall	C Wall	L Ctr		I Drywall		White	-0.4	QM
45	005	UpperHall	D Wall	L Ctr		I Drywall		White	-0.4	QM
46	005	UpperHall	C Ceiling			I Drywall		White	0.0	QM
47	005	UpperHall	B Baseboard	Ctr		I Wood		White	0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
48	005	UpperHall	D	Closet		Ctr Door Casing	I	Wood	White	0.1	QM
49	005	UpperHall	D	Closet		Ctr Door	I	Wood	White	0.2	QM
50	005	UpperHall	D	Closet		Ctr Floor	I	Wood	White	0.2	QM
51	005	UpperHall	D	WallCap		Rgt	I	Wood	White	-0.3	QM
52	005	UpperHall	D	Attic Casing		Ctr	I	Wood	White	0.3	QM
53	005	UpperHall	D	AccessHatch		Ctr	I	Wood	White	0.0	QM
54	006	UpperBedA	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
55	006	UpperBedA	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
56	006	UpperBedA	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
57	006	UpperBedA	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
58	006	UpperBedA	C	Ceiling			I	Drywall	White	0.0	QM
59	006	UpperBedA	A	Baseboard		Ctr	I	Wood	White	-0.8	QM
60	006	UpperBedA	C	Door		Rgt Rgt casing	I	Wood	White	-0.6	QM
61	006	UpperBedA	C	Door		Rgt U Ctr	I	Wood	White	0.0	QM
62	006	UpperBedA	A	Window		Lft Rgt casing	I	Wood	White	-0.3	QM
63	006	UpperBedA	A	Window		Lft Sash	I	Wood	White	-0.3	QM
64	006	UpperBedA	D	Closet		Rgt Shelf	I	Wood	White	-0.5	QM
65	006	UpperBedA	D	Closet		Rgt Shelf Sup.	I	Wood	White	-0.1	QM
66	007	MasterBath	A	Wall	U	Ctr	I	Drywall	White	-0.2	QM
67	007	MasterBath	B	Wall	U	Ctr	I	Drywall	White	0.1	QM
68	007	MasterBath	C	Wall	U	Ctr	I	Drywall	White	-0.1	QM
69	007	MasterBath	D	Wall	U	Lft	I	Drywall	White	-0.2	QM
70	007	MasterBath	C	Ceiling			I	Drywall	White	0.0	QM
71	007	MasterBath	C	Baseboard		Ctr	I	Vinyl	Black	-0.2	QM
72	007	MasterBath	A	Door		Ctr Rgt jamb	I	Wood	White	-0.1	QM
73	007	MasterBath	A	Door		Ctr U Ctr	I	Wood	White	0.0	QM
74	007	MasterBath	D	Cabinet		Rgt	I	Wood	White	-0.1	QM
75	008	UpperBath	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
76	008	UpperBath	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
77	008	UpperBath	C	Wall	L	Ctr	I	Drywall	White	-0.1	QM
78	008	UpperBath	D	Wall	L	Ctr	I	Drywall	White	0.0	QM
79	008	UpperBath	C	Ceiling			I	Drywall	White	-0.8	QM
80	008	UpperBath	C	Baseboard		Ctr	I	Vinyl	Black	-0.1	QM
81	008	UpperBath	D	Door		Rgt Rgt jamb	I	Wood	White	-0.2	QM
82	008	UpperBath	D	Door		Rgt U Ctr	I	Wood	White	-0.6	QM
83	008	UpperBath	B	Cabinet		Lft	I	Wood	White	-0.3	QM
84	008	UpperBath	C	Bathtub		Ctr	I	Porcelain	White	>9.9	QM
85	009	UpperBedB/C	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
86	009	UpperBedB/C	B	Wall	L	Ctr	I	Drywall	White	0.0	QM
87	009	UpperBedB/C	C	Wall	L	Ctr	I	Drywall	White	-0.1	QM
88	009	UpperBedB/C	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
89	009	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.3	QM
90	009	UpperBedB/C	A	Baseboard		Ctr	I	Wood	White	0.1	QM
91	009	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	-0.2	QM
92	009	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.3	QM
93	009	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
94	009	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.4	QM
95	009	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.3	QM
96	009	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	-0.1	QM
97	010	UpperBedC/D	A	Wall	L	Ctr	I	Drywall	White	-0.7	QM
98	010	UpperBedC/D	B	Wall	L	Ctr	I	Drywall	White	0.0	QM
99	010	UpperBedC/D	C	Wall	L	Ctr	I	Drywall	White	-0.1	QM
100	010	UpperBedC/D	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
101	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.2	QM
102	010	UpperBedC/D	A	Baseboard		Ctr	I	Wood	White	0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	010	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	0.1	QM
104	010	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
105	010	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
106	010	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.5	QM
107	010	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	-0.3	QM
108	010	UpperBedC/D	A	Closet		Lft Wall	I	Wood	White	-0.1	QM
109	010	UpperBedC/D	A	Closet		Lft Shelf	I	Wood	White	-0.1	QM
110	011	LowerBath	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
111	011	LowerBath	B	Wall	L	Ctr	I	Drywall	White	0.2	QM
112	011	LowerBath	C	Wall	L	Ctr	I	Drywall	White	0.2	QM
113	011	LowerBath	D	Wall	L	Ctr	I	Drywall	White	0.3	QM
114	011	LowerBath	C	Ceiling			I	Drywall	White	-0.6	QM
115	011	LowerBath	A	Baseboard		Ctr	I	Wood	White	-1.0	QM
116	011	LowerBath	B	Door		Rgt Rgt casing	I	Wood	White	-0.4	QM
117	011	LowerBath	B	Door		Rgt U Lft	I	Wood	White	-0.3	QM
118	011	LowerBath	D	Cabinet		Lft	I	Wood	Varnish	-0.6	QM
119		CALIBRATION								1.0	QM
120		CALIBRATION								1.0	QM
121		CALIBRATION								1.0	QM
122		CALIBRATION								-0.2	QM
123		CALIBRATION								-0.9	QM
124		CALIBRATION								-0.4	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:43
 Total Readings: 124
 Job Started: 09/05/13 10:43
 Job Finished: 09/05/13 11:30

USCG Elizabeth City
 Housing Units
 388 Hercules Court- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.2	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
008	A	Door	Ctr	U Ctr	I	Metal	White	-0.4	QM
002	B	Wall	L Ctr		I	Drywall	White	0.3	QM
006	B	Baseboard	Lft		I	Wood	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
005	C	Ceiling			I	Drywall	White	-0.4	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
013	D	Stairs	Lft	Treads	I	Wood	Varnish	-1.0	QM
011	D	Stairs	Lft	Risers	I	Wood	White	-0.7	QM
012	D	Stairs	Lft	Stringer	I	Wood	White	-1.1	QM
009	D	Closet	Ctr	Door	I	Wood	White	-1.0	QM
010	D	Closet	Ctr	Door Casing	I	Wood	White	-0.9	QM
Interior Room 002 Bedroom A/B									
014	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
019	A	Baseboard	Ctr		I	Wood	White	-0.4	QM
022	A	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
023	A	Window	Ctr	Sash	I	Wood	White	-0.9	QM
015	B	Wall	L Ctr		I	Drywall	White	-1.1	QM
016	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
018	C	Ceiling			I	Drywall	White	-0.6	QM
017	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
020	D	Door	Lft	Rgt jamb	I	Wood	White	-0.5	QM
021	D	Door	Lft	U Ctr	I	Wood	White	-0.7	QM
Interior Room 003 Kitchen									
024	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
031	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
025	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
026	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
029	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
028	C	Ceiling			I	Drywall	White	-0.4	QM
030	C	Door	Lft	Rgt jamb	I	Wood	White	-0.6	QM
027	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
Interior Room 004 Living/Din									
032	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
037	A	Baseboard	Ctr		I	Wood	White	-0.2	QM
033	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
034	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
036	C	Ceiling			I	Drywall	White	-1.0	QM
040	C	Window	Lft	Rgt casing	I	Wood	White	-0.3	QM
041	C	Window	Lft	Sash	I	Wood	White	-0.2	QM
038	C	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
039	C	Door	Ctr	U Ctr	I	Metal	White	-0.4	QM
035	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 005 UpperHall									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
042	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
043	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
047	B	Baseboard	Ctr		I	Wood	White	0.1	QM
044	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
046	C	Ceiling			I	Drywall	White	0.0	QM
045	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
049	D	Closet	Ctr	Door	I	Wood	White	0.2	QM
048	D	Closet	Ctr	Door Casing	I	Wood	White	0.1	QM
050	D	Closet	Ctr	Floor	I	Wood	White	0.2	QM
052	D	Attic Casing	Ctr		I	Wood	White	0.3	QM
053	D	AccessHatch	Ctr		I	Wood	White	0.0	QM
051	D	WallCap	Rgt		I	Wood	White	-0.3	QM
Interior Room 006 UpperBedA									
054	A	Wall	L Ctr		I	Drywall	White	0.0	QM
059	A	Baseboard	Ctr		I	Wood	White	-0.8	QM
062	A	Window	Lft	Rgt casing	I	Wood	White	-0.3	QM
063	A	Window	Lft	Sash	I	Wood	White	-0.3	QM
055	B	Wall	L Ctr		I	Drywall	White	0.1	QM
056	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
058	C	Ceiling			I	Drywall	White	0.0	QM
060	C	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
061	C	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
057	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
065	D	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
064	D	Closet	Rgt	Shelf	I	Wood	White	-0.5	QM
Interior Room 007 MasterBath									
066	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
072	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
073	A	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
067	B	Wall	U Ctr		I	Drywall	White	0.1	QM
068	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
071	C	Baseboard	Ctr		I	Vinyl	Black	-0.2	QM
070	C	Ceiling			I	Drywall	White	0.0	QM
069	D	Wall	U Lft		I	Drywall	White	-0.2	QM
074	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
Interior Room 008 UpperBath									
075	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
076	B	Wall	L Ctr		I	Drywall	White	0.1	QM
083	B	Cabinet	Lft		I	Wood	White	-0.3	QM
077	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
080	C	Baseboard	Ctr		I	Vinyl	Black	-0.1	QM
079	C	Ceiling			I	Drywall	White	-0.8	QM
084	C	Bathtub	Ctr		I	Porcelain	White	>9.9	QM
078	D	Wall	L Ctr		I	Drywall	White	0.0	QM
081	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
082	D	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
Interior Room 009 UpperBedB/C									
085	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
090	A	Baseboard	Ctr		I	Wood	White	0.1	QM
095	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
096	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
086	B	Wall	L Ctr		I	Drywall	White	0.0	QM
087	C	Wall	L Ctr		I	Drywall	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
089	C	Ceiling			I	Drywall	White	-0.3	QM
093	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
094	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
088	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
091	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
092	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
Interior Room 010 UpperBedC/D									
097	A	Wall	L Ctr		I	Drywall	White	-0.7	QM
102	A	Baseboard	Ctr		I	Wood	White	0.1	QM
103	A	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
104	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
107	A	Closet	Lft	Door	I	Wood	White	-0.3	QM
108	A	Closet	Lft	Wall	I	Wood	White	-0.1	QM
109	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
098	B	Wall	L Ctr		I	Drywall	White	0.0	QM
099	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
101	C	Ceiling			I	Drywall	White	-0.2	QM
105	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
106	C	Window	Ctr	Sash	I	Wood	White	-0.5	QM
100	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 011 LowerBath									
110	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
115	A	Baseboard	Ctr		I	Wood	White	-1.0	QM
111	B	Wall	L Ctr		I	Drywall	White	0.2	QM
116	B	Door	Rgt	Rgt casing	I	Wood	White	-0.4	QM
117	B	Door	Rgt	U Lft	I	Wood	White	-0.3	QM
112	C	Wall	L Ctr		I	Drywall	White	0.2	QM
114	C	Ceiling			I	Drywall	White	-0.6	QM
113	D	Wall	L Ctr		I	Drywall	White	0.3	QM
118	D	Cabinet	Lft		I	Wood	Varnish	-0.6	QM
Calibration Readings									
119								1.0	QM
120								1.0	QM
121								1.0	QM
122								-0.2	QM
123								-0.9	QM
124								-0.4	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 10:43
 Total Reading Sets: 118
 Job Started: 09/05/13 10:43
 Job Finished: 09/05/13 11:30

USCG Elizabeth City
 Housing Units
 388 Hercules Court- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
AccessHatch	1	0 <0%>	1 <100%>	0 <0%>	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	11	0 <0%>	11 <100%>	0 <0%>	
Bathtub	1	1 <100%>	0 <0%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	4	0 <0%>	4 <100%>	0 <0%>	
Closet Door Casing	2	0 <0%>	2 <100%>	0 <0%>	
Closet Floor	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	3	0 <0%>	3 <100%>	0 <0%>	
Closet Shelf Sup.	1	0 <0%>	1 <100%>	0 <0%>	
Closet Wall	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Door Rgt jamb	4	0 <0%>	4 <100%>	0 <0%>	
Door U Ctr	8	0 <0%>	8 <100%>	0 <0%>	
Door U Lft	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Wall	44	0 <0%>	44 <100%>	0 <0%>	
WallCap	1	0 <0%>	1 <100%>	0 <0%>	
Window Rgt casing	5	0 <0%>	5 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Inspection Totals:	118	1 < 1%>	117 < 99%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 10:34

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
289 Gulfstream Drive- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____



Date: _____

9/11/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 10:34
 Total Readings: 120 Actionable: 2
 Job Started: 09/04/13 10:34
 Job Finished: 09/04/13 11:09

USCG Elizabeth City
 Housing Units
 289 Gulfstream Drive- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 008 MasterBath									
079	A	Wall	L Lft		I	Ceramic	Tan	5.5	QM
Interior Room 009 UpperBath									
090	D	Wall	L Ctr		I	Ceramic	Tan	4.3	QM
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 10:34
 Total Readings: 120
 Job Started: 09/04/13 10:34
 Job Finished: 09/04/13 11:09

USCG Elizabeth City
 Housing Units
 289 Gulfstream Drive- Interior

Read No.	Rm No.	Room Name	Wall Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A Wall	U Ctr		I Drywall		White	0.0	QM
2	001	Hall/Stairs	B Wall	L Ctr		I Drywall		White	-0.4	QM
3	001	Hall/Stairs	C Wall	L Ctr		I Drywall		White	-0.1	QM
4	001	Hall/Stairs	D Wall	L Ctr		I Drywall		White	0.0	QM
5	001	Hall/Stairs	C Ceiling			I Drywall		White	-0.1	QM
6	001	Hall/Stairs	D Baseboard		Rgt	I Wood		White	-0.4	QM
7	001	Hall/Stairs	A Door		Ctr Rgt casing	I Wood		White	-0.1	QM
8	001	Hall/Stairs	A Door		Ctr U Ctr	I Metal		White	0.0	QM
9	001	Hall/Stairs	D Closet		Ctr Shelf Sup.	I Wood		White	0.0	QM
10	001	Hall/Stairs	D Stairs		Ctr Risers	P Wood		White	-0.1	QM
11	001	Hall/Stairs	D Stairs		Ctr Stringer	I Wood		White	0.1	QM
12	001	Hall/Stairs	D Stairs		Ctr Treads	I Wood		Varnish	0.0	QM
13	002	Bedroom A/B	A Wall	L Ctr		I Drywall		White	-0.2	QM
14	002	Bedroom A/B	B Wall	L Ctr		I Drywall		White	-0.1	QM
15	002	Bedroom A/B	C Wall	L Ctr		I Drywall		White	-0.2	QM
16	002	Bedroom A/B	D Wall	L Ctr		I Drywall		White	-0.8	QM
17	002	Bedroom A/B	C Ceiling			I Drywall		White	-0.2	QM
18	002	Bedroom A/B	A Baseboard		Ctr	I Wood		White	-0.1	QM
19	002	Bedroom A/B	D Door		Lft Rgt casing	I Wood		White	-0.1	QM
20	002	Bedroom A/B	D Door		Lft U Ctr	I Wood		White	-0.5	QM
21	002	Bedroom A/B	A Window		Ctr Sash	I Wood		White	-0.2	QM
22	002	Bedroom A/B	A Window		Ctr Sill	I Wood		White	0.1	QM
23	002	Bedroom A/B	B Mini Blinds		Ctr	I Vinyl		White	-0.1	QM
24	003	Kitchen	A Wall	L Ctr		I Drywall		White	0.0	QM
25	003	Kitchen	B Wall	L Ctr		I Drywall		White	-0.4	QM
26	003	Kitchen	C Wall	L Ctr		I Drywall		White	0.2	QM
27	003	Kitchen	D Wall	L Ctr		I Drywall		White	0.3	QM
28	003	Kitchen	C Ceiling			I Drywall		White	-0.9	QM
29	003	Kitchen	D Baseboard		Ctr	I Vinyl		Black	-0.3	QM
30	003	Kitchen	A Cabinet		Ctr	I Wood		Varnish	-0.6	QM
31	004	Living/Din	A Wall	L Ctr		I Drywall		White	-0.5	QM
32	004	Living/Din	B Wall	L Ctr		I Drywall		White	-0.2	QM
33	004	Living/Din	C Wall	L Ctr		I Drywall		White	0.1	QM
34	004	Living/Din	D Wall	L Ctr		I Drywall		White	-0.4	QM
35	004	Living/Din	C Ceiling			I Drywall		White	-0.5	QM
36	004	Living/Din	A Baseboard		Ctr	I Wood		White	0.0	QM
37	004	Living/Din	C Door		Ctr Rgt casing	I Wood		White	-0.2	QM
38	004	Living/Din	C Door		Ctr U Ctr	I Wood		White	-0.3	QM
39	004	Living/Din	C Window		Rgt Rgt casing	I Wood		White	-0.3	QM
40	004	Living/Din	C Window		Rgt Sash	I Vinyl		White	-0.1	QM
41	005	LowerBath	A Wall	L Ctr		I Drywall		White	0.1	QM
42	005	LowerBath	B Wall	L Ctr		I Drywall		White	-0.2	QM
43	005	LowerBath	C Wall	L Ctr		I Drywall		White	0.0	QM
44	005	LowerBath	D Wall	L Ctr		I Drywall		White	-0.3	QM
45	005	LowerBath	C Ceiling			I Drywall		White	-0.5	QM
46	005	LowerBath	B Door		Rgt Rgt jamb	I Wood		White	-0.3	QM
47	005	LowerBath	B Door		Rgt U Lft	I Wood		White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	LowerBath	A	Closet		Ctr Shelf	I	Wood	White	-0.3	QM
49	005	LowerBath	A	Baseboard		Ctr	I	Wood	White	-0.3	QM
50	006	UpperHall	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
51	006	UpperHall	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
52	006	UpperHall	C	Wall	L	Ctr	I	Drywall	White	-0.5	QM
53	006	UpperHall	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
54	006	UpperHall	C	Ceiling			I	Drywall	White	-0.3	QM
55	006	UpperHall	D	Baseboard		Ctr	I	Wood	White	0.0	QM
56	006	UpperHall	D	Closet		Ctr Door Casing	I	Wood	White	-0.2	QM
57	006	UpperHall	D	Closet		Ctr Door	I	Wood	White	0.0	QM
58	006	UpperHall	D	Closet		Ctr Shelf	I	Wood	White	-0.4	QM
59	006	UpperHall	A	Attic Hatch		Ctr	I	Wood	White	-0.3	QM
60	006	UpperHall	A	Attic Casing		Ctr	I	Wood	White	-0.4	QM
61	006	UpperHall	D	WallCap		Ctr	I	Wood	White	0.0	QM
62	007	UpperBedA	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
63	007	UpperBedA	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
64	007	UpperBedA	C	Wall	L	Ctr	I	Drywall	White	0.0	QM
65	007	UpperBedA	D	Wall	L	Ctr	I	Drywall	White	0.3	QM
66	007	UpperBedA	C	Ceiling			I	Drywall	White	-0.4	QM
67	007	UpperBedA	A	Baseboard		Ctr	I	Wood	White	-0.1	QM
68	007	UpperBedA	C	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
69	007	UpperBedA	C	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
70	007	UpperBedA	C	Window		Lft Sash	I	Wood	White	-0.1	QM
71	007	UpperBedA	C	Window		Lft Sill	I	Wood	White	0.3	QM
72	007	UpperBedA	D	Closet		Rgt Shelf	I	Wood	White	-0.5	QM
73	007	UpperBedA	D	Closet		Rgt Shelf Sup.	I	Wood	White	-0.3	QM
74	008	MasterBath	A	Wall	U	Ctr	I	Drywall	White	-0.4	QM
75	008	MasterBath	B	Wall	U	Ctr	I	Drywall	White	-0.6	QM
76	008	MasterBath	C	Wall	U	Ctr	I	Drywall	White	-0.9	QM
77	008	MasterBath	D	Wall	U	Ctr	I	Drywall	White	-0.6	QM
78	008	MasterBath	C	Ceiling			I	Drywall	White	-0.4	QM
79	008	MasterBath	A	Wall	L	Lft	I	Ceramic	Tan	5.5	QM
80	008	MasterBath	A	Door		Rgt Rgt casing	I	Wood	White	-0.6	QM
81	008	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	-1.0	QM
82	008	MasterBath	D	Cabinet		Rgt	I	Wood	White	-0.2	QM
83	008	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.4	QM
84	008	MasterBath	D	Sink		Rgt	I	Porcelain	White	-0.8	QM
85	009	UpperBath	A	Wall	U	Ctr	I	Drywall	White	0.0	QM
86	009	UpperBath	B	Wall	U	Ctr	I	Drywall	White	-0.8	QM
87	009	UpperBath	C	Wall	U	Ctr	I	Drywall	White	-0.7	QM
88	009	UpperBath	D	Wall	U	Ctr	I	Drywall	White	-0.4	QM
89	009	UpperBath	A	Ceiling			I	Drywall	White	-0.3	QM
90	009	UpperBath	D	Wall	L	Ctr	I	Ceramic	Tan	4.3	QM
91	009	UpperBath	D	Door		Ctr Rgt casing	I	Wood	White	-0.3	QM
92	009	UpperBath	D	Door		Ctr U Ctr	I	Wood	White	-0.3	QM
93	009	UpperBath	B	Cabinet		Rgt	I	Wood	White	-0.2	QM
94	009	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.5	QM
95	009	UpperBath	B	Sink		Rgt	I	Porcelain	White	-0.1	QM
96	010	UpperBedB/C	A	Wall	L	Lft	I	Drywall	White	-0.2	QM
97	010	UpperBedB/C	B	Wall	L	Rgt	I	Drywall	White	-0.1	QM
98	010	UpperBedB/C	C	Wall	L	Lft	I	Drywall	White	0.0	QM
99	010	UpperBedB/C	D	Wall	L	Lft	I	Drywall	White	0.1	QM
100	010	UpperBedB/C	C	Ceiling			I	Drywall	White	0.0	QM
101	010	UpperBedB/C	D	Baseboard		Lft	I	Wood	White	-0.2	QM
102	010	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
103	010	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	0.1	QM
104	010	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.3	QM
105	010	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	-0.4	QM
106	010	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.3	QM
107	010	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	0.0	QM
108	010	UpperBedB/C	C	Mini Blinds		Ctr	I	Vinyl	White	-0.7	QM
109	011	UpperBedC/D	A	Wall		L Ctr	I	Drywall	White	0.2	QM
110	011	UpperBedC/D	B	Wall		L Ctr	I	Drywall	White	-0.2	QM
111	011	UpperBedC/D	C	Wall		L Ctr	I	Drywall	White	-0.3	QM
112	011	UpperBedC/D	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
113	011	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.2	QM
114	011	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	-0.3	QM
115	011	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
116	011	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	0.0	QM
117	011	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.2	QM
118	011	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.3	QM
119	011	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	-0.2	QM
120	011	UpperBedC/D	A	Closet		Lft Shelf Sup.	I	Wood	White	-0.3	QM
----- End of Readings -----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	289 Gulfstream Drive- Interior
Report No.	09/04/13 10:34	
Total Readings:	120	
Job Started:	09/04/13 10:34	
Job Finished:	09/04/13 11:09	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	U Ctr		I	Drywall	White	0.0	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
008	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
005	C	Ceiling			I	Drywall	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	0.0	QM
006	D	Baseboard	Rgt		I	Wood	White	-0.4	QM
012	D	Stairs	Ctr	Treads	I	Wood	Varnish	0.0	QM
010	D	Stairs	Ctr	Risers	P	Wood	White	-0.1	QM
011	D	Stairs	Ctr	Stringer	I	Wood	White	0.1	QM
009	D	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
Interior Room 002 Bedroom A/B									
013	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
018	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
021	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
022	A	Window	Ctr	Sill	I	Wood	White	0.1	QM
014	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
023	B	Mini Blinds	Ctr		I	Vinyl	White	-0.1	QM
015	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
017	C	Ceiling			I	Drywall	White	-0.2	QM
016	D	Wall	L Ctr		I	Drywall	White	-0.8	QM
019	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
020	D	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
Interior Room 003 Kitchen									
024	A	Wall	L Ctr		I	Drywall	White	0.0	QM
030	A	Cabinet	Ctr		I	Wood	Varnish	-0.6	QM
025	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
026	C	Wall	L Ctr		I	Drywall	White	0.2	QM
028	C	Ceiling			I	Drywall	White	-0.9	QM
027	D	Wall	L Ctr		I	Drywall	White	0.3	QM
029	D	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
Interior Room 004 Living/Din									
031	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
036	A	Baseboard	Ctr		I	Wood	White	0.0	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
033	C	Wall	L Ctr		I	Drywall	White	0.1	QM
035	C	Ceiling			I	Drywall	White	-0.5	QM
039	C	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
040	C	Window	Rgt	Sash	I	Vinyl	White	-0.1	QM
037	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
038	C	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 005 LowerBath									
041	A	Wall	L Ctr		I	Drywall	White	0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
049	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
048	A	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
042	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
046	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
047	B	Door	Rgt	U Lft	I	Wood	White	-0.3	QM
043	C	Wall	L Ctr		I	Drywall	White	0.0	QM
045	C	Ceiling			I	Drywall	White	-0.5	QM
044	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 006 UpperHall									
050	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
059	A	Attic Hatch	Ctr		I	Wood	White	-0.3	QM
060	A	Attic Casing	Ctr		I	Wood	White	-0.4	QM
051	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
054	C	Ceiling			I	Drywall	White	-0.3	QM
053	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
055	D	Baseboard	Ctr		I	Wood	White	0.0	QM
057	D	Closet	Ctr	Door	I	Wood	White	0.0	QM
056	D	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
058	D	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
061	D	WallCap	Ctr		I	Wood	White	0.0	QM
Interior Room 007 UpperBedA									
062	A	Wall	L Ctr		I	Drywall	White	0.0	QM
067	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
063	B	Wall	L Ctr		I	Drywall	White	0.1	QM
064	C	Wall	L Ctr		I	Drywall	White	0.0	QM
066	C	Ceiling			I	Drywall	White	-0.4	QM
070	C	Window	Lft	Sash	I	Wood	White	-0.1	QM
071	C	Window	Lft	Sill	I	Wood	White	0.3	QM
068	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
069	C	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
065	D	Wall	L Ctr		I	Drywall	White	0.3	QM
073	D	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.3	QM
072	D	Closet	Rgt	Shelf	I	Wood	White	-0.5	QM
Interior Room 008 MasterBath									
079	A	Wall	L Lft		I	Ceramic	Tan	5.5	QM
074	A	Wall	U Ctr		I	Drywall	White	-0.4	QM
080	A	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
081	A	Door	Rgt	U Ctr	I	Wood	White	-1.0	QM
075	B	Wall	U Ctr		I	Drywall	White	-0.6	QM
076	C	Wall	U Ctr		I	Drywall	White	-0.9	QM
078	C	Ceiling			I	Drywall	White	-0.4	QM
083	C	Bathtub	Ctr		I	Porcelain	White	-0.4	QM
077	D	Wall	U Ctr		I	Drywall	White	-0.6	QM
082	D	Cabinet	Rgt		I	Wood	White	-0.2	QM
084	D	Sink	Rgt		I	Porcelain	White	-0.8	QM
Interior Room 009 UpperBath									
085	A	Wall	U Ctr		I	Drywall	White	0.0	QM
089	A	Ceiling			I	Drywall	White	-0.3	QM
094	A	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
086	B	Wall	U Ctr		I	Drywall	White	-0.8	QM
093	B	Cabinet	Rgt		I	Wood	White	-0.2	QM
095	B	Sink	Rgt		I	Porcelain	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
087	C	Wall	U Ctr		I	Drywall	White	-0.7	QM
090	D	Wall	L Ctr		I	Ceramic	Tan	4.3	QM
088	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
091	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
092	D	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
Interior Room 010 UpperBedB/C									
096	A	Wall	L Lft		I	Drywall	White	-0.2	QM
106	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
107	A	Closet	Rgt	Shelf	I	Wood	White	0.0	QM
097	B	Wall	L Rgt		I	Drywall	White	-0.1	QM
098	C	Wall	L Lft		I	Drywall	White	0.0	QM
100	C	Ceiling			I	Drywall	White	0.0	QM
104	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
105	C	Window	Ctr	Sill	I	Wood	White	-0.4	QM
108	C	Mini Blinds	Ctr		I	Vinyl	White	-0.7	QM
099	D	Wall	L Lft		I	Drywall	White	0.1	QM
101	D	Baseboard	Lft		I	Wood	White	-0.2	QM
102	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
103	D	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
Interior Room 011 UpperBedC/D									
109	A	Wall	L Ctr		I	Drywall	White	0.2	QM
115	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
116	A	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
119	A	Closet	Lft	Door	I	Wood	White	-0.2	QM
120	A	Closet	Lft	Shelf Sup.	I	Wood	White	-0.3	QM
110	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
111	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
114	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
113	C	Ceiling			I	Drywall	White	-0.2	QM
117	C	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
118	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
112	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 10:34
 Total Reading Sets: 120
 Job Started: 09/04/13 10:34
 Job Finished: 09/04/13 11:09

USCG Elizabeth City
 Housing Units
 289 Gulfstream Drive- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Attic Hatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	9	0 <0%>	9 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	3	0 <0%>	3 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	3	0 <0%>	3 <100%>	0 <0%>	
Closet Door Casing	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	4	0 <0%>	4 <100%>	0 <0%>	
Closet Shelf Sup.	3	0 <0%>	3 <100%>	0 <0%>	
Door Rgt casing	7	0 <0%>	7 <100%>	0 <0%>	
Door Rgt jamb	2	0 <0%>	2 <100%>	0 <0%>	
Door U Ctr	8	0 <0%>	8 <100%>	0 <0%>	
Door U Lft	1	0 <0%>	1 <100%>	0 <0%>	
Mini Blinds	2	0 <0%>	2 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Wall	46	2 <4%>	44 <96%>	0 <0%>	
WallCap	1	0 <0%>	1 <100%>	0 <0%>	
Window Rgt casing	2	0 <0%>	2 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Window Sill	3	0 <0%>	3 <100%>	0 <0%>	
Inspection Totals:	120	2 < 2%>	118 < 98%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 14:21

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
340 Pelican Street- Interior


INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____

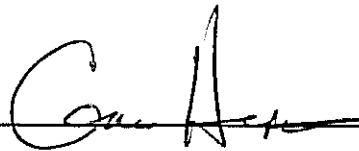

Date: _____

9-11-2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13 USCG Elizabeth City
Report Date: 9/10/2013 Housing Units
Abatement Level: 1.0 340 Pelican Street- Interior
Report No. 09/04/13 14:21
Total Readings: 119 Actionable: 2
Job Started: 09/04/13 14:21
Job Finished: 09/04/13 15:01

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 007 MasterBath									
070	A	Wall	L Lft		I	Ceramic	Tan	4.4	QM
Interior Room 008 UpperBath									
081	A	Wall	L Lft		I	Ceramic	Tan	4.2	QM
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 14:21
 Total Readings: 119
 Job Started: 09/04/13 14:21
 Job Finished: 09/04/13 15:01

USCG Elizabeth City
 Housing Units
 340 Pelican Street- Interior

Read No.	Rm No.	Room Name	Wall Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A Wall	L Ctr		I Drywall		White	-0.1	QM
2	001	Hall/Stairs	B Wall	L Ctr		I Drywall		White	-0.1	QM
3	001	Hall/Stairs	C Wall	L Ctr		I Drywall		White	-0.1	QM
4	001	Hall/Stairs	D Wall	L Ctr		I Drywall		White	-0.3	QM
5	001	Hall/Stairs	C Ceiling			I Drywall		White	-0.1	QM
6	001	Hall/Stairs	C Baseboard		Ctr	I Wood		White	0.1	QM
7	001	Hall/Stairs	A Door		Ctr Rgt casing	I Wood		White	0.0	QM
8	001	Hall/Stairs	A Door		Ctr U Ctr	I Metal		White	-0.1	QM
9	001	Hall/Stairs	D Closet		Ctr Door	I Wood		White	-0.3	QM
10	001	Hall/Stairs	D Closet		Ctr Door Casing	I Wood		White	-0.2	QM
11	001	Hall/Stairs	D Closet		Ctr Shelf	I Wood		White	0.0	QM
12	001	Hall/Stairs	D Stairs		Lft Risers	I Wood		White	-0.1	QM
13	001	Hall/Stairs	D Stairs		Lft Stringer	I Wood		White	-0.1	QM
14	001	Hall/Stairs	D Stairs		Lft Treads	I Wood		Varnish	-0.1	QM
15	002	Bedroom A/B	A Wall	L Ctr		I Drywall		White	-0.2	QM
16	002	Bedroom A/B	B Wall	L Ctr		I Drywall		White	-0.4	QM
17	002	Bedroom A/B	C Wall	L Ctr		I Drywall		White	0.1	QM
18	002	Bedroom A/B	D Wall	L Ctr		I Drywall		White	-0.4	QM
19	002	Bedroom A/B	C Ceiling			I Drywall		White	-1.0	QM
20	002	Bedroom A/B	D Baseboard		Ctr	I Wood		White	-0.3	QM
21	002	Bedroom A/B	D Door		Lft Lft casing	I Wood		White	-0.1	QM
22	002	Bedroom A/B	D Door		Lft U Ctr	I Wood		White	-0.3	QM
23	002	Bedroom A/B	A Window		Ctr Sash	I Wood		White	-0.5	QM
24	002	Bedroom A/B	A Window		Ctr Sill	I Wood		White	-0.3	QM
25	003	Kitchen	A Wall	L Ctr		I Drywall		White	-0.2	QM
26	003	Kitchen	B Wall	L Ctr		I Drywall		White	-0.1	QM
27	003	Kitchen	C Wall	L Ctr		I Drywall		White	-0.2	QM
28	003	Kitchen	D Wall	L Ctr		I Drywall		White	0.1	QM
29	003	Kitchen	C Ceiling			I Drywall		White	-0.3	QM
30	003	Kitchen	B Baseboard		Ctr	I Vinyl		Black	-0.6	QM
31	003	Kitchen	B Cabinet		Ctr	I Wood		Varnish	-0.1	QM
32	004	Living/Din	A Wall	L Ctr		I Drywall		White	-0.3	QM
33	004	Living/Din	B Wall	L Ctr		I Drywall		White	0.2	QM
34	004	Living/Din	C Wall	L Ctr		I Drywall		White	0.2	QM
35	004	Living/Din	D Wall	L Ctr		I Drywall		White	0.0	QM
36	004	Living/Din	C Ceiling			I Drywall		White	-0.1	QM
37	004	Living/Din	D Baseboard		Ctr	I Wood		White	-0.1	QM
38	004	Living/Din	C Door		Lft Rgt casing	I Wood		White	0.0	QM
39	004	Living/Din	C Door		Lft U Ctr	I Metal		White	-0.1	QM
40	004	Living/Din	C Window		Rgt Rgt casing	I Wood		White	-0.2	QM
41	004	Living/Din	C Window		Rgt Sash	I Vinyl		White	-0.2	QM
42	005	UpperHall	A Wall	L Ctr		I Drywall		White	-0.1	QM
43	005	UpperHall	B Wall	L Ctr		I Drywall		White	0.0	QM
44	005	UpperHall	C Wall	L Ctr		I Drywall		White	0.1	QM
45	005	UpperHall	D Wall	L Ctr		I Drywall		White	-0.2	QM
46	005	UpperHall	C Ceiling			I Drywall		White	-0.2	QM
47	005	UpperHall	D Baseboard		Rgt	I Wood		White	-0.5	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall Structure		Location	Member	Paint		Color	Lead (mg/cm²)	Mode
							Cond	Substrate			
48	005	UpperHall	D	Closet		Ctr Door Casing	I Wood	White	-0.1	QM	
49	005	UpperHall	D	Closet		Ctr Door	I Wood	White	-0.1	QM	
50	005	UpperHall	D	Closet		Ctr Shelf	I Wood	White	-1.0	QM	
51	005	UpperHall	D	WallCap		Ctr	I Wood	White	-0.2	QM	
52	005	UpperHall	A	Attic Casing		Ctr	I Wood	White	0.0	QM	
53	005	UpperHall	A	Attic Hatch		Ctr	I Wood	White	0.0	QM	
54	006	UpperBedA	A	Wall	L	Ctr	I Drywall	White	0.2	QM	
55	006	UpperBedA	B	Wall	L	Ctr	I Drywall	White	-0.2	QM	
56	006	UpperBedA	C	Wall	L	Ctr	I Drywall	White	0.1	QM	
57	006	UpperBedA	D	Wall	L	Ctr	I Drywall	White	-0.3	QM	
58	006	UpperBedA	C	Ceiling			I Drywall	White	-0.3	QM	
59	006	UpperBedA	A	Baseboard		Ctr	I Wood	White	-0.1	QM	
60	006	UpperBedA	C	Door		Rgt Rgt casing	I Wood	White	-0.2	QM	
61	006	UpperBedA	C	Door		Rgt U Ctr	I Wood	White	0.0	QM	
62	006	UpperBedA	A	Window		Lft Sash	I Wood	White	0.0	QM	
63	006	UpperBedA	A	Window		Lft Sill	I Wood	White	-0.3	QM	
64	006	UpperBedA	D	Closet		Rgt Shelf	I Wood	White	-0.2	QM	
65	007	MasterBath	A	Wall	U	Ctr	I Drywall	White	0.0	QM	
66	007	MasterBath	B	Wall	U	Ctr	I Drywall	White	-0.2	QM	
67	007	MasterBath	C	Wall	U	Ctr	I Drywall	White	-0.1	QM	
68	007	MasterBath	D	Wall	U	Ctr	I Drywall	White	0.1	QM	
69	007	MasterBath	C	Ceiling			I Drywall	White	0.2	QM	
70	007	MasterBath	A	Wall	L	Lft	I Ceramic	Tan	4.4	QM	
71	007	MasterBath	A	Door		Rgt Rgt jamb	I Wood	White	-0.5	QM	
72	007	MasterBath	A	Door		Rgt U Ctr	I Wood	White	-0.1	QM	
73	007	MasterBath	D	Cabinet		Rgt	I Wood	White	-0.1	QM	
74	007	MasterBath	D	Sink		Rgt	I Porcelain	White	-0.5	QM	
75	007	MasterBath	C	Bathtub		Ctr	I Porcelain	White	-0.1	QM	
76	008	UpperBath	A	Wall	U	Ctr	I Drywall	White	0.2	QM	
77	008	UpperBath	B	Wall	U	Ctr	I Drywall	White	-0.2	QM	
78	008	UpperBath	C	Wall	U	Ctr	I Drywall	White	-0.4	QM	
79	008	UpperBath	D	Wall	U	Ctr	I Drywall	White	-0.2	QM	
80	008	UpperBath	C	Ceiling			I Drywall	White	-0.5	QM	
81	008	UpperBath	A	Wall	L	Lft	I Ceramic	Tan	4.2	QM	
82	008	UpperBath	D	Door		Ctr Rgt casing	I Wood	White	-0.9	QM	
83	008	UpperBath	D	Door		Ctr U Ctr	I Wood	White	-0.2	QM	
84	008	UpperBath	B	Cabinet		Rgt	I Wood	White	-0.2	QM	
85	008	UpperBath	B	Sink		Rgt	I Porcelain	White	-1.8	QM	
86	008	UpperBath	A	Bathtub		Ctr	I Porcelain	White	-0.3	QM	
87	009	UpperBedB/C	A	Wall	L	Ctr	I Drywall	White	0.0	QM	
88	009	UpperBedB/C	B	Wall	L	Ctr	I Drywall	White	-0.3	QM	
89	009	UpperBedB/C	C	Wall	L	Ctr	I Drywall	White	-0.1	QM	
90	009	UpperBedB/C	D	Wall	L	Ctr	I Drywall	White	0.0	QM	
91	009	UpperBedB/C	C	Ceiling			I Drywall	White	-0.1	QM	
92	009	UpperBedB/C	A	Baseboard		Ctr	I Wood	White	0.0	QM	
93	009	UpperBedB/C	D	Door		Rgt Lft jamb	I Wood	White	0.1	QM	
94	009	UpperBedB/C	D	Door		Rgt U Ctr	I Wood	White	0.2	QM	
95	009	UpperBedB/C	C	Window		Ctr Rgt casing	I Wood	White	-0.1	QM	
96	009	UpperBedB/C	C	Window		Ctr Sash	I Wood	White	-0.3	QM	
97	009	UpperBedB/C	A	Closet		Rgt Door	I Wood	White	-0.1	QM	
98	009	UpperBedB/C	A	Closet		Rgt Shelf Sup.	I Wood	White	-0.5	QM	
99	010	UpperBedC/D	A	Wall	L	Ctr	I Drywall	White	-0.5	QM	
100	010	UpperBedC/D	B	Wall	L	Ctr	I Drywall	White	-0.4	QM	
101	010	UpperBedC/D	C	Wall	L	Ctr	I Drywall	White	-0.4	QM	
102	010	UpperBedC/D	D	Wall	L	Ctr	I Drywall	White	0.2	QM	

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
103	010	UpperBedC/D	C	Ceiling			I	Drywall	White	0.1	QM
104	010	UpperBedC/D	A	Baseboard		Ctr	I	Wood	White	0.1	QM
105	010	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	0.3	QM
106	010	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
107	010	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
108	010	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.2	QM
109	010	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	-0.5	QM
110	010	UpperBedC/D	A	Closet		Lft Shelf	I	Wood	White	-0.6	QM
111	011	LowerBath	A	Wall		L Ctr	I	Drywall	White	-0.5	QM
112	011	LowerBath	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
113	011	LowerBath	C	Wall		L Ctr	I	Drywall	White	0.3	QM
114	011	LowerBath	D	Wall		L Ctr	I	Drywall	White	-0.1	QM
115	011	LowerBath	C	Ceiling			I	Drywall	White	-0.6	QM
116	011	LowerBath	A	Baseboard		Ctr	I	Wood	White	0.0	QM
117	011	LowerBath	B	Door		Rgt Rgt casing	I	Wood	White	-0.4	QM
118	011	LowerBath	B	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
119	011	LowerBath	D	Cabinet		Lft	I	Wood	Varnish	0.2	QM
----- End of Readings -----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 14:21
 Total Readings: 119
 Job Started: 09/04/13 14:21
 Job Finished: 09/04/13 15:01

USCG Elizabeth City
 Housing Units
 340 Pelican Street- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
008	A	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
006	C	Baseboard	Ctr		I	Wood	White	0.1	QM
005	C	Ceiling			I	Drywall	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
014	D	Stairs	Lft	Treads	I	Wood	Varnish	-0.1	QM
012	D	Stairs	Lft	Risers	I	Wood	White	-0.1	QM
013	D	Stairs	Lft	Stringer	I	Wood	White	-0.1	QM
009	D	Closet	Ctr	Door	I	Wood	White	-0.3	QM
010	D	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
011	D	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
Interior Room 002 Bedroom A/B									
015	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
023	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
024	A	Window	Ctr	Sill	I	Wood	White	-0.3	QM
016	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
017	C	Wall	L Ctr		I	Drywall	White	0.1	QM
019	C	Ceiling			I	Drywall	White	-1.0	QM
018	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
020	D	Baseboard	Ctr		I	Wood	White	-0.3	QM
021	D	Door	Lft	Lft casing	I	Wood	White	-0.1	QM
022	D	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
Interior Room 003 Kitchen									
025	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
026	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
030	B	Baseboard	Ctr		I	Vinyl	Black	-0.6	QM
031	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
027	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
029	C	Ceiling			I	Drywall	White	-0.3	QM
028	D	Wall	L Ctr		I	Drywall	White	0.1	QM
Interior Room 004 Living/Din									
032	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
033	B	Wall	L Ctr		I	Drywall	White	0.2	QM
034	C	Wall	L Ctr		I	Drywall	White	0.2	QM
036	C	Ceiling			I	Drywall	White	-0.1	QM
040	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
041	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM
038	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
039	C	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
035	D	Wall	L Ctr		I	Drywall	White	0.0	QM
037	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
Interior Room 005 UpperHall									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
042	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
052	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
053	A	Attic Hatch	Ctr		I	Wood	White	0.0	QM
043	B	Wall	L Ctr		I	Drywall	White	0.0	QM
044	C	Wall	L Ctr		I	Drywall	White	0.1	QM
046	C	Ceiling			I	Drywall	White	-0.2	QM
045	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
047	D	Baseboard	Rgt		I	Wood	White	-0.5	QM
049	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
048	D	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
050	D	Closet	Ctr	Shelf	I	Wood	White	-1.0	QM
051	D	WallCap	Ctr		I	Wood	White	-0.2	QM
Interior Room 006 UpperBedA									
054	A	Wall	L Ctr		I	Drywall	White	0.2	QM
059	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
062	A	Window	Lft	Sash	I	Wood	White	0.0	QM
063	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
055	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
056	C	Wall	L Ctr		I	Drywall	White	0.1	QM
058	C	Ceiling			I	Drywall	White	-0.3	QM
060	C	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
061	C	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
057	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
064	D	Closet	Rgt	Shelf	I	Wood	White	-0.2	QM
Interior Room 007 MasterBath									
070	A	Wall	L Lft		I	Ceramic	Tan	4.4	QM
065	A	Wall	U Ctr		I	Drywall	White	0.0	QM
071	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.5	QM
072	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
066	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
067	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
069	C	Ceiling			I	Drywall	White	0.2	QM
075	C	Bathtub	Ctr		I	Porcelain	White	-0.1	QM
068	D	Wall	U Ctr		I	Drywall	White	0.1	QM
073	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
074	D	Sink	Rgt		I	Porcelain	White	-0.5	QM
Interior Room 008 UpperBath									
081	A	Wall	L Lft		I	Ceramic	Tan	4.2	QM
076	A	Wall	U Ctr		I	Drywall	White	0.2	QM
086	A	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
077	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
084	B	Cabinet	Rgt		I	Wood	White	-0.2	QM
085	B	Sink	Rgt		I	Porcelain	White	-1.8	QM
078	C	Wall	U Ctr		I	Drywall	White	-0.4	QM
080	C	Ceiling			I	Drywall	White	-0.5	QM
079	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
082	D	Door	Ctr	Rgt casing	I	Wood	White	-0.9	QM
083	D	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
Interior Room 009 UpperBedB/C									
087	A	Wall	L Ctr		I	Drywall	White	0.0	QM
092	A	Baseboard	Ctr		I	Wood	White	0.0	QM
097	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
098	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
088	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
089	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
091	C	Ceiling			I	Drywall	White	-0.1	QM
095	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
096	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
090	D	Wall	L Ctr		I	Drywall	White	0.0	QM
093	D	Door	Rgt	Lft jamb	I	Wood	White	0.1	QM
094	D	Door	Rgt	U Ctr	I	Wood	White	0.2	QM
Interior Room 010 UpperBedC/D									
099	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
104	A	Baseboard	Ctr		I	Wood	White	0.1	QM
105	A	Door	Rgt	Rgt casing	I	Wood	White	0.3	QM
106	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
109	A	Closet	Lft	Door	I	Wood	White	-0.5	QM
110	A	Closet	Lft	Shelf	I	Wood	White	-0.6	QM
100	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
101	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
103	C	Ceiling			I	Drywall	White	0.1	QM
107	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
108	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
102	D	Wall	L Ctr		I	Drywall	White	0.2	QM
Interior Room 011 LowerBath									
111	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
116	A	Baseboard	Ctr		I	Wood	White	0.0	QM
112	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
117	B	Door	Rgt	Rgt casing	I	Wood	White	-0.4	QM
118	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
113	C	Wall	L Ctr		I	Drywall	White	0.3	QM
115	C	Ceiling			I	Drywall	White	-0.6	QM
114	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
119	D	Cabinet	Lft		I	Wood	Varnish	0.2	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 14:21
 Total Reading Sets: 119
 Job Started: 09/04/13 14:21
 Job Finished: 09/04/13 15:01

USCG Elizabeth City
 Housing Units
 340 Pelican Street- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Attic Hatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	9	0 <0%>	9 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	4	0 <0%>	4 <100%>	0 <0%>	
Closet Door Casing	2	0 <0%>	2 <100%>	0 <0%>	
Closet Shelf	4	0 <0%>	4 <100%>	0 <0%>	
Closet Shelf Sup.	1	0 <0%>	1 <100%>	0 <0%>	
Door Lft casing	1	0 <0%>	1 <100%>	0 <0%>	
Door Lft jamb	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Door Rgt jamb	1	0 <0%>	1 <100%>	0 <0%>	
Door U Ctr	9	0 <0%>	9 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Wall	46	2 <4%>	44 <96%>	0 <0%>	
WallCap	1	0 <0%>	1 <100%>	0 <0%>	
Window Rgt casing	3	0 <0%>	3 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Window Sill	2	0 <0%>	2 <100%>	0 <0%>	
Inspection Totals:	119	2 < 2%>	117 < 98%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 13:30

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
373 Mariner Court- Interior


INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____

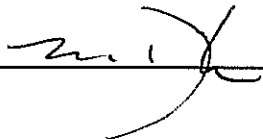

Date: _____

9/11/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
Report Date: 9/10/2013
Abatement Level: 1.0
Report No. 09/04/13 13:30
Total Readings: 128 Actionable: 1
Job Started: 09/04/13 13:30
Job Finished: 09/04/13 14:16

USCG Elizabeth City
Housing Units
373 Mariner Court- Interior

Reading					Paint			Lead	
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	Mode
Interior Room 008 UpperBath									
091	C	Bathtub	Ctr		I	Porcelain	White	>9.9	QM
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 13:30
 Total Readings: 128
 Job Started: 09/04/13 13:30
 Job Finished: 09/04/13 14:16

USCG Elizabeth City
 Housing Units
 373 Mariner Court- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stair	A	Wall	L	Ctr	I	Drywall	White	0.2	QM
2	001	Hall/Stair	B	Wall	L	Ctr	I	Drywall	White	-0.6	QM
3	001	Hall/Stair	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
4	001	Hall/Stair	D	Wall	L	Ctr	I	Drywall	White	-0.6	QM
5	001	Hall/Stair	C	Ceiling			I	Drywall	White	-0.5	QM
6	001	Hall/Stair	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
7	001	Hall/Stair	A	Door		Lft Rgt casing	I	Wood	White	0.0	QM
8	001	Hall/Stair	A	Door		Lft Rgt jamb	I	Wood	White	0.1	QM
9	001	Hall/Stair	A	Door		Lft U Lft	I	Metal	White	0.0	QM
10	001	Hall/Stair	A	Window		Rgt Rgt casing	I	Wood	White	-0.2	QM
11	001	Hall/Stair	A	Window		Rgt Sill	I	Wood	White	0.1	QM
12	001	Hall/Stair	C	Stairs		Ctr Stringer	I	Wood	White	0.2	QM
13	001	Hall/Stair	D	Stairs		Ctr Risers	I	Wood	White	0.1	QM
14	001	Hall/Stair	B	Stairs		Ctr Wall	I	Wood	White	0.0	QM
15	001	Hall/Stair	D	Stairs		Ctr Treads	I	Wood	Varnish	0.2	QM
16	001	Hall/Stair	D	Stairs		Ctr Railing cap	I	Wood	Varnish	0.2	QM
17	002	Room A/B	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
18	002	Room A/B	B	Wall	L	Ctr	I	Drywall	White	0.2	QM
19	002	Room A/B	C	Wall	L	Ctr	I	Drywall	White	0.1	QM
20	002	Room A/B	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
21	002	Room A/B	C	Ceiling			I	Drywall	White	0.0	QM
22	002	Room A/B	C	Baseboard		Ctr	I	Wood	White	-0.4	QM
23	002	Room A/B	D	Door		Lft Rgt casing	I	Wood	White	0.1	QM
24	002	Room A/B	D	Door		Lft Rgt jamb	I	Wood	White	0.0	QM
25	002	Room A/B	D	Door		Lft U Ctr	I	Wood	White	-0.3	QM
26	002	Room A/B	A	Window		Ctr Rgt casing	I	Wood	White	0.5	QM
27	002	Room A/B	A	Window		Ctr Sash	I	Wood	White	0.3	QM
28	002	Room A/B	A	Window		Ctr Sill	I	Wood	White	-0.1	QM
29	003	Kitchen	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
30	003	Kitchen	B	Wall	L	Ctr	I	Drywall	White	0.0	QM
31	003	Kitchen	C	Wall	L	Ctr	I	Drywall	White	0.2	QM
32	003	Kitchen	D	Wall	L	Ctr	I	Drywall	White	-0.2	QM
33	003	Kitchen	A	Ceiling			I	Drywall	White	-0.2	QM
34	003	Kitchen	C	Baseboard		Ctr	I	Wood	White	0.1	QM
35	003	Kitchen	A	Cabinet		Ctr	I	Wood	Varnish	-0.1	QM
36	004	Living/Din	A	Wall	L	Ctr	I	Drywall	White	0.2	QM
37	004	Living/Din	B	Wall	L	Ctr	I	Drywall	White	-0.8	QM
38	004	Living/Din	C	Wall	L	Ctr	I	Drywall	White	0.1	QM
39	004	Living/Din	D	Wall	L	Ctr	I	Drywall	White	-0.4	QM
40	004	Living/Din	C	Ceiling			I	Drywall	White	-0.5	QM
41	004	Living/Din	C	Baseboard		Ctr	I	Wood	White	-0.5	QM
42	004	Living/Din	C	Door		Ctr Rgt casing	I	Wood	White	0.2	QM
43	004	Living/Din	C	Door		Ctr Rgt jamb	I	Wood	White	0.2	QM
44	004	Living/Din	C	Door		Ctr U Ctr	I	Metal	White	-0.2	QM
45	004	Living/Din	C	Window		Rgt Rgt casing	I	Wood	White	0.0	QM
46	004	Living/Din	C	Window		Rgt Sash	I	Wood	White	0.0	QM
47	004	Living/Din	C	Window		Rgt Sill	I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	BedroomD/A	A	Wall	L	Ctr	I	Drywall	White	-0.1	QM
49	005	BedroomD/A	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
50	005	BedroomD/A	C	Wall	L	Ctr	I	Drywall	White	-0.4	QM
51	005	BedroomD/A	D	Wall	L	Ctr	I	Drywall	White	0.1	QM
52	005	BedroomD/A	C	Ceiling			I	Drywall	White	-0.5	QM
53	005	BedroomD/A	C	Baseboard		Ctr	I	Wood	White	-0.1	QM
54	005	BedroomD/A	B	Door		Rgt Rgt casing	I	Wood	White	-0.6	QM
55	005	BedroomD/A	B	Door		Rgt Rgt jamb	I	Wood	White	0.0	QM
56	005	BedroomD/A	B	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
57	005	BedroomD/A	D	Cabinet		Lft	I	Wood	Varnish	0.1	QM
58	005	BedroomD/A	A	Cabinet		Ctr	I	Wood	Varnish	-0.3	QM
59	006	UpperBedA/B	A	Wall	L	Ctr	I	Drywall	White	-0.4	QM
60	006	UpperBedA/B	B	Wall	L	Ctr	I	Drywall	White	-0.1	QM
61	006	UpperBedA/B	C	Wall	L	Ctr	I	Drywall	White	-0.2	QM
62	006	UpperBedA/B	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
63	006	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.1	QM
64	006	UpperBedA/B	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
65	006	UpperBedA/B	C	Closet		Ctr Door Casing	I	Wood	White	-0.4	QM
66	006	UpperBedA/B	C	Closet		Ctr Door Jamb	I	Wood	White	-0.1	QM
67	006	UpperBedA/B	C	Closet		Ctr Door	I	Wood	White	-0.5	QM
68	006	UpperBedA/B	A	Window		Ctr Rgt casing	I	Wood	White	0.0	QM
69	006	UpperBedA/B	A	Window		Ctr Sash	I	Wood	White	-0.5	QM
70	006	UpperBedA/B	A	Window		Ctr Sill	I	Wood	White	-0.5	QM
71	006	UpperBedA/B	D	Closet		Ctr Shelf Sup.	I	Wood	White	-0.4	QM
72	007	MasterBath	A	Wall	L	Ctr	I	Drywall	White	-0.3	QM
73	007	MasterBath	B	Wall	L	Ctr	I	Drywall	White	-0.6	QM
74	007	MasterBath	C	Wall	L	Ctr	I	Drywall	White	-0.3	QM
75	007	MasterBath	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
76	007	MasterBath	C	Ceiling			I	Drywall	White	-0.8	QM
77	007	MasterBath	C	Baseboard		Ctr	I	Wood	White	-0.9	QM
78	007	MasterBath	A	Door		Rgt Rgt casing	I	Wood	White	-0.7	QM
79	007	MasterBath	A	Door		Rgt Rgt jamb	I	Wood	White	-0.7	QM
80	007	MasterBath	A	Door		Rgt U Ctr	I	Wood	White	-0.7	QM
81	007	MasterBath	D	Cabinet		Rgt	I	Wood	White	-1.2	QM
82	008	UpperBath	A	Wall	L	Ctr	I	Drywall	White	-0.4	QM
83	008	UpperBath	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM
84	008	UpperBath	C	Wall	L	Ctr	I	Drywall	White	-0.1	QM
85	008	UpperBath	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
86	008	UpperBath	C	Ceiling			I	Drywall	White	-0.2	QM
87	008	UpperBath	C	Baseboard		Ctr	I	Wood	White	0.0	QM
88	008	UpperBath	D	Door		Rgt Rgt casing	I	Wood	White	-0.3	QM
89	008	UpperBath	D	Door		Rgt Rgt jamb	I	Wood	White	-0.4	QM
90	008	UpperBath	D	Door		Rgt U Lft	I	Wood	White	-0.2	QM
91	008	UpperBath	C	Bathtub		Ctr	I	Porcelain	White	>9.9	QM
92	009	UpperBedB/C	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
93	009	UpperBedB/C	B	Wall	L	Ctr	I	Drywall	White	0.2	QM
94	009	UpperBedB/C	C	Wall	L	Ctr	I	Drywall	White	0.1	QM
95	009	UpperBedB/C	D	Wall	L	Ctr	I	Drywall	White	0.0	QM
96	009	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.1	QM
97	009	UpperBedB/C	C	Baseboard		Ctr	I	Wood	White	-0.3	QM
98	009	UpperBedB/C	D	Door		Rgt Rgt casing	I	Wood	White	-0.3	QM
99	009	UpperBedB/C	D	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
100	009	UpperBedB/C	D	Door		Rgt U Ctr	I	Wood	White	-0.1	QM
101	009	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.3	QM
102	009	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	C	Window		Ctr Sill	I	Wood	White	-0.3	QM
104	009	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	0.1	QM
105	010	UpperBedC/D	A	Wall		L Ctr	I	Drywall	White	-0.2	QM
106	010	UpperBedC/D	B	Wall		L Ctr	I	Drywall	White	-0.1	QM
107	010	UpperBedC/D	C	Wall		L Ctr	I	Drywall	White	0.0	QM
108	010	UpperBedC/D	D	Wall		L Ctr	I	Drywall	White	-0.3	QM
109	010	UpperBedC/D	B	Ceiling			I	Drywall	White	-0.1	QM
110	010	UpperBedC/D	C	Baseboard		Ctr	I	Wood	White	-0.4	QM
111	010	UpperBedC/D	A	Door		Rgt Rgt casing	I	Wood	White	-0.1	QM
112	010	UpperBedC/D	A	Door		Rgt Rgt jamb	I	Wood	White	-0.1	QM
113	010	UpperBedC/D	A	Door		Rgt U Ctr	I	Wood	White	0.2	QM
114	010	UpperBedC/D	C	Window		Ctr Rgt casing	I	Wood	White	-0.2	QM
115	010	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	0.0	QM
116	010	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	0.1	QM
117	010	UpperBedC/D	A	Closet		Lft Shelf	I	Wood	White	-0.1	QM
118	010	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	-0.3	QM
119	011	UpperHall	A	Wall		L Ctr	I	Drywall	White	-0.5	QM
120	011	UpperHall	B	Wall		L Ctr	I	Drywall	White	-0.3	QM
121	011	UpperHall	C	Wall		L Ctr	I	Drywall	White	-0.1	QM
122	011	UpperHall	D	Wall		L Ctr	I	Drywall	White	0.0	QM
123	011	UpperHall	C	Ceiling			I	Drywall	White	-0.1	QM
124	011	UpperHall	C	Baseboard		Ctr	I	Wood	White	-0.2	QM
125	011	UpperHall	B	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
126	011	UpperHall	B	Door		Lft Rgt jamb	I	Wood	White	-0.2	QM
127	011	UpperHall	B	Door		Lft U Ctr	I	Wood	White	-0.2	QM
128	011	UpperHall	A	AccessHatch		Ctr	I	Wood	White	0.2	QM
----- End of Readings -----											

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	373 Mariner Court- Interior
Report No.	09/04/13 13:30	
Total Readings:	128	
Job Started:	09/04/13 13:30	
Job Finished:	09/04/13 14:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stair									
001	A	Wall	L Ctr		I	Drywall	White	0.2	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
011	A	Window	Rgt	Sill	I	Wood	White	0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
009	A	Door	Lft	U Lft	I	Metal	White	0.0	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
014	B	Stairs	Ctr	Wall	I	Wood	White	0.0	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
005	C	Ceiling			I	Drywall	White	-0.5	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
015	D	Stairs	Ctr	Treads	I	Wood	Varnish	0.2	QM
013	D	Stairs	Ctr	Risers	I	Wood	White	0.1	QM
016	D	Stairs	Ctr	Railing cap	I	Wood	Varnish	0.2	QM
Interior Room 002 Room A/B									
017	A	Wall	L Ctr		I	Drywall	White	0.0	QM
026	A	Window	Ctr	Rgt casing	I	Wood	White	0.5	QM
027	A	Window	Ctr	Sash	I	Wood	White	0.3	QM
028	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
018	B	Wall	L Ctr		I	Drywall	White	0.2	QM
019	C	Wall	L Ctr		I	Drywall	White	0.1	QM
022	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
021	C	Ceiling			I	Drywall	White	0.0	QM
020	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
024	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
023	D	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
025	D	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
Interior Room 003 Kitchen									
029	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
033	A	Ceiling			I	Drywall	White	-0.2	QM
035	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
030	B	Wall	L Ctr		I	Drywall	White	0.0	QM
031	C	Wall	L Ctr		I	Drywall	White	0.2	QM
034	C	Baseboard	Ctr		I	Wood	White	0.1	QM
032	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Living/Din									
036	A	Wall	L Ctr		I	Drywall	White	0.2	QM
037	B	Wall	L Ctr		I	Drywall	White	-0.8	QM
038	C	Wall	L Ctr		I	Drywall	White	0.1	QM
041	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
040	C	Ceiling			I	Drywall	White	-0.5	QM
045	C	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
046	C	Window	Rgt	Sash	I	Wood	White	0.0	QM
047	C	Window	Rgt	Sill	I	Wood	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
043	C	Door	Ctr	Rgt jamb	I	Wood	White	0.2	QM
042	C	Door	Ctr	Rgt casing	I	Wood	White	0.2	QM
044	C	Door	Ctr	U Ctr	I	Metal	White	-0.2	QM
039	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 005 BedroomD/A									
048	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
058	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
049	B	Wall	L Ctr		I	Drywall	White	0.1	QM
055	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
054	B	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
056	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
050	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
053	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
052	C	Ceiling			I	Drywall	White	-0.5	QM
051	D	Wall	L Ctr		I	Drywall	White	0.1	QM
057	D	Cabinet	Lft		I	Wood	Varnish	0.1	QM
Interior Room 006 UpperBedA/B									
059	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
068	A	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
069	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
070	A	Window	Ctr	Sill	I	Wood	White	-0.5	QM
060	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
061	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
064	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
063	C	Ceiling			I	Drywall	White	-0.1	QM
067	C	Closet	Ctr	Door	I	Wood	White	-0.5	QM
065	C	Closet	Ctr	Door Casing	I	Wood	White	-0.4	QM
066	C	Closet	Ctr	Door Jamb	I	Wood	White	-0.1	QM
062	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
071	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.4	QM
Interior Room 007 MasterBath									
072	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
079	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.7	QM
078	A	Door	Rgt	Rgt casing	I	Wood	White	-0.7	QM
080	A	Door	Rgt	U Ctr	I	Wood	White	-0.7	QM
073	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
074	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
077	C	Baseboard	Ctr		I	Wood	White	-0.9	QM
076	C	Ceiling			I	Drywall	White	-0.8	QM
075	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
081	D	Cabinet	Rgt		I	Wood	White	-1.2	QM
Interior Room 008 UpperBath									
082	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
083	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
084	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
087	C	Baseboard	Ctr		I	Wood	White	0.0	QM
086	C	Ceiling			I	Drywall	White	-0.2	QM
091	C	Bathtub	Ctr		I	Porcelain	White	>9.9	QM
085	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
089	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.4	QM
088	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
090	D	Door	Rgt	U Lft	I	Wood	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 009 UpperBedB/C									
092	A	Wall	L Ctr		I	Drywall	White	0.0	QM
096	A	Ceiling			I	Drywall	White	-0.1	QM
104	A	Closet	Rgt	Door	I	Wood	White	0.1	QM
093	B	Wall	L Ctr		I	Drywall	White	0.2	QM
094	C	Wall	L Ctr		I	Drywall	White	0.1	QM
097	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
101	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
102	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
103	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
095	D	Wall	L Ctr		I	Drywall	White	0.0	QM
099	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
098	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
100	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Interior Room 010 UpperBedC/D									
105	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
111	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
113	A	Door	Rgt	U Ctr	I	Wood	White	0.2	QM
118	A	Closet	Lft	Door	I	Wood	White	-0.3	QM
117	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
106	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
109	B	Ceiling			I	Drywall	White	-0.1	QM
107	C	Wall	L Ctr		I	Drywall	White	0.0	QM
110	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
114	C	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
115	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
116	C	Window	Ctr	Sill	I	Wood	White	0.1	QM
108	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 011 UpperHall									
119	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
128	A	AccessHatch	Ctr		I	Wood	White	0.2	QM
120	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
126	B	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
125	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
127	B	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
121	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
124	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
123	C	Ceiling			I	Drywall	White	-0.1	QM
122	D	Wall	L Ctr		I	Drywall	White	0.0	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/04/13 13:30
 Total Reading Sets: 128
 Job Started: 09/04/13 13:30
 Job Finished: 09/04/13 14:16

USCG Elizabeth City
 Housing Units
 373 Mariner Court- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
AccessHatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	11	0 <0%>	11 <100%>	0 <0%>	
Bathtub	1	1 <100%>	0 <0%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	3	0 <0%>	3 <100%>	0 <0%>	
Closet Door Casing	1	0 <0%>	1 <100%>	0 <0%>	
Closet Door Jamb	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf Sup.	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	9	0 <0%>	9 <100%>	0 <0%>	
Door Rgt jamb	9	0 <0%>	9 <100%>	0 <0%>	
Door U Ctr	7	0 <0%>	7 <100%>	0 <0%>	
Door U Lft	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Railing cap	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Wall	1	0 <0%>	1 <100%>	0 <0%>	
Wall	44	0 <0%>	44 <100%>	0 <0%>	
Window Rgt casing	6	0 <0%>	6 <100%>	0 <0%>	
Window Sash	5	0 <0%>	5 <100%>	0 <0%>	
Window Sill	6	0 <0%>	6 <100%>	0 <0%>	
Inspection Totals:	128	1 < 1%>	127 < 99%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 09:41

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
222 Albatross Street- Interior

INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____



Date: _____

9-11-13

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
Report Date: 9/23/2013
Abatement Level: 1.0
Report No. 09/05/13 09:41
Total Readings: 124 Actionable: 2
Job Started: 09/05/13 09:41
Job Finished: 09/05/13 10:17

USCG Elizabeth City
Housing Units
222 Albatross Street- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 008 MasterBath									
081	C	Wall	L Ctr		I	Ceramic	Tan	5.1	QM
Interior Room 011 UpperBath									
119	A	Wall	L Lft		I	Ceramic	Tan	4.6	QM
----- End of Readings -----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/23/2013
 Abatement Level: 1.0
 Report No. 09/05/13 09:41
 Total Readings: 124
 Job Started: 09/05/13 09:41
 Job Finished: 09/05/13 10:17

USCG Elizabeth City
 Housing Units
 222 Albatross Street- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Hall/Stair									
001	A	Wall	L Ctr		I	Drywall	White	0.2	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	0.2	QM
008	A	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
014	B	Stairs	Rgt	Treads	I	Wood	Varnish	-0.3	QM
012	B	Stairs	Rgt	Risers	I	Wood	White	0.1	QM
013	B	Stairs	Rgt	Stringer	I	Wood	White	0.0	QM
009	B	Closet	Ctr	Door	P	Wood	White	-0.1	QM
010	B	Closet	Ctr	Door Casing	I	Wood	White	0.0	QM
011	B	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
005	C	Ceiling			I	Drywall	White	0.0	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
006	D	Baseboard	Ctr		I	Wood	White	0.2	QM
Interior Room 002 LowerBath									
015	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
020	A	Baseboard	Ctr		I	Wood	White	0.0	QM
016	B	Wall	L Ctr		I	Drywall	White	0.0	QM
023	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
017	C	Wall	L Ctr		I	Drywall	White	0.0	QM
019	C	Ceiling			I	Drywall	White	-0.5	QM
018	D	Wall	L Ctr		I	Drywall	White	0.0	QM
021	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
022	D	Door	Lft	U Ctr	I	Wood	White	0.1	QM
Interior Room 003 Living/Din									
024	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
029	A	Baseboard	Ctr		I	Wood	White	-0.2	QM
025	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
026	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
028	C	Ceiling			I	Drywall	White	-0.5	QM
032	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
030	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
031	C	Door	Rgt	U Ctr	I	Metal	White	-0.4	QM
033	C	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
027	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Kitchen									
034	A	Wall	L Ctr		I	Drywall	White	0.0	QM
038	A	Ceiling			I	Drywall	White	-0.1	QM
040	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
035	B	Wall	L Ctr		I	Drywall	White	0.2	QM
036	C	Wall	L Ctr		I	Drywall	White	0.1	QM
037	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
039	D	Baseboard	Ctr		I	Vinyl	Black	0.0	QM
Interior Room 005 LowerBedD/A									
041	A	Wall	L Ctr		I	Drywall	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
049	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
050	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
051	A	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
042	B	Wall	L Ctr		I	Drywall	White	0.0	QM
047	B	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
048	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
043	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
045	C	Ceiling			I	Drywall	White	-0.2	QM
044	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
046	D	Baseboard	Ctr		I	Wood	White	0.0	QM
Interior Room 006 UpperHall									
052	A	Wall	L Ctr		I	Drywall	White	0.0	QM
062	A	Attic Casing	Ctr		I	Wood	White	-0.3	QM
063	A	Attic Hatch	Ctr		I	Wood	White	-0.5	QM
053	B	Wall	L Ctr		I	Drywall	White	0.2	QM
059	B	Closet	Ctr	Door	I	Wood	White	-0.6	QM
058	B	Closet	Ctr	Door Casing	I	Wood	White	-0.5	QM
060	B	Closet	Ctr	Door Jamb	I	Wood	White	-0.8	QM
061	B	WallCap	Lft		I	Wood	White	-0.5	QM
054	C	Wall	L Ctr		I	Drywall	White	0.1	QM
056	C	Ceiling			I	Drywall	White	0.1	QM
055	D	Wall	L Ctr		I	Drywall	White	0.1	QM
057	D	Baseboard	Lft		I	Wood	White	0.2	QM
Interior Room 007 UpperBedA									
064	A	Wall	L Ctr		I	Drywall	White	-1.2	QM
069	A	Baseboard	Ctr		I	Wood	White	-0.2	QM
072	A	Window	Rgt	Rgt casing	I	Wood	White	-0.8	QM
073	A	Window	Rgt	Sill	I	Wood	White	-0.5	QM
074	A	Mini Blinds	Rgt		I	Vinyl	White	-1.0	QM
065	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
076	B	Closet	Lft	Shelf Sup.	I	Wood	White	-0.4	QM
075	B	Closet	Lft	Shelf	I	Wood	White	-0.3	QM
066	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
068	C	Ceiling			I	Drywall	White	-0.3	QM
070	C	Door	Lft	Lft casing	I	Wood	White	-0.4	QM
071	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
067	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 008 MasterBath									
077	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
083	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
084	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
078	B	Wall	U Ctr		I	Drywall	White	-0.4	QM
085	B	Cabinet	Lft		I	Wood	White	-0.3	QM
086	B	Sink	Lft		I	Porcelain	White	-0.4	QM
081	C	Wall	L Ctr		I	Ceramic	Tan	5.1	QM
079	C	Wall	U Ctr		I	Drywall	White	-0.8	QM
082	C	Ceiling			I	Drywall	White	-0.4	QM
087	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
080	D	Wall	U Ctr		I	Drywall	White	-0.8	QM
Interior Room 009 UpperBedB/C									
088	A	Wall	L Ctr		I	Drywall	White	0.0	QM
093	A	Baseboard	Ctr		I	Wood	White	0.0	QM
094	A	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
095	A	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
099	A	Closet	Rgt	Door	I	Wood	White	-0.4	QM
100	A	Closet	Rgt	Shelf	I	Wood	White	-0.6	QM
089	B	Wall	L Ctr		I	Drywall	White	0.1	QM
090	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
092	C	Ceiling			I	Drywall	White	-0.2	QM
096	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
097	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
098	C	Mini Blinds	Ctr		I	Vinyl	White	-0.3	QM
091	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 010 UpperBedC/D									
101	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
112	A	Closet	Lft	Door	I	Wood	White	0.0	QM
113	A	Closet	Lft	Shelf Sup.	I	Wood	White	-0.5	QM
102	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
107	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
108	B	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
103	C	Wall	L Ctr		I	Drywall	White	-1.0	QM
105	C	Ceiling			I	Drywall	White	-0.5	QM
109	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
110	C	Window	Ctr	Sill	I	Wood	White	0.0	QM
111	C	Mini Blinds	Ctr		I	Vinyl	White	-0.6	QM
104	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
106	D	Baseboard	Ctr		I	Wood	White	-0.3	QM
Interior Room 011 UpperBath									
119	A	Wall	L Lft		I	Ceramic	Tan	4.6	QM
114	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
124	A	Bathtub	Ctr		I	Porcelain	White	-0.4	QM
115	B	Wall	U Ctr		I	Drywall	White	-0.6	QM
122	B	Cabinet	Lft		I	Wood	White	-0.3	QM
123	B	Sink	Lft		I	Porcelain	White	-0.7	QM
116	C	Wall	U Lft		I	Drywall	White	-0.2	QM
118	C	Ceiling			I	Drywall	White	-1.1	QM
117	D	Wall	U Ctr		I	Drywall	White	-0.3	QM
120	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
121	D	Door	Lft	U Ctr	I	Wood	White	-0.6	QM
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/23/2013
 Abatement Level: 1.0
 Report No. 09/05/13 09:41
 Total Readings: 124
 Job Started: 09/05/13 09:41
 Job Finished: 09/05/13 10:17

USCG Elizabeth City
 Housing Units
 222 Albatross Street- Interior

Read No.	Rm No.	Room Name	Wall Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stair	A Wall	L Ctr		I Drywall		White	0.2	QM
2	001	Hall/Stair	B Wall	L Ctr		I Drywall		White	-0.5	QM
3	001	Hall/Stair	C Wall	L Ctr		I Drywall		White	-0.1	QM
4	001	Hall/Stair	D Wall	L Ctr		I Drywall		White	-0.3	QM
5	001	Hall/Stair	C Ceiling			I Drywall		White	0.0	QM
6	001	Hall/Stair	D Baseboard		Ctr	I Wood		White	0.2	QM
7	001	Hall/Stair	A Door		Ctr Rgt casing	I Wood		White	0.2	QM
8	001	Hall/Stair	A Door		Ctr U Ctr	I Metal		White	-0.1	QM
9	001	Hall/Stair	B Closet		Ctr Door	P Wood		White	-0.1	QM
10	001	Hall/Stair	B Closet		Ctr Door Casing	I Wood		White	0.0	QM
11	001	Hall/Stair	B Closet		Ctr Shelf	I Wood		White	-0.4	QM
12	001	Hall/Stair	B Stairs		Rgt Risers	I Wood		White	0.1	QM
13	001	Hall/Stair	B Stairs		Rgt Stringer	I Wood		White	0.0	QM
14	001	Hall/Stair	B Stairs		Rgt Treads	I Wood		Varnish	-0.3	QM
15	002	LowerBath	A Wall	L Ctr		I Drywall		White	-0.1	QM
16	002	LowerBath	B Wall	L Ctr		I Drywall		White	0.0	QM
17	002	LowerBath	C Wall	L Ctr		I Drywall		White	0.0	QM
18	002	LowerBath	D Wall	L Ctr		I Drywall		White	0.0	QM
19	002	LowerBath	C Ceiling			I Drywall		White	-0.5	QM
20	002	LowerBath	A Baseboard		Ctr	I Wood		White	0.0	QM
21	002	LowerBath	D Door		Lft Rgt jamb	I Wood		White	-0.1	QM
22	002	LowerBath	D Door		Lft U Ctr	I Wood		White	0.1	QM
23	002	LowerBath	B Cabinet		Rgt	I Wood		Varnish	-0.1	QM
24	003	Living/Din	A Wall	L Ctr		I Drywall		White	-0.4	QM
25	003	Living/Din	B Wall	L Ctr		I Drywall		White	-0.1	QM
26	003	Living/Din	C Wall	L Ctr		I Drywall		White	-0.1	QM
27	003	Living/Din	D Wall	L Ctr		I Drywall		White	-0.1	QM
28	003	Living/Din	C Ceiling			I Drywall		White	-0.5	QM
29	003	Living/Din	A Baseboard		Ctr	I Wood		White	-0.2	QM
30	003	Living/Din	C Door		Rgt Rgt casing	I Wood		White	0.0	QM
31	003	Living/Din	C Door		Rgt U Ctr	I Metal		White	-0.4	QM
32	003	Living/Din	C Window		Ctr Rgt casing	I Wood		White	0.0	QM
33	003	Living/Din	C Mini Blinds		Ctr	I Vinyl		White	-0.2	QM
34	004	Kitchen	A Wall	L Ctr		I Drywall		White	0.0	QM
35	004	Kitchen	B Wall	L Ctr		I Drywall		White	0.2	QM
36	004	Kitchen	C Wall	L Ctr		I Drywall		White	0.1	QM
37	004	Kitchen	D Wall	L Ctr		I Drywall		White	-0.4	QM
38	004	Kitchen	A Ceiling			I Drywall		White	-0.1	QM
39	004	Kitchen	D Baseboard		Ctr	I Vinyl		Black	0.0	QM
40	004	Kitchen	A Cabinet		Ctr	I Wood		Varnish	-0.1	QM
41	005	LowerBedD/A	A Wall	L Ctr		I Drywall		White	-0.3	QM
42	005	LowerBedD/A	B Wall	L Ctr		I Drywall		White	0.0	QM
43	005	LowerBedD/A	C Wall	L Ctr		I Drywall		White	-0.4	QM
44	005	LowerBedD/A	D Wall	L Ctr		I Drywall		White	-0.2	QM
45	005	LowerBedD/A	C Ceiling			I Drywall		White	-0.2	QM
46	005	LowerBedD/A	D Baseboard		Ctr	I Wood		White	0.0	QM
47	005	LowerBedD/A	B Door		Rgt Rgt casing	I Wood		White	0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	LowerBedD/A	B	Door		Rgt U Ctr	I	Wood	White	-0.2	QM
49	005	LowerBedD/A	A	Window		Ctr Rgt casing	I	Wood	White	-0.1	QM
50	005	LowerBedD/A	A	Window		Ctr Sash	I	Wood	White	0.0	QM
51	005	LowerBedD/A	A	Mini Blinds		Ctr	I	Vinyl	White	-0.4	QM
52	006	UpperHall	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
53	006	UpperHall	B	Wall	L	Ctr	I	Drywall	White	0.2	QM
54	006	UpperHall	C	Wall	L	Ctr	I	Drywall	White	0.1	QM
55	006	UpperHall	D	Wall	L	Ctr	I	Drywall	White	0.1	QM
56	006	UpperHall	C	Ceiling			I	Drywall	White	0.1	QM
57	006	UpperHall	D	Baseboard		Lft	I	Wood	White	0.2	QM
58	006	UpperHall	B	Closet		Ctr Door Casing	I	Wood	White	-0.5	QM
59	006	UpperHall	B	Closet		Ctr Door	I	Wood	White	-0.6	QM
60	006	UpperHall	B	Closet		Ctr Door Jamb	I	Wood	White	-0.8	QM
61	006	UpperHall	B	WallCap		Lft	I	Wood	White	-0.5	QM
62	006	UpperHall	A	Attic Casing		Ctr	I	Wood	White	-0.3	QM
63	006	UpperHall	A	Attic Hatch		Ctr	I	Wood	White	-0.5	QM
64	007	UpperBedA	A	Wall	L	Ctr	I	Drywall	White	-1.2	QM
65	007	UpperBedA	B	Wall	L	Ctr	I	Drywall	White	-0.3	QM
66	007	UpperBedA	C	Wall	L	Ctr	I	Drywall	White	-0.5	QM
67	007	UpperBedA	D	Wall	L	Ctr	I	Drywall	White	-0.5	QM
68	007	UpperBedA	C	Ceiling			I	Drywall	White	-0.3	QM
69	007	UpperBedA	A	Baseboard		Ctr	I	Wood	White	-0.2	QM
70	007	UpperBedA	C	Door		Lft Lft casing	I	Wood	White	-0.4	QM
71	007	UpperBedA	C	Door		Lft U Ctr	I	Wood	White	-0.2	QM
72	007	UpperBedA	A	Window		Rgt Rgt casing	I	Wood	White	-0.8	QM
73	007	UpperBedA	A	Window		Rgt Sill	I	Wood	White	-0.5	QM
74	007	UpperBedA	A	Mini Blinds		Rgt	I	Vinyl	White	-1.0	QM
75	007	UpperBedA	B	Closet		Lft Shelf	I	Wood	White	-0.3	QM
76	007	UpperBedA	B	Closet		Lft Shelf Sup.	I	Wood	White	-0.4	QM
77	008	MasterBath	A	Wall	U	Ctr	I	Drywall	White	-0.5	QM
78	008	MasterBath	B	Wall	U	Ctr	I	Drywall	White	-0.4	QM
79	008	MasterBath	C	Wall	U	Ctr	I	Drywall	White	-0.8	QM
80	008	MasterBath	D	Wall	U	Ctr	I	Drywall	White	-0.8	QM
81	008	MasterBath	C	Wall	L	Ctr	I	Ceramic	Tan	5.1	QM
82	008	MasterBath	C	Ceiling			I	Drywall	White	-0.4	QM
83	008	MasterBath	A	Door		Lft Rgt casing	I	Wood	White	-0.3	QM
84	008	MasterBath	A	Door		Lft U Ctr	I	Wood	White	-0.1	QM
85	008	MasterBath	B	Cabinet		Lft	I	Wood	White	-0.3	QM
86	008	MasterBath	B	Sink		Lft	I	Porcelain	White	-0.4	QM
87	008	MasterBath	C	Bathtub		Ctr	I	Porcelain	White	-0.5	QM
88	009	UpperBedB/C	A	Wall	L	Ctr	I	Drywall	White	0.0	QM
89	009	UpperBedB/C	B	Wall	L	Ctr	I	Drywall	White	0.1	QM
90	009	UpperBedB/C	C	Wall	L	Ctr	I	Drywall	White	-0.1	QM
91	009	UpperBedB/C	D	Wall	L	Ctr	I	Drywall	White	-0.1	QM
92	009	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.2	QM
93	009	UpperBedB/C	A	Baseboard		Ctr	I	Wood	White	0.0	QM
94	009	UpperBedB/C	A	Door		Lft Rgt jamb	I	Wood	White	-0.4	QM
95	009	UpperBedB/C	A	Door		Lft U Ctr	I	Wood	White	-0.4	QM
96	009	UpperBedB/C	C	Window		Ctr Rgt casing	I	Wood	White	-0.4	QM
97	009	UpperBedB/C	C	Window		Ctr Sash	I	Wood	White	-0.4	QM
98	009	UpperBedB/C	C	Mini Blinds		Ctr	I	Vinyl	White	-0.3	QM
99	009	UpperBedB/C	A	Closet		Rgt Door	I	Wood	White	-0.4	QM
100	009	UpperBedB/C	A	Closet		Rgt Shelf	I	Wood	White	-0.6	QM
101	010	UpperBedC/D	A	Wall	L	Ctr	I	Drywall	White	-0.6	QM
102	010	UpperBedC/D	B	Wall	L	Ctr	I	Drywall	White	-0.4	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
103	010	UpperBedC/D	C	Wall	L	Ctr	I	Drywall	White	-1.0	QM
104	010	UpperBedC/D	D	Wall	L	Ctr	I	Drywall	White	-0.3	QM
105	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.5	QM
106	010	UpperBedC/D	D	Baseboard		Ctr	I	Wood	White	-0.3	QM
107	010	UpperBedC/D	B	Door		Lft Rgt jamb	I	Wood	White	-0.1	QM
108	010	UpperBedC/D	B	Door		Lft U Ctr	I	Wood	White	-0.3	QM
109	010	UpperBedC/D	C	Window		Ctr Sash	I	Wood	White	-0.3	QM
110	010	UpperBedC/D	C	Window		Ctr Sill	I	Wood	White	0.0	QM
111	010	UpperBedC/D	C	Mini Blinds		Ctr	I	Vinyl	White	-0.6	QM
112	010	UpperBedC/D	A	Closet		Lft Door	I	Wood	White	0.0	QM
113	010	UpperBedC/D	A	Closet		Lft Shelf Sup.	I	Wood	White	-0.5	QM
114	011	UpperBath	A	Wall		U Ctr	I	Drywall	White	-0.5	QM
115	011	UpperBath	B	Wall		U Ctr	I	Drywall	White	-0.6	QM
116	011	UpperBath	C	Wall		U Lft	I	Drywall	White	-0.2	QM
117	011	UpperBath	D	Wall		U Ctr	I	Drywall	White	-0.3	QM
118	011	UpperBath	C	Ceiling			I	Drywall	White	-1.1	QM
119	011	UpperBath	A	Wall	L	Lft	I	Ceramic	Tan	4.6	QM
120	011	UpperBath	D	Door		Lft Rgt casing	I	Wood	White	-0.1	QM
121	011	UpperBath	D	Door		Lft U Ctr	I	Wood	White	-0.6	QM
122	011	UpperBath	B	Cabinet		Lft	I	Wood	White	-0.3	QM
123	011	UpperBath	B	Sink		Lft	I	Porcelain	White	-0.7	QM
124	011	UpperBath	A	Bathtub		Ctr	I	Porcelain	White	-0.4	QM
----- End of Readings -----											

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/23/2013
 Abatement Level: 1.0
 Report No. 09/05/13 09:41
 Total Reading Sets: 124
 Job Started: 09/05/13 09:41
 Job Finished: 09/05/13 10:17

USCG Elizabeth City
 Housing Units
 222 Albatross Street- Interior

Structure	Total	Structure Distribution			
		Positive	Negative	Inconclusive	
Attic Casing	1	0 <0%>	1 <100%>	0 <0%>	
Attic Hatch	1	0 <0%>	1 <100%>	0 <0%>	
Baseboard	9	0 <0%>	9 <100%>	0 <0%>	
Bathtub	2	0 <0%>	2 <100%>	0 <0%>	
Cabinet	4	0 <0%>	4 <100%>	0 <0%>	
Ceiling	11	0 <0%>	11 <100%>	0 <0%>	
Closet Door	4	0 <0%>	4 <100%>	0 <0%>	
Closet Door Casing	2	0 <0%>	2 <100%>	0 <0%>	
Closet Door Jamb	1	0 <0%>	1 <100%>	0 <0%>	
Closet Shelf	3	0 <0%>	3 <100%>	0 <0%>	
Closet Shelf Sup.	2	0 <0%>	2 <100%>	0 <0%>	
Door Lft casing	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	5	0 <0%>	5 <100%>	0 <0%>	
Door Rgt jamb	3	0 <0%>	3 <100%>	0 <0%>	
Door U Ctr	9	0 <0%>	9 <100%>	0 <0%>	
Mini Blinds	5	0 <0%>	5 <100%>	0 <0%>	
Sink	2	0 <0%>	2 <100%>	0 <0%>	
Stairs Risers	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Stringer	1	0 <0%>	1 <100%>	0 <0%>	
Stairs Treads	1	0 <0%>	1 <100%>	0 <0%>	
Wall	46	2 <4%>	44 <96%>	0 <0%>	
WallCap	1	0 <0%>	1 <100%>	0 <0%>	
Window Rgt casing	4	0 <0%>	4 <100%>	0 <0%>	
Window Sash	3	0 <0%>	3 <100%>	0 <0%>	
Window Sill	2	0 <0%>	2 <100%>	0 <0%>	
Inspection Totals:	124	2 < 2%>	122 < 98%>	0 < 0%>	

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 11:07

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
Housing/Maintenance Building-
Interior


INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____

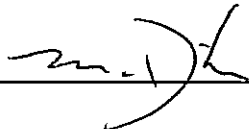

Date: _____

9/11/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
Report Date: 9/10/2013
Abatement Level: 1.0
Report No. 09/05/13 11:07
Total Readings: 41 Actionable: 1
Job Started: 09/05/13 11:07
Job Finished: 09/05/13 11:33

USCG Elizabeth City
Housing Units
Housing/Maintenance Building-
Interior

Reading					Paint			Lead	
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm²)	Mode
Interior Room 003 Bathroom									
024	C	Sink	Rgt		I	Porcelain	White	>9.9	QM
Calibration Readings									
----- End of Readings -----									

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/05/13
 Report Date: 9/10/2013
 Abatement Level: 1.0
 Report No. 09/05/13 11:07
 Total Readings: 41
 Job Started: 09/05/13 11:07
 Job Finished: 09/05/13 11:33

USCG Elizabeth City
 Housing Units
 Housing/Maintenance Building-
 Interior

Read No.	Rm No.	Room Name	Wall Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
1	001	Office	A Wall	L Ctr		I Wood	Panel		-0.1	QM
2	001	Office	C Baseboard	Ctr		I Wood	White		-0.1	QM
3	001	Office	B Window	Ctr Sash		I Metal	Brown		-0.3	QM
4	001	Office	A Door	Ctr Rgt casing		I Metal	White		0.0	QM
5	001	Office	A Door	Ctr Rgt jamb		I Metal	White		0.2	QM
6	001	Office	A Door	Ctr U Ctr		P Wood	White		-0.1	QM
7	002	VehicleBay	A Wall	L Ctr		I Cindrblock	White		0.2	QM
8	002	VehicleBay	B Wall	L Ctr		I Cindrblock	White		-0.2	QM
9	002	VehicleBay	C Wall	L Ctr		I Cindrblock	White		-0.2	QM
		Mechanical room door.								
10	002	VehicleBay	D Wall	L Ctr		I Cindrblock	White		-0.2	QM
11	002	VehicleBay	A Ceiling			I Drywall	White		-0.3	QM
12	002	VehicleBay	D Crown Mldg	Ctr		I Wood	White		-0.1	QM
13	002	VehicleBay	D Window	Rgt Rgt casing		I Metal	Brown		-0.3	QM
14	002	VehicleBay	B Door	Ctr Rgt casing		I Metal	White		-0.1	QM
15	002	VehicleBay	B Door	Ctr Rgt jamb		I Metal	White		0.0	QM
16	002	VehicleBay	B Door	Ctr U Ctr		I Metal	White		-0.1	QM
		Carport								
17	003	Bathroom	A Wall	L Ctr		I Cindrblock	White		-0.1	QM
		Carport								
18	003	Bathroom	B Wall	L Ctr		I Cindrblock	White		-0.1	QM
		Carport								
19	003	Bathroom	C Wall	L Rgt		I Cindrblock	White		-0.1	QM
20	003	Bathroom	D Wall	L Ctr		I Cindrblock	White		-0.1	QM
21	003	Bathroom	D Door	Ctr Rgt casing		I Metal	White		0.0	QM
22	003	Bathroom	D Door	Ctr Rgt jamb		I Metal	White		0.3	QM
23	003	Bathroom	D Door	Ctr U Ctr		I Metal	White		0.0	QM
24	003	Bathroom	C Sink	Rgt		I Porcelain	White		>9.9	QM
25	003	Bathroom	C Cabinet	Rgt		P Wood	White		-0.1	QM
26	004	Storage	A Wall	U Ctr		I Vinyl	White		-0.1	QM
27	004	Storage	B Wall	U Ctr		I Wood	White		-0.2	QM
28	004	Storage	C Wall	U Ctr		I Wood	White		-0.2	QM
29	004	Storage	D Wall	U Ctr		I Wood	White		-0.1	QM
30	004	Storage	A Ceiling			I Wood	White		-0.2	QM
31	004	Storage	C Door	Ctr Rgt casing		I Metal	White		0.0	QM
32	004	Storage	C Door	Ctr Rgt jamb		I Metal	White		-0.1	QM
33	004	Storage	C Door	Ctr U Ctr		I Metal	White		-0.1	QM
34	004	Storage	A Cabinet	Rgt		I Wood	White		-0.1	QM
35	004	Storage	D Lockers	Ctr		I Wood	Green		-0.1	QM
36		CALIBRATION							1.0	QM
37		CALIBRATION							1.0	QM
38		CALIBRATION							1.0	QM
39		CALIBRATION							-0.2	QM
40		CALIBRATION							-0.1	QM
41		CALIBRATION							0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	Housing/Maintenance Building-
Report No.	09/05/13 11:07	Interior
Total Readings:	41	
Job Started:	09/05/13 11:07	
Job Finished:	09/05/13 11:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
Interior Room 001 Office									
001	A	Wall	L Ctr		I	Wood	Panel	-0.1	QM
005	A	Door	Ctr	Rgt jamb	I	Metal	White	0.2	QM
004	A	Door	Ctr	Rgt casing	I	Metal	White	0.0	QM
006	A	Door	Ctr	U Ctr	P	Wood	White	-0.1	QM
003	B	Window	Ctr	Sash	I	Metal	Brown	-0.3	QM
002	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
Interior Room 002 VehicleBay									
007	A	Wall	L Ctr		I	Cindrblock	White	0.2	QM
011	A	Ceiling			I	Drywall	White	-0.3	QM
008	B	Wall	L Ctr		I	Cindrblock	White	-0.2	QM
015	B	Door	Ctr	Rgt jamb	I	Metal	White	0.0	QM
014	B	Door	Ctr	Rgt casing	I	Metal	White	-0.1	QM
016	B	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
Carport									
009	C	Wall	L Ctr		I	Cindrblock	White	-0.2	QM
Mechanical room door.									
010	D	Wall	L Ctr		I	Cindrblock	White	-0.2	QM
013	D	Window	Rgt	Rgt casing	I	Metal	Brown	-0.3	QM
012	D	Crown Mldg	Ctr		I	Wood	White	-0.1	QM
Interior Room 003 Bathroom									
017	A	Wall	L Ctr		I	Cindrblock	White	-0.1	QM
Carport									
018	B	Wall	L Ctr		I	Cindrblock	White	-0.1	QM
Carport									
019	C	Wall	L Rgt		I	Cindrblock	White	-0.1	QM
024	C	Sink	Rgt		I	Porcelain	White	>9.9	QM
025	C	Cabinet	Rgt		P	Wood	White	-0.1	QM
020	D	Wall	L Ctr		I	Cindrblock	White	-0.1	QM
022	D	Door	Ctr	Rgt jamb	I	Metal	White	0.3	QM
021	D	Door	Ctr	Rgt casing	I	Metal	White	0.0	QM
023	D	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
Interior Room 004 Storage									
026	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
030	A	Ceiling			I	Wood	White	-0.2	QM
034	A	Cabinet	Rgt		I	Wood	White	-0.1	QM
027	B	Wall	U Ctr		I	Wood	White	-0.2	QM
028	C	Wall	U Ctr		I	Wood	White	-0.2	QM
032	C	Door	Ctr	Rgt jamb	I	Metal	White	-0.1	QM
031	C	Door	Ctr	Rgt casing	I	Metal	White	0.0	QM
033	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
029	D	Wall	U Ctr		I	Wood	White	-0.1	QM
035	D	Lockers	Ctr		I	Wood	Green	-0.1	QM
Calibration Readings									
036								1.0	QM
037								1.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm ²)	Mode
038								1.0	QM
039								-0.2	QM
040								-0.1	QM
041								0.2	QM
----- End of Readings -----									

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	Housing/Maintenance Building-
Report No.	09/05/13 11:07	Interior
Total Reading Sets:	35	
Job Started:	09/05/13 11:07	
Job Finished:	09/05/13 11:33	

Structure	Total	----- Structure Distribution -----			
		Positive	Negative	Inconclusive	
Baseboard	1	0 <0%>	1 <100%>	0 <0%>	
Cabinet	2	0 <0%>	2 <100%>	0 <0%>	
Ceiling	2	0 <0%>	2 <100%>	0 <0%>	
Crown Mldg	1	0 <0%>	1 <100%>	0 <0%>	
Door Rgt casing	4	0 <0%>	4 <100%>	0 <0%>	
Door Rgt jamb	4	0 <0%>	4 <100%>	0 <0%>	
Door U Ctr	4	0 <0%>	4 <100%>	0 <0%>	
Lockers	1	0 <0%>	1 <100%>	0 <0%>	
Sink	1	1 <100%>	0 <0%>	0 <0%>	
Wall	13	0 <0%>	13 <100%>	0 <0%>	
Window Rgt casing	1	0 <0%>	1 <100%>	0 <0%>	
Window Sash	1	0 <0%>	1 <100%>	0 <0%>	
Inspection Totals:	35	1 < 3%>	34 < 97%>	0 < 0%>	



United States Coast Guard
Housing Units in Elizabeth City, North Carolina
Environmental Compliance Due Diligence Report

APPENDIX C

LEAD IN SOIL SAMPLING REPORT



United States Coast Guard
Housing Units in Elizabeth City, North Carolina
Lead in Soil Sampling Report

FINAL

Lead in Soil Sampling Report

U.S. Coast Guard Elizabeth City Housing Units
250 to 390 Gulfstream Drive
380 to 394 Hercules Court
370 to 381 Mariner Court
340 to 350 Pelican Street
200 to 250 Albatross Street
Elizabeth City, North Carolina 27909

Contract No. GS-00P-08-CY-A-0045/Award No. GS-P-00-13-CY-5050

Prepared For:

United States General Services Administration
Office of Real Property Utilization and Disposal
1800 F Street, NW
Washington, DC 20405

Prepared By:

AMEC Environment & Infrastructure, Inc.
46850 Magellan Drive, Suite 190
Novi, Michigan 48377

April 2014

AMEC Project No: GSA1570024

Date of Site Visit: 03-06 September, 2013

Erica Geasler-Bromley, P.E.
Project Manager

John Maas
Environmental Scientist



TABLE OF CONTENTS

1.0	INTRODUCTION.....	1-1
2.0	LEAD IN SOIL	2-1
2.1	EQUIPMENT DECONTAMINATION.....	2-1
2.2	INVESTIGATION-DERIVED WASTE.....	2-1
2.3	ANALYTICAL RESULTS.....	2-1
3.0	RECOMMENDATIONS	3-1

TABLES

Table 1	Lead in Soil Analytical Results
---------	---------------------------------

ATTACHMENTS

Attachment A	Lead in Soil Analytical Results Maps
Attachment B	Lead in Soil Laboratory Analytical Results



1.0 INTRODUCTION

Prior to the late 1970s many paints contained lead. When these paints become damaged, i.e., peeling or flaking, or the painted surface is renovated or demolished, lead can be released into the environment constituting an environmental and worker health hazard. Depending on the age of structures, LBP may potentially exist, either exposed or covered over with other paints or materials as a result of subsequent renovation. Flaking or peeling paint that could be lead-based should be removed or encapsulated appropriately. Based on the age of the Site, it is possible that LBP was used for painting the interior and exterior of the walls of the structures.



2.0 LEAD IN SOIL

In accordance with the Scope of Work (SOW), AMEC collected two soil samples per exterior structure wall. Soil sample locations were within five feet (drip line) of each exterior wall. A total of 220 soil samples were collected. Two soil samples were collected at each location, at the surface (0 inches bgs) and 6 inches bgs. The samples were containerized and shipped under standard chain of custody procedures to CT Laboratories, Inc. located in Baraboo, Wisconsin. The samples were submitted for total lead analysis by United States Environmental Protection Agency (USEPA) SW-846 Method 6010C.

2.1 EQUIPMENT DECONTAMINATION

Equipment used for field sampling activities was decontaminated prior to mobilization as well as before and after each use following the procedures specified below.

1. Equipment was washed with distilled bottled water and laboratory grade Alconox™ detergent;
2. Equipment was rinsed with distilled or deionized water; and,
3. Information was recorded concerning decontamination methodology, data, time, and personnel in the field log book.

2.2 INVESTIGATION-DERIVED WASTE

Investigation-derived waste (IDW) generated during field investigation activities included a de-minimus quantity of soil cuttings and decontamination water (less than 5 gallons of each). Soil cuttings were returned to the borehole location. Used disposable equipment and protective clothing were double bagged in polyethylene trash bags and disposed of as general refuse. Decontamination water was released to the ground surface in the area of generation.

2.3 ANALYTICAL RESULTS

Following receipt of the analytical laboratory report, AMEC compared the soil analytical results to the USEPA Residential Direct Contact Clean up Level Criterion and the North Carolina Department of Environment and Natural Resources (NCDENR) Residential Direct Contact Criterion of 400 milligrams per kilogram (mg/kg) (ppm). Soil analytical results indicated that lead was detected in concentrations ranging between 1.6 mg/kg and 133 mg/kg, with no sample exceeding USEPA or NCDENR action levels. Lead in soil analytical results are summarized in **Table 1** below. Lead in soil analytical results map is included in **Attachment A**. The laboratory analytical report is included in **Attachment B**.



Table 1: Lead in Soil Analytical Results

Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-001 (0-0.5')	13.7
ELIZ-SS-002 (0-0.5')	17.4
ELIZ-SS-003 (0-0.5')	4.8
ELIZ-SS-004 (0-0.5')	6.1
ELIZ-SS-005 (0-0.5')	14.2
ELIZ-SS-006 (0-0.5')	11.0
ELIZ-SS-007 (0-0.5')	8.5
ELIZ-SS-008 (0-0.5')	6.9
ELIZ-SS-009 (0-0.5')	13.4
ELIZ-SS-010 (0-0.5')	8.0
ELIZ-SS-011 (0-0.5')	6.8
ELIZ-SS-012 (0-0.5')	6.0
ELIZ-SS-013 (0-0.5')	9.3
ELIZ-SS-014 (0-0.5')	6.5
ELIZ-SS-015 (0-0.5')	10.1
ELIZ-SS-016 (0-0.5')	6.4
ELIZ-SS-017 (0-0.5')	4.4
ELIZ-SS-018 (0-0.5')	4.8
ELIZ-SS-019 (0-0.5')	7.2
ELIZ-SS-020 (0-0.5')	6.2
ELIZ-SS-021 (0-0.5')	10.1
ELIZ-SS-022 (0-0.5')	9.3
ELIZ-SS-023 (0-0.5')	8.8
ELIZ-SS-024 (0-0.5')	9.0
ELIZ-SS-025 (0-0.5')	8.1
ELIZ-SS-026 (0-0.5')	15.5
ELIZ-SS-027 (0-0.5')	2.9
ELIZ-SS-028 (0-0.5')	9.0
ELIZ-SS-029 (0-0.5')	7.6
ELIZ-SS-030 (0-0.5')	2.6
ELIZ-SS-031 (0-0.5')	7.4
ELIZ-SS-032 (0-0.5')	7.7
ELIZ-SS-033 (0-0.5')	8.8
ELIZ-SS-034 (0-0.5')	5.2
ELIZ-SS-035 (0-0.5')	10.5
ELIZ-SS-036 (0-0.5')	14.7
ELIZ-SS-037 (0-0.5')	25.5
ELIZ-SS-038 (0-0.5')	12.5
ELIZ-SS-039 (0-0.5')	10.1
ELIZ-SS-040 (0-0.5')	14.9
ELIZ-SS-041 (0-0.5')	21.1
ELIZ-SS-042 (0-0.5')	9.3
ELIZ-SS-043 (0-0.5')	10.4
ELIZ-SS-044 (0-0.5')	11.2
ELIZ-SS-045 (0-0.5')	7.0

Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-001 (0.5-1')	7.3
ELIZ-SS-002 (0.5-1')	7.9
ELIZ-SS-003 (0.5-1')	6.1
ELIZ-SS-004 (0.5-1')	4.8
ELIZ-SS-005 (0.5-1')	8.4
ELIZ-SS-006 (0.5-1')	8.5
ELIZ-SS-007 (0.5-1')	7.4
ELIZ-SS-008 (0.5-1')	8.1
ELIZ-SS-009 (0.5-1')	6.1
ELIZ-SS-010 (0.5-1')	7.3
ELIZ-SS-011 (0.5-1')	7.8
ELIZ-SS-012 (0.5-1')	5.2
ELIZ-SS-013 (0.5-1')	9.5
ELIZ-SS-014 (0.5-1')	12.3
ELIZ-SS-015 (0.5-1')	8.2
ELIZ-SS-016 (0.5-1')	7.5
ELIZ-SS-017 (0.5-1')	7.1
ELIZ-SS-018 (0.5-1')	7.6
ELIZ-SS-019 (0.5-1')	9.5
ELIZ-SS-020 (0.5-1')	5.6
ELIZ-SS-021 (0.5-1')	14.7
ELIZ-SS-022 (0.5-1')	4.7
ELIZ-SS-023 (0.5-1')	7.6
ELIZ-SS-024 (0.5-1')	7.6
ELIZ-SS-025 (0.5-1')	5.6
ELIZ-SS-026 (0.5-1')	5.8
ELIZ-SS-027 (0.5-1')	6.1
ELIZ-SS-028 (0.5-1')	5.5
ELIZ-SS-029 (0.5-1')	8.8
ELIZ-SS-030 (0.5-1')	8.7
ELIZ-SS-031 (0.5-1')	7.9
ELIZ-SS-032 (0.5-1')	6.8
ELIZ-SS-033 (0.5-1')	7.9
ELIZ-SS-034 (0.5-1')	7.6
ELIZ-SS-035 (0.5-1')	8.5
ELIZ-SS-036 (0.5-1')	10.2
ELIZ-SS-037 (0.5-1')	10.1
ELIZ-SS-038 (0.5-1')	10.1
ELIZ-SS-039 (0.5-1')	8.5
ELIZ-SS-040 (0.5-1')	10.6
ELIZ-SS-041 (0.5-1')	6.3
ELIZ-SS-042 (0.5-1')	9.9
ELIZ-SS-043 (0.5-1')	8.6
ELIZ-SS-044 (0.5-1')	9.8
ELIZ-SS-045 (0.5-1')	11.3



Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-046 (0-0.5')	11.9
ELIZ-SS-047 (0-0.5')	9.0
ELIZ-SS-048 (0-0.5')	11.8
ELIZ-SS-049 (0-0.5')	24.4
ELIZ-SS-050 (0-0.5')	12.6
ELIZ-SS-051 (0-0.5')	6.0
ELIZ-SS-052 (0-0.5')	16.8
ELIZ-SS-053 (0-0.5')	14.4
ELIZ-SS-054 (0-0.5')	6.6
ELIZ-SS-055 (0-0.5')	17.0
ELIZ-SS-056 (0-0.5')	25.3
ELIZ-SS-057 (0-0.5')	10.9
ELIZ-SS-058 (0-0.5')	34.1
ELIZ-SS-059 (0-0.5')	76.2
ELIZ-SS-060 (0-0.5')	13.7
ELIZ-SS-061 (0-0.5')	10.5
ELIZ-SS-062 (0-0.5')	11.0
ELIZ-SS-063 (0-0.5')	16.4
ELIZ-SS-064 (0-0.5')	19.9
ELIZ-SS-065 (0-0.5')	9.7
ELIZ-SS-066 (0-0.5')	15.8
ELIZ-SS-067 (0-0.5')	84.4
ELIZ-SS-068 (0-0.5')	8.5
ELIZ-SS-069 (0-0.5')	10.0
ELIZ-SS-070 (0-0.5')	25.5
ELIZ-SS-071 (0-0.5')	8.7
ELIZ-SS-072 (0-0.5')	6.2
ELIZ-SS-073 (0-0.5')	10.0
ELIZ-SS-074 (0-0.5')	9.8
ELIZ-SS-075 (0-0.5')	5.6
ELIZ-SS-076 (0-0.5')	5.7
ELIZ-SS-077 (0-0.5')	6.9
ELIZ-SS-078 (0-0.5')	6.0
ELIZ-SS-079 (0-0.5')	7.0
ELIZ-SS-080 (0-0.5')	13.0
ELIZ-SS-081 (0-0.5')	14.5
ELIZ-SS-082 (0-0.5')	8.9
ELIZ-SS-083 (0-0.5')	9.2
ELIZ-SS-084 (0-0.5')	7.9
ELIZ-SS-085 (0-0.5')	10.6
ELIZ-SS-086 (0-0.5')	6.4
ELIZ-SS-087 (0-0.5')	5.4
ELIZ-SS-088 (0-0.5')	14.2
ELIZ-SS-089 (0-0.5')	4.7
ELIZ-SS-090 (0-0.5')	9.8
ELIZ-SS-091 (0-0.5')	7.6
ELIZ-SS-092 (0-0.5')	9.1
ELIZ-SS-093 (0-0.5')	133

Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-046 (0.5-1')	7.3
ELIZ-SS-047 (0.5-1')	5.4
ELIZ-SS-048 (0.5-1')	3.1
ELIZ-SS-049 (0.5-1')	4.0
ELIZ-SS-050 (0.5-1')	2.8
ELIZ-SS-051 (0.5-1')	1.9
ELIZ-SS-052 (0.5-1')	10.7
ELIZ-SS-053 (0.5-1')	8.8
ELIZ-SS-054 (0.5-1')	6.5
ELIZ-SS-055 (0.5-1')	5.5
ELIZ-SS-056 (0.5-1')	10.7
ELIZ-SS-057 (0.5-1')	2.1
ELIZ-SS-058 (0.5-1')	3.9
ELIZ-SS-059 (0.5-1')	5.5
ELIZ-SS-060 (0.5-1')	3.6
ELIZ-SS-061 (0.5-1')	5.3
ELIZ-SS-062 (0.5-1')	10.8
ELIZ-SS-063 (0.5-1')	10.4
ELIZ-SS-064 (0.5-1')	20.4
ELIZ-SS-065 (0.5-1')	5.8
ELIZ-SS-066 (0.5-1')	10.9
ELIZ-SS-067 (0.5-1')	18.4
ELIZ-SS-068 (0.5-1')	8.7
ELIZ-SS-069 (0.5-1')	6.1
ELIZ-SS-070 (0.5-1')	9.5
ELIZ-SS-071 (0.5-1')	7.1
ELIZ-SS-072 (0.5-1')	7.3
ELIZ-SS-073 (0.5-1')	11.5
ELIZ-SS-074 (0.5-1')	6.1
ELIZ-SS-075 (0.5-1')	7.4
ELIZ-SS-076 (0.5-1')	8.8
ELIZ-SS-077 (0.5-1')	8.6
ELIZ-SS-078 (0.5-1')	8.5
ELIZ-SS-079 (0.5-1')	6.5
ELIZ-SS-080 (0.5-1')	8.8
ELIZ-SS-081 (0.5-1')	9.1
ELIZ-SS-082 (0.5-1')	7.4
ELIZ-SS-083 (0.5-1')	7.2
ELIZ-SS-084 (0.5-1')	18.7
ELIZ-SS-085 (0.5-1')	5.1
ELIZ-SS-086 (0.5-1')	8.5
ELIZ-SS-087 (0.5-1')	8.4
ELIZ-SS-088 (0.5-1')	9.6
ELIZ-SS-089 (0.5-1')	7.3
ELIZ-SS-090 (0.5-1')	7.3
ELIZ-SS-091 (0.5-1')	4.8
ELIZ-SS-092 (0.5-1')	6.2
ELIZ-SS-093 (0.5-1')	6.7



Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-094 (0-0.5')	8.4
ELIZ-SS-095 (0-0.5')	5.9
ELIZ-SS-096 (0-0.5')	4.2
ELIZ-SS-097 (0-0.5')	1.6
ELIZ-SS-098 (0-0.5')	7.9
ELIZ-SS-099 (0-0.5')	4.4
ELIZ-SS-100 (0-0.5')	13.9
ELIZ-SS-101 (0-0.5')	7.9
ELIZ-SS-102 (0-0.5')	12.2
ELIZ-SS-103 (0-0.5')	4.7
ELIZ-SS-104 (0-0.5')	6.8
ELIZ-SS-105 (0-0.5')	13.1
ELIZ-SS-106 (0-0.5')	6.1
ELIZ-SS-107 (0-0.5')	4.0
ELIZ-SS-108 (0-0.5')	10.8
ELIZ-SS-109 (0-0.5')	11.3
ELIZ-SS-110 (0-0.5')	10.7
USEPA and NCDENR Residential Direct Contact Criterion for Lead	400

Sample Name	Lead in Soil Concentration (mg/kg)
ELIZ-SS-094 (0.5-1')	6.9
ELIZ-SS-095 (0.5-1')	6.1
ELIZ-SS-096 (0.5-1')	8.4
ELIZ-SS-097 (0.5-1')	7.9
ELIZ-SS-098 (0.5-1')	9.3
ELIZ-SS-099 (0.5-1')	4.5
ELIZ-SS-100 (0.5-1')	5.3
ELIZ-SS-101 (0.5-1')	7.2
ELIZ-SS-102 (0.5-1')	6.0
ELIZ-SS-103 (0.5-1')	5.5
ELIZ-SS-104 (0.5-1')	7.0
ELIZ-SS-105 (0.5-1')	9.9
ELIZ-SS-106 (0.5-1')	6.0
ELIZ-SS-107 (0.5-1')	4.0
ELIZ-SS-108 (0.5-1')	6.8
ELIZ-SS-109 (0.5-1')	7.5
ELIZ-SS-110 (0.5-1')	5.0
USEPA and NCDENR Residential Direct Contact Criterion for Lead	400



3.0 RECOMMENDATIONS

Soil analytical results indicated that lead was not detected at concentrations exceeding the USEPA or the NCDENR residential direct contact criteria; therefore, there are no recommendations.



United States Coast Guard
Housing Units in Elizabeth City, North Carolina
Lead in Soil Sampling Report

ATTACHMENT A

LEAD IN SOIL ANALYTICAL RESULTS MAPS

